

**International  
Progress Report**

**IPR-05-35**

# **Äspö Hard Rock Laboratory**

## **Canister Retrieval Test**

**Sensors data report  
(Period 001026-051101)  
Report No:11**

Reza Goudarzi

Lennart Börgesson

Clay Technology AB

Kennert Röshoff

Martin Edelman

BBK

November 2005

***Svensk Kärnbränslehantering AB***

Swedish Nuclear Fuel  
and Waste Management Co  
Box 5864  
SE-102 40 Stockholm Sweden  
Tel 08-459 84 00  
+46 8 459 84 00  
Fax 08-661 57 19  
+46 8 661 57 19





Report no.	No.
IPR-05-35	F69K
Author	Date
Reza Goudarzi	November 2005
Lennart Börgesson	
Kennert Röshoff	
Martin Edelman	
Checked by	Date
Lennart Börgesson	2006-01-11
Approved	Date
Anders Sjöland	2006-01-12

# Äspö Hard Rock Laboratory

## Canister Retrieval Test

**Sensors data report  
(Period 001026-051101)  
Report No:11**

Reza Goudarzi  
Lennart Börgesson  
Clay Technology AB

Kennert Röshoff  
Martin Edelman  
BBK

November 2005

**Keywords:** Buffer, Bentonite, Rock, Temperature, Stress, Strain, Test, Measurements, Swelling, Full scale, In-situ

This report concerns a study which was conducted for SKB. The conclusions and viewpoints presented in the report are those of the author(s) and do not necessarily coincide with those of the client.



# **Abstract**

This report presents data from the measurements in the Canister Retrieval Test from 001026 to 051101.

The following measurements are made in the bentonite: Temperature is measured in 32 points, total pressure in 27 points, pore water pressure in 14 points and relative humidity in 55 points. Temperature is also measured by all relative humidity gauges. The positions of the measuring points in the bentonite are related to a coordinate system in the deposition hole.

The following measurements are made in the rock: Temperature is measured in 40 points, stresses are measured in 8 points and strain is measured in 9 points. Stresses and strains are also measured in the rock around the empty deposition hole located 6 m south of the test hole.

The following measurements are made in the canister: Temperature is measured every meter along two fiber optic cables and strain is measured in 76 points on the surface of the copper envelop. Temperature is measured in the steel insert in 18 points.

The following measurements are made on the plug: Force is measured in 3 of the 9 anchors and vertical displacement is measured in three points.

The water inflow to the filter mats on the rock surface is also measured.

The general conclusion is that the measuring systems and transducers seem to work well except for the heaters and the transducers inside the canister and Kulite pressure transducers. The strain measurements in the canister are not reported due to question marks regarding the relevance of the results.

Most Vaisala relative humidity transducers have stopped yielding results due to full water saturation. Four out of six Kulite total pressure transducers seem to yield erroneous results. All temperature sensors inside the canister have stopped functioning.

The heat power of the canister has successively been reduced due to failure of heaters. After the latest failure in March only 4 out of 36 heaters were still working and the power was kept constant at about 1150 W. On October 11 (day 1811) the power was switched off in order to prepare for the dismantling, excavation and retrieval of the test, which will start in the beginning of 2006.

The water pressure in the mats attached to the deposition hole wall was reduced to atmospheric in March 2005 in order to try to keep the last heaters alive, which resulted in that the water inflow stopped as well as the increase in the force acting on the plug.



# Sammanfattning

I denna rapport presenteras data från mätningar i Återtag under perioden 001026-051101.

Följande mätningar görs i bentoniten: Temperaturen mäts i 32 punkter, totaltryck i 27 punkter, porvattentryck i 14 punkter och relativa fuktigheten i 55 punkter. Temperaturen mäts även i alla relativa fuktighetsmätare. Varje mätpunkt relateras till ett koordinatsystem i deponeringshålet.

Följande mätningar görs i berget: Temperaturen mäts i 40 punkter, bergspänningar mäts i 8 punkter och töjningar i 9 punkter. Bergspänningar och töjningar mäts också i berget runt det tomma deponeringshållet 6 m söder om försökshållet.

Följande mätningar görs på ytan i kapselns kopparhölje: Temperaturen mäts varje meter längs två fiberoptiska kablar och töjning mäts i 76 punkter. Temperaturen mäts i stålinsatsen i kanistern i 18 punkter.

Följande mätningar görs på pluggen: Kraften mäts i 3 av de 9 stagen och vertikala förskjutningen mäts i tre punkter.

Vatteninflödet till filtermattorna mäts också.

En generell slutsats är att mätsystemen och givarna tycks fungera bra förutom givarna inuti kapseln och Kulites givare. Töjningsmätningarna i kapseln har inte redovisats p. g. a frågetecken beträffande mätresultatens relevans.

De flesta av Visalas relativa fuktighetsmätare, har slutat fungera p. g. a. hög vattenmättnadsgrad. Fyra av sex Kulite totaltrycksgivare tycks ge felaktiga resultat idag. Alla temperaturgivare inuti kapslen har slutat fungera.

Värmeeffekten i kapslen har succesivt reducerats p.g.a. att värmarna gått sönder. Efter det sista avbrottet som skedde i mars fungerar bara 4 av 36 värmare och effekten har sedan dess hållts till c:a 1150 W. Den 11 oktober 2005 (dag 1811) stängdes effekten av för att förbereda för brytning av försöket och demonstration av åtretaget. Brytningen skall starta i början av 2006.

Vattentrycket i bevätningssmattorna på deponeringshålsväggen sänktes till atmosfärstryck i mars 2005 i ett försök att hålla de sista värmarna vid liv, vilket fick till följd att vatteninflödet upphörde liksom ökningen av krafterna på pluggen.



# Contents

<b>1</b>	<b>Introduction</b>	<b>9</b>
<b>2</b>	<b>Comments</b>	<b>11</b>
2.1	General	11
2.2	Total pressure, Geocon (App. A pages 35-38)	12
2.3	Total Pressure, Kulite (App. A page 39)	12
2.4	Suction, Wescore Psychrometers (App. A pages 40-49)	12
2.5	Relative humidity, Vaisala (App. A pages 50-54)	12
2.6	Pore water pressure, Geocon (App. A pages 55-56)	13
2.7	Pore water pressure, Kulite (App. A page 57)	13
2.8	Water flow into the filters (App. A page 58)	13
2.9	Forces on the plug (App. A page 59)	13
2.10	Displacement of the plug (App. A page 60)	14
2.11	Canister power (App. A page 61)	14
2.12	Temperature in the buffer (App. A pages 62-66)	14
2.13	Temperature in the rock (App. A pages 67-70)	14
2.14	Temperature on the canister surface, Optical fiber cables (App. A pages 71-72)	14
2.15	Temperature inside the canister (App. A pages 73-75)	15
2.16	Strain in the canister	15
2.17	Rock stresses and strains	15
<b>3</b>	<b>Geometry</b>	<b>17</b>
<b>4</b>	<b>Location of instruments</b>	<b>19</b>
4.1	Brief description of the instruments	19
4.2	Strategy for describing the position of each device	20
4.3	Position of each instrument in the bentonite	21
4.4	Instruments in the rock	26
4.5	Instruments in the canister	27
4.6	Instruments at the plug	30
<b>References</b>		<b>31</b>
<b>Appendix A: Results</b>		<b>33</b>
<b>Appendix B: Stress and strain measurements of the rock mass</b>		<b>77</b>



# **1      Introduction**

The installation of the Canister Retrieval Test was made during autumn 2000. In general the data in this report are presented in diagrams covering the time period 2000-10-26 to 2005-11-01. The time axis in the diagrams represents days from 2000-10-26. The diagrams are attached in Appendix A. The stress and strain measurements in the rock are reported separately by BBK. That report is attached as Appendix B.

A test overview with the positions of the measuring points and a brief description of the instruments is also presented in this report (chapters 3 and 4).

General comments concerning the collected data are given in chapter 2.



## **2      Comments**

### **2.1    General**

In this chapter short comments on general trends in the measurements are given. Sensors that are not delivering reliable data or no data at all are noted and comments on the data in general are given.

The slot between rock and bentonite block was filled with bentonite pellets and water on 001026. This date is also marked as start date. 1 m water head in the water supply tank was connected to the filters on 001102.

The heating of the canister started with an initially applied constant power of 700 W at 001027 that is one day after test start. The power was raised to 1700 W on 001113. The power was further raised to 2600 W on 010213.

At the end of 2001 two of the 36 electrical heaters failed due to short circuit to earth and no power was generated during one day between November 5 and 6, 2001 (day 375). The heaters were also shut off during one week between March 4 and 11 2002 (days 495 to 502) for control measurements. The water pressure in the mats was stepwise increased to 800 kPa in the period 5/9 – 10/10 2002 (days 687-713). The power of the heaters in the canister was reduced to 2100 W on day 683 (10/9 –02) and to 1600 W on day 1135 (4/12 –03). The later reduction was done after another heater failure that took place on day 1134.

There have been additional problems with the heaters resulting in failure of heaters and short power interruptions. The latest occurred on 2005-02-20 (day 1578) and 2005-03-10 (day 1596), after which only 4 heaters are still functioning. Consequently the power in the canister had to be reduced from 1600 W to about 1150 W on day 1596 (10/3- 05).

The water pressure in the mats attached to the deposition hole wall was temporarily reduced to 100 kPa during the period 5/12 2002 – 9/1 2003 (days 770-805) and to 400 kPa during the period 9/1 2003 – 23/1 2003 (days 805-819). The water pressure was reduced to atmospheric in March 2005 in order to try to keep the last heaters alive.

On October 11 (day 1811) the power was switched off in order to prepare for the dismantling, excavation and retrieval of the test, which will start in the beginning of 2006.

The mats were flushed on July 19.

It should also be mentioned that the actual power from start until day 1135 has been higher than indicated by the measurements. See chapter 2.11.

The tenth report covered the period up to 050501. This report is eleventh the one and covers the results up to 051101.

## **2.2 Total pressure, Geokon (App. A pages 35-38)**

The pressure that decreased after turning off the heaters and reducing the water pressure in March has slowly increased during the reporting period, but not regained the original values. It is interesting to note that there is a sudden pressure increase on July 19, the same day as the mats were flushed. The power that was turned off just before the end of the reporting period, has caused a strong reduction in total pressure.

Sensor P104 was not installed. U106 was originally intended to be a pore pressure sensor but was replaced by a total pressure sensor. One of 21 sensors is out of order.

## **2.3 Total Pressure, Kulite (App. A page 39)**

Six Kulite total pressure transducers are installed in the bentonite blocks. Unfortunately they don't work properly. The reason for the malfunction is probably brakeage of the transducer connections at high pressures.

One sensor (P221) did not work from start 3 stopped working earlier and the two remaining transducers had problems and did not yield reliable values during one year period. Presently only one transducer is working.

## **2.4 Suction, Wescore Psychrometers (App. A pages 40-49)**

Wescor psychrometers are only working at suction below 5000 kPa, which correspond to high relative humidity (above about 96%). 24 out of 26 transducer yield values that can or could be evaluated and have thus a high relative humidity. 9 out of these 24 are drowned meaning that the sensors are probably filled with water. The remaining two sensors (of all 26) had not a high enough relative humidity to yield readable values.

The interpretation of the values should be done with care since the evaluation is done with an automatic technique and the plateau required for proper evaluation not always formed. This explains why most transducers start their appearance from very low value. These low values are not correct but only an indication of that the relative humidity or suction is getting close to the measuring range. All diagrams are included (also diagrams with no evaluated values).

In Ring 5 eight out of nine transducers are indicating a high relative humidity (measurable suction), which confirm the total pressure measurements. In ring 10 all eight transducers indicate a high relative humidity.

The temperature and water pressure reduction have resulted in a change in suction for some transducers.

## **2.5 Relative humidity, Vaisala (App. A pages 50-54)**

Relative humidity and temperature are also measured with Vaisala transducers. The relative humidity results and the temperature results in ring 10 have been split into two diagrams (pages 52 and 53) since the data were interfering with each other.

All transducers in Cyl.1 and Ring5 have stopped to work. In Ring 10 the two placed transducers placed above the canister yield a continuing increase in RH after the initial drying. One transducer placed in the periphery (W138) has after several years of malfunctioning started to yield increasing RH (difficult to explain).

The reason for the successive malfunction is not clear but the transducers do not work very well at high relative humidity. All transducers between the rock and the canister in rings 5 and 10 indicate a high degree of saturation, which confirm the results of the Wescor psychrometers.

18 out of 25 sensors are out of order. The main reason for malfunction is high degree of saturation.

## **2.6 Pore water pressure, Geokon (App. A pages 55-56)**

The reduced water pressure and reduced power and subsequent temperature decrease was reflected in a strong reduction of pore pressure, which has remained at very low values due to the low water pressure in the mats.

U106 is replaced by a total pressure sensor.

1 out of 11 sensors is out of order.

## **2.7 Pore water pressure, Kulite (App. A page 57)**

There are only one sensor of this type in Ring 10 and one in Cylinder 4. None of them have shown any increase in pore pressure.

## **2.8 Water flow into the filters (App. A page 58)**

Measurement of water inflow into the filters started at 001102. The total inflow to the filters has since that date been 672 liter.

The inflow rate has strongly increased after start pressurizing the water in the mats at 020905 (day 678) and ceased after the pressurization was stopped on 050304 (day 1590).

## **2.9 Forces on the plug (App. A page 59)**

The forces on the plug have been measured since 001106. The total force is about 9000 kN on 051101 and was steadily increasing until the water pressure and power were reduced. Very little increase in force has been measured after that date.

During the first about 50 days the plug was only fixed with 3 rods. When the total force exceeded 1500 kN the rest of the 9 rods were fixed in a prescribed manner. This procedure took place 12-14 December 2000 that is 46-48 days after test start. From that time only every third anchor is measured and the results should thus be multiplied with 3. The diagram shows both the actual measurements and after multiplication with 3.

## **2.10 Displacement of the plug (App. A page 60)**

One transducer shows a logical steady upwards displacement of the plug, while two transducers act strangely. An error in the measuring equipment seems to have developed recently.

## **2.11 Canister power (App. A page 61)**

There were problems with the heaters at several occasions occasions and the power has successively been reduced. The power was switched off 2005-10-11 (day 1811).

Days 600-1 100 the power 2100 W was measured by direct measurement regularly. However, an alternative technique for measuring the power showed for some canisters in the Prototype Repository a deviating power. This technique, which consists in measurement of the entire energy consumed by the canister, was used to measure the average power of the canister in CRT during four weeks (at day ~1000). The result was a conclusion that the average power was not 2100 W as plotted but 2220 W. This difference seems to have endured up to the latest power failure. After reduction in power to 1600W the two techniques agree. The new equipment for continuous measurement and calculation of the entire energy consumed by the canister was installed on 2004-01-28 and has been used in the data plot from that date (day ~1200).

## **2.12 Temperature in the buffer (App. A pages 62-66)**

After switching off the power the highest measured temperature in the buffer near the canister in Ring 5 has decreased from 53 °C to 32 °C in the end of this measuring period. All temperature sensors have worked well during the entire test.

## **2.13 Temperature in the rock (App. A pages 67-70)**

The maximum temperature measured in the rock is measured in the central section on the surface of the deposition hole. After switching off the power the maximum temperature measured in the rock decreased from 46 degree to 34 degrees.

There was an almost complete axial symmetry of the temperature measured in the rock until day 880. The change of this trend with mainly increasing temperature in direction A (north) is caused be the neighboring experiment TBT that started its heating at 030326.

## **2.14 Temperature on the canister surface, Optical fiber cables (App. A pages 71-72)**

The first diagram shows the maximum temperature plotted as a function of time. The maximum temperature measured on the canister surface was reduced by 24 °C to about 34 °C after switching off the power 05-10-11(day 1811). The second diagram shows the distribution of the temperature along the cables at 05-11-01. The length of the cable on the canister surface is only about 20 m and close to the entrances the lower surrounding temperatures have an influence on the measured temperature.

## **2.15 Temperature inside the canister (App. A pages 73-75)**

All sensors have been lost.

## **2.16 Strain in the canister**

Continuous measurements have been made but so far no results have been produced due to evaluation problems.

## **2.17 Rock stresses and strains**

Rock stresses and strains are reported in Appendix B.




### 3 Geometry

The test installation consists of a full-scale deposition hole, a copper canister equipped with electrical heaters and bentonite blocks (cylindrical and ring shaped). A plug of concrete and steel is anchored to the rock on top of the bentonite.

The saturation of the bentonite is attained artificially by vertical filter stripes. 16 stripes with a width of 0.1 meters and a length of 5.5 meters are applied on the surrounding rock.

Measurements are made in four vertical sections A, B, C and D according to Figure 3-1. Direction A-B is parallel to the tunnels axial with A headed almost against north.

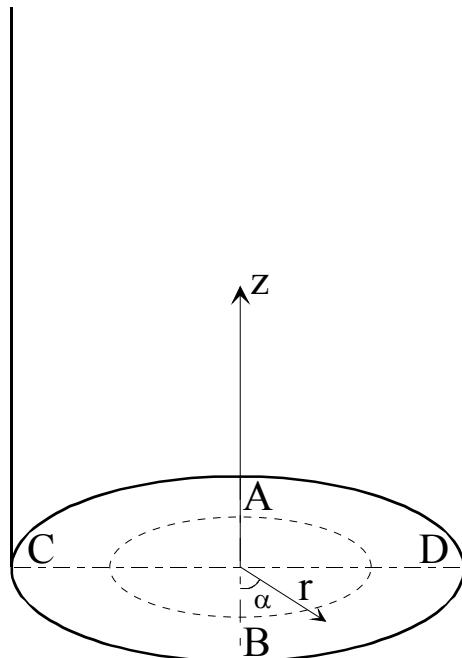

**Figure 3-1.** Figure describing the instrument planes (A-D) and the coordinate system used when describing the instrument positions.



## 4 Location of instruments

### 4.1 Brief description of the instruments

The different instruments that are used in the experiment are briefly described in this chapter.

#### Measurements of temperature

##### *Buffer*

Thermocouples from BICC have been installed for measuring temperature in the buffer. Measurements are done in 32 points in the test hole. In addition, temperature gauges are built in into the capacitive relative humidity sensors (29 sensors) as well as in the pressure gauges of vibrating wire type (13 gauges). Temperature is also measured in the psychrometers.

##### *Canister*

Temperature is measured inside the canister (on the insert) in 19 points with PT-100 gauges. In addition temperature is measured on the surface of the canister with optical fiber cables. An optical measuring system called FTR (Fiber Temperature Laser Radar) from BICC is used.

##### *Rock*

Temperature in the rock and on the rock surface of the hole is measured in 40 points with thermocouples from BICC.

#### Measurement of total pressure in the buffer

Total pressure is the sum of the swelling pressure and the pore water pressure. It is measured with the following instrument types:

- Geocon total pressure cells with vibrating wire transducers. 15 cells of this type have been installed.
- Kulite total pressure cells with piezo resistive transducers. 6 cells of this type have been installed.

#### Measurement of pore water pressure in the buffer

Pore water pressure is measured with the following instrument types:

- Geocon pore pressure cells with vibrating wire transducer. 13 cells of this type have been installed.
- Kulite pore pressure cells with piezo resistive transducer. 2 cells of this type have been installed.

## **Measurement of the water saturation process**

The water saturation process is recorded by measuring the relative humidity in the pore system, which can be converted into water ratio or total suction (negative water pressure). The following techniques and devices are used:

- Vaisala relative humidity sensor of capacitive type. 29 cells of this type have been installed. The measuring range is 0-100 % RH.
- Wescor psychrometers model PST-55. The devices measure the relative humidity in the pore system. The measuring range is 95.5-99.6 % RH corresponding to the pore water pressure -0.5 to -6MPa. 26 cells of this type have been installed.

## **Measurements of strain in the Canister**

These measurements are not reported.

## **Measurements of stresses and strain in the rock**

These measurements are not reported.

## **Measurements of forces on the plug**

The force on the plug caused by the swelling pressure of the bentonite is measured in 3 of the 9 anchors. The force transducers are of the type GLÖTZL.

## **Measurements of plug displacement**

Due to straining of the anchors the swelling pressure of the bentonite will cause not only a force on the plug but also displacement of the plug. The displacement is measured in three points with transducers of the type LVDT with the range 0 – 50 mm.

## **Measurement of water flow into the permeable mats**

Water is supplied to the bentonite with filter strips attached to the rock surface. The water flow into these mats is measured by measuring the water volume in the supply tank with a differential pressure transmitter that measures the difference in pressure between the nitrogen in the top of the tank and the water in the bottom of the tank.

## **4.2 Strategy for describing the position of each device**

Every instrument is named with a short unique name consisting of 1-2 letters describing the type of measurement and 3 figures numbering the device. Every instrument position in the buffer and rock is described with three coordinates according to Figure 3-1.

The r-coordinate is the horizontal distance from the center of the hole and the z-coordinate is the height from the bottom of the hole (the block height is set to 500 mm). The  $\alpha$ -coordinate is the angle from the vertical direction B (almost south).

The short description of the positions in the diagrams differs between the buffer and the rock.

**Buffer:** Three positions with the following meaning: (bentonite block or cylinder number counted from the bottom \ direction A, B, C, or D \ radius in mm from center line)

**Rock:** Three positions with the following meaning: (distance in meters from the bottom \  $\alpha$  according to Fig 3-1 \ distance in meters from the hole surface)

The bentonite blocks are called cylinders and rings. The cylinders are numbered C1-C4 and the rings R1-R10 respectively (Figure 4-1).

### **4.3 Position of each instrument in the bentonite**


Measurements are done in four vertical sections A, B, C and D according to Figure 3-1. Direction A and B are placed in the tunnels axial direction.

An overview of the positions of the instruments is shown in Fig 4-1. Exact positions are described in Tables 4-1 to 4-4.

The instruments are located in two main levels in the blocks, 50 mm and 160 mm, from the upper surface. The thermocouples have mostly placed in the 50mm level and the other gauges in the 160 mm level.

- pore water pressure + temp.
- total pressure + temp.
- ✗ temp.
- △ relative humidity (+ temp.)

1m

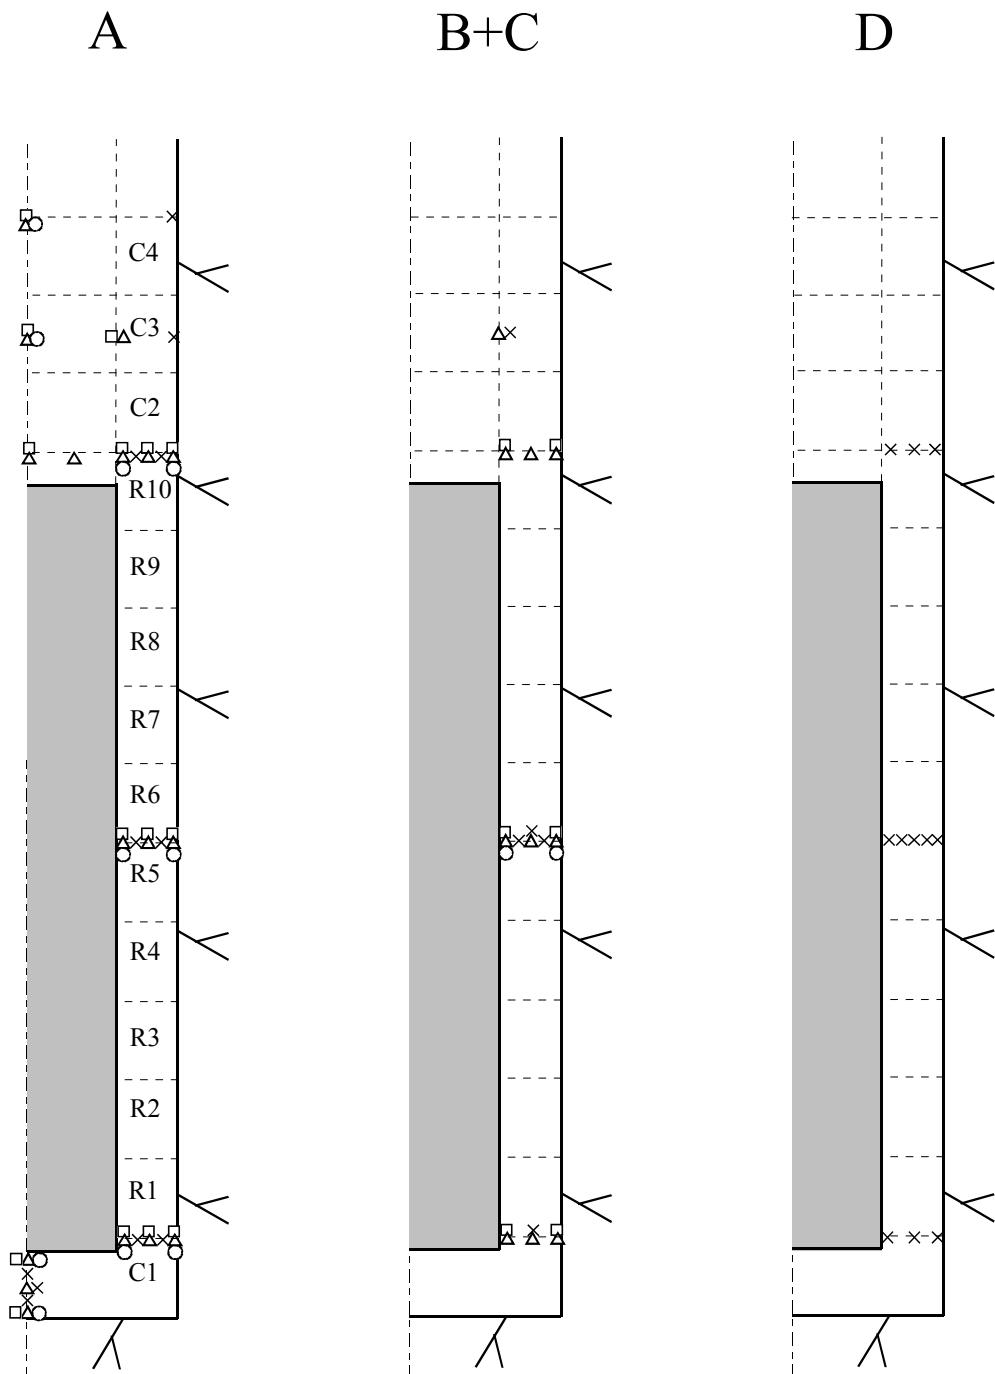

**Figure 4-1** Schematic view over the instruments in four vertical sections and the block designation.

**Table 4-1 Numbering and position of instruments for measuring temperature (T)**

Type and number	Block	Instrument position in block			Cable pos.	Fabricate	Remark
		Direction	$\alpha$	r			
T101	Cyl. 1	Center	90	50	50	242	BICC
T102	Cyl. 1	Center	90	50	250	238	BICC
T103	Cyl. 1	Center	90	50	450	230	BICC
T104	Cyl. 1	A	180	635	450	206	BICC
T105	Cyl. 1	A	180	735	450	202	BICC
T106	Cyl. 1	B	365	685	450	38	BICC
T107	Cyl. 1	C	275	685	450	274	BICC
T108	Cyl. 1	D	90	585	450	96	BICC
T109	Cyl. 1	D	90	685	450	94	BICC
T110	Cyl. 1	D	90	785	450	92	BICC
T111	Ring 5	A	180	635	2950	224	BICC
T112	Ring 5	A	180	735	2950	218	BICC
T113	Ring 5	B	360	610	2950	318	BICC
T114	Ring 5	B	360	685	2950	322	BICC
T115	Ring 5	B	360	735	2950	324	BICC
T116	Ring 5	C	270	610	2950	258	BICC
T117	Ring 5	C	270	685	2950	260	BICC
T118	Ring 5	C	270	735	2950	262	BICC
T119	Ring 5	D	90	585	2950	44	BICC
T120	Ring 5	D	90	635	2950	46	BICC
T121	Ring 5	D	90	685	2950	48	BICC
T122	Ring 5	D	90	735	2950	50	BICC
T123	Ring 5	D	90	785	2950	52	BICC
T124	Ring 10	A	180	635	5450	200	BICC
T125	Ring 10	A	180	735	5450	194	BICC
T126	Ring 10	D	90	585	5450	54	BICC
T127	Ring 10	D	90	685	5450	56	BICC
T128	Ring 10	D	90	785	5450	58	BICC
T129	Cyl. 3	A	180	785	6250	166	BICC
T130	Cyl. 3	B	365	585	6250	358	BICC
T131	Cyl. 3	C	275	585	6250	280	BICC
T132	Cyl. 4	A	180	785	6950	66	BICC

**Table 4-2 Numbering and position of instruments for measuring total pressure (P)**

Type and number	Block	Instrument position in block				Cable pos.	Fabricate	Remark
		Direction	$\alpha$	r(mm)	Z(mm)			
P101	Cyl. 1	Center	180	50	0	244	Kulite	
P102	Cyl. 1	Center	180	50	450	232	Kulite	
P103	Cyl. 1	A	185	585	340	208	Geokon	
P104	Cyl. 1	A	185	685	340	204	Geokon	
P105	Cyl. 1	A	185	785	340	186	Geokon	
P106	Cyl. 1	B	365	585	340	40	Geokon	
P107	Cyl. 1	B	365	785	340	2	Geokon	
P108	Cyl. 1	C	275	585	340	278	Geokon	
P109	Cyl. 1	C	275	785	340	270	Geokon	
P110	Ring 5	A	185	585	2840	228	Geokon	
P111	Ring 5	A	185	685	2840	222	Geokon	
P112	Ring 5	A	185	785	2840	188	Geokon	
P113	Ring 5	B	365	535	2840	36	Geokon	
P114	Ring 5	B	365	825	2840	16	Geokon	
P115	Ring 5	C	275	585	2840	296	Geokon	
P116	Ring 5	C	275	785	2840	290	Geokon	
P117	Ring 10	Center	180	50	5340	24	Kulite	
P118	Ring 10	A	180	585	5340	216	Geokon	
P119	Ring 10	A	180	685	5340	198	Geokon	
P120	Ring 10	A	180	785	5340	192	Geokon	
P121	Ring 10	B	365	585	5340	20	Kulite	
P122	Ring 10	B	365	785	5340	18	Kulite	
P123	Ring 10	C	275	585	5340	286	Kulite	
P124	Ring 10	C	275	785	5340	284	Kulite	
P125	Cyl. 3	Center	180	50	6250	158	Geokon	
P126	Cyl. 3	A	180	585	6250	162	Geokon	
P127	Cyl. 4	Center	180	50	6840	64	Kulite	

**Table 4-3 Numbering and position of instruments for measuring pore water pressure (U)**

Type and number	Block	Instrument position in block				Cable pos.	Fabricate	Remark
		Direction	$\alpha$	r(mm)	Z(mm)			
U101	Cyl. 1	Center	270	50	50	246	Geokon	
U102	Cyl. 1	Center	270	50	450	236	Geokon	Horizontal
U103	Cyl. 1	A	175	585	340	126	Geokon	
U104	Cyl. 1	A	175	785	340	178	Geokon	
U105	Ring 5	A	175	585	2840	138	Geokon	
U106	Ring 5	A	175	785	2840	180	Geokon	
U107	Ring 5	B	355	535	2840	314	Geokon	In the slot
U108	Ring 5	B	355	825	2840	348	Geokon	In the slot
U109	Ring 5	C	265	585	2840	256	Geokon	
U110	Ring 5	C	265	825	2840	264	Geokon	In the slot
U111	Ring 10	A	175	585	5340	146	Geokon	
U112	Ring 10	A	175	785	5340	152	Geokon	
U113	Cyl. 3	Center	270	50	6250	156	Geokon	
U114	Cyl. 4	Center	270	50	6950	62	Kulite	

**Table 4-4 Numbering and position of instruments for measuring water content (W)**

Type and number	Block	Direction	Instrument position in block	r	z	Cable pos.	Fabricate	Remark
W101	Cyl. 1	Center	360	50	50	248	Vaisala	
W102	Cyl. 1	Center	360	400	160	240	Vaisala	
W103	Cyl. 1	Center	360	50	450	234	Vaisala	Horizontal
W104	Cyl. 1	A	180	585	340	128	Vaisala	
W105	Cyl. 1	A	180	685	340	132	Vaisala	
W106	Cyl. 1	A	180	785	340	184	Vaisala	
W107	Cyl. 1	A	170	585	340	124	Wescor	
W108	Cyl. 1	A	170	685	340	130	Wescor	
W109	Cyl. 1	A	170	785	340	134	Wescor	
W110	Cyl. 1	B	360	585	340	304	Vaisala	
W111	Cyl. 1	B	360	785	340	360	Vaisala	
W112	Cyl. 1	B	360	685	340	308	Vaisala	
W113	Cyl. 1	B	355	585	340	302	Wescor	
W114	Cyl. 1	B	355	685	340	306	Wescor	
W115	Cyl. 1	B	355	785	340	310	Wescor	
W116	Cyl. 1	C	270	585	340	250	Wescor	
W117	Cyl. 1	C	270	685	340	252	Wescor	
W118	Cyl. 1	C	270	785	340	254	Vaisala	
W119	Ring 5	A	180	585	2840	226	Vaisala	
W120	Ring 5	A	180	685	2840	220	Vaisala	
W121	Ring 5	A	180	785	2840	182	Vaisala	
W122	Ring 5	A	170	585	2840	136	Wescor	
W123	Ring 5	A	170	685	2840	140	Wescor	
W124	Ring 5	A	170	785	2840	142	Wescor	
W125	Ring 5	B	360	535	2840	316	Vaisala	In the slot
W126	Ring 5	B	360	685	2840	34	Vaisala	
W127	Ring 5	B	360	785	2840	350	Vaisala	
W128	Ring 5	B	350	535	2840	312	Wescor	In the slot
W129	Ring 5	B	350	685	2840	320	Wescor	
W130	Ring 5	B	350	785	2840	346	Wescor	
W131	Ring 5	C	270	585	2840	294	Wescor	In the slot
W132	Ring 5	C	275	685	2840	292	Wescor	
W133	Ring 5	C	270	785	2840	288	Wescor	
W134	Ring 10	Center	360	50	5340	22	Vaisala	
W135	Ring 10	A	180	262	5340	26	Vaisala	
W136	Ring 10	A	180	585	5340	214	Vaisala	
W137	Ring 10	A	180	685	5340	196	Vaisala	
W138	Ring 10	A	180	785	5340	190	Vaisala	
W139	Ring 10	A	170	585	5340	144	Wescor	
W140	Ring 10	A	170	685	5340	148	Wescor	
W141	Ring 10	A	170	785	5340	150	Wescor	
W142	Ring 10	B	360	585	5340	328	Vaisala	
W143	Ring 10	B	360	685	5340	332	Vaisala	
W144	Ring 10	B	360	785	5340	336	Vaisala	
W145	Ring 10	B	355	585	5340	326	Wescor	
W146	Ring 10	B	355	685	5340	330	Wescor	
W147	Ring 10	B	355	785	5340	334	Wescor	
W148	Ring 10	C	270	585	5340	266	Wescor	
W149	Ring 10	C	270	685	5340	268	Wescor	
W150	Ring 10	C	270	785	5340	272	Vaisala	
W151	Cyl. 3	Center	360	50	6250	154	Vaisala	
W152	Cyl. 3	A	180	585	6250	160	Vaisala	
W153	Cyl. 3	B	360	585	6250	356	Vaisala	
W154	Cyl. 3	C	270	585	6250	276	Wescor	
W155	Cyl. 4	Center	360	50	6840	60	Vaisala	

## 4.4 Instruments in the rock

### Temperature measurements

40 thermocouples are placed in the rock and on the rock surface of the deposition hole. Holes have been bored in three directions on three levels and one additional hole has been bored in the bottom of the deposition hole i.e. totally 10 holes. They are led from the rock, over the gap between rock and bentonite and up along the bentonite block periphery. The position of the thermocouples in the rock is shown in Table 4-5.

**Table 4-5 Numbering and positions of thermocouples in the rock**

Type and number	Level	Direction	Distance from rock surface	Cable pos.	Fabricate	Remark
TR101	0	Center	0.000	70°-90°	BICC	
TR102	0	Center	0.375	70°-90°	BICC	
TR103	0	Center	0.750	70°-90°	BICC	
TR104	0	Center	1.500	70°-90°	BICC	
TR105	0.61	10°	0.000	4°-14°	BICC	
TR106	0.61	10°	0.375	4°-14°	BICC	
TR107	0.61	10°	0.750	4°-14°	BICC	
TR108	0.61	10°	1.500	4°-14°	BICC	
TR109	0.61	80°	0.000	70°-90°	BICC	
TR110	0.61	80°	0.375	70°-90°	BICC	
TR111	0.61	80°	0.750	70°-90°	BICC	
TR112	0.61	80°	1.500	70°-90°	BICC	
TR113	0.61	170°	0.000	168°-176°	BICC	
TR114	0.61	170°	0.375	168°-176°	BICC	
TR115	0.61	170°	0.750	168°-176°	BICC	
TR116	0.61	170°	1.500	168°-176°	BICC	
TR117	3.01	10°	0.000	4°-14°	BICC	
TR118	3.01	10°	0.375	4°-14°	BICC	
TR119	3.01	10°	0.750	4°-14°	BICC	
TR120	3.01	10°	1.500	4°-14°	BICC	
TR121	3.01	80°	0.000	70°-90°	BICC	
TR122	3.01	80°	0.375	70°-90°	BICC	
TR123	3.01	80°	0.750	70°-90°	BICC	
TR124	3.01	80°	1.500	70°-90°	BICC	
TR125	3.01	170°	0.000	168°-176°	BICC	
TR126	3.01	170°	0.375	168°-176°	BICC	
TR127	3.01	170°	0.750	168°-176°	BICC	
TR128	3.01	170°	1.500	168°-176°	BICC	
TR129	5.41	10°	0.000	4°-14°	BICC	
TR130	5.41	10°	0.375	4°-14°	BICC	
TR131	5.41	10°	0.750	4°-14°	BICC	
TR132	5.41	10°	1.500	4°-14°	BICC	
TR133	5.41	80°	0.000	70°-90°	BICC	
TR134	5.41	80°	0.375	70°-90°	BICC	
TR135	5.41	80°	0.750	70°-90°	BICC	
TR136	5.41	80°	1.500	70°-90°	BICC	
TR137	5.41	170°	0.000	168°-176°	BICC	
TR138	5.41	170°	0.375	168°-176°	BICC	
TR139	5.41	170°	0.750	168°-176°	BICC	
TR140	5.41	170°	1.500	168°-176°	BICC	

### Stress and strain measurements

See Appendix B .

## **4.5 Instruments in the canister**

The canister is instrumented with optical fiber cables on the copper surface, thermocouples in the steel insert and strain gauges on the inner and outer surface of the copper envelop in canister.

### **Optical fiber cables**

Figure 4-2 shows how the two optical fiber cables are placed on the canister surface. Both ends of a cable are used for measurements. This means that the two cables are used as four measuring channels as described in Table 4-6.

With this laying the cable will enter and exit the surface at almost the same position. Curvatures are shaped as a quarter circle with a radius of 20 cm. The cable is placed in a milled out channel on the surface. The channel has a width and a depth of just above 2 mm


**Table 4-6. Combination of cables and channels**

Channel 1	Outlet of cable 1
Channel 2	Inlet of cable 1
Channel 3	Outlet of cable 2
Channel 4	Inlet of cable 2


Figure 4-3 shows the location of the thermocouples on the steel insert inside the canister.

### **Thermocouple, PT100**

Temperature in the steel insert measured at 18 point of measuring with. thermocouple of type PT100. Figure 4-4 shows how these thermocouple are placed

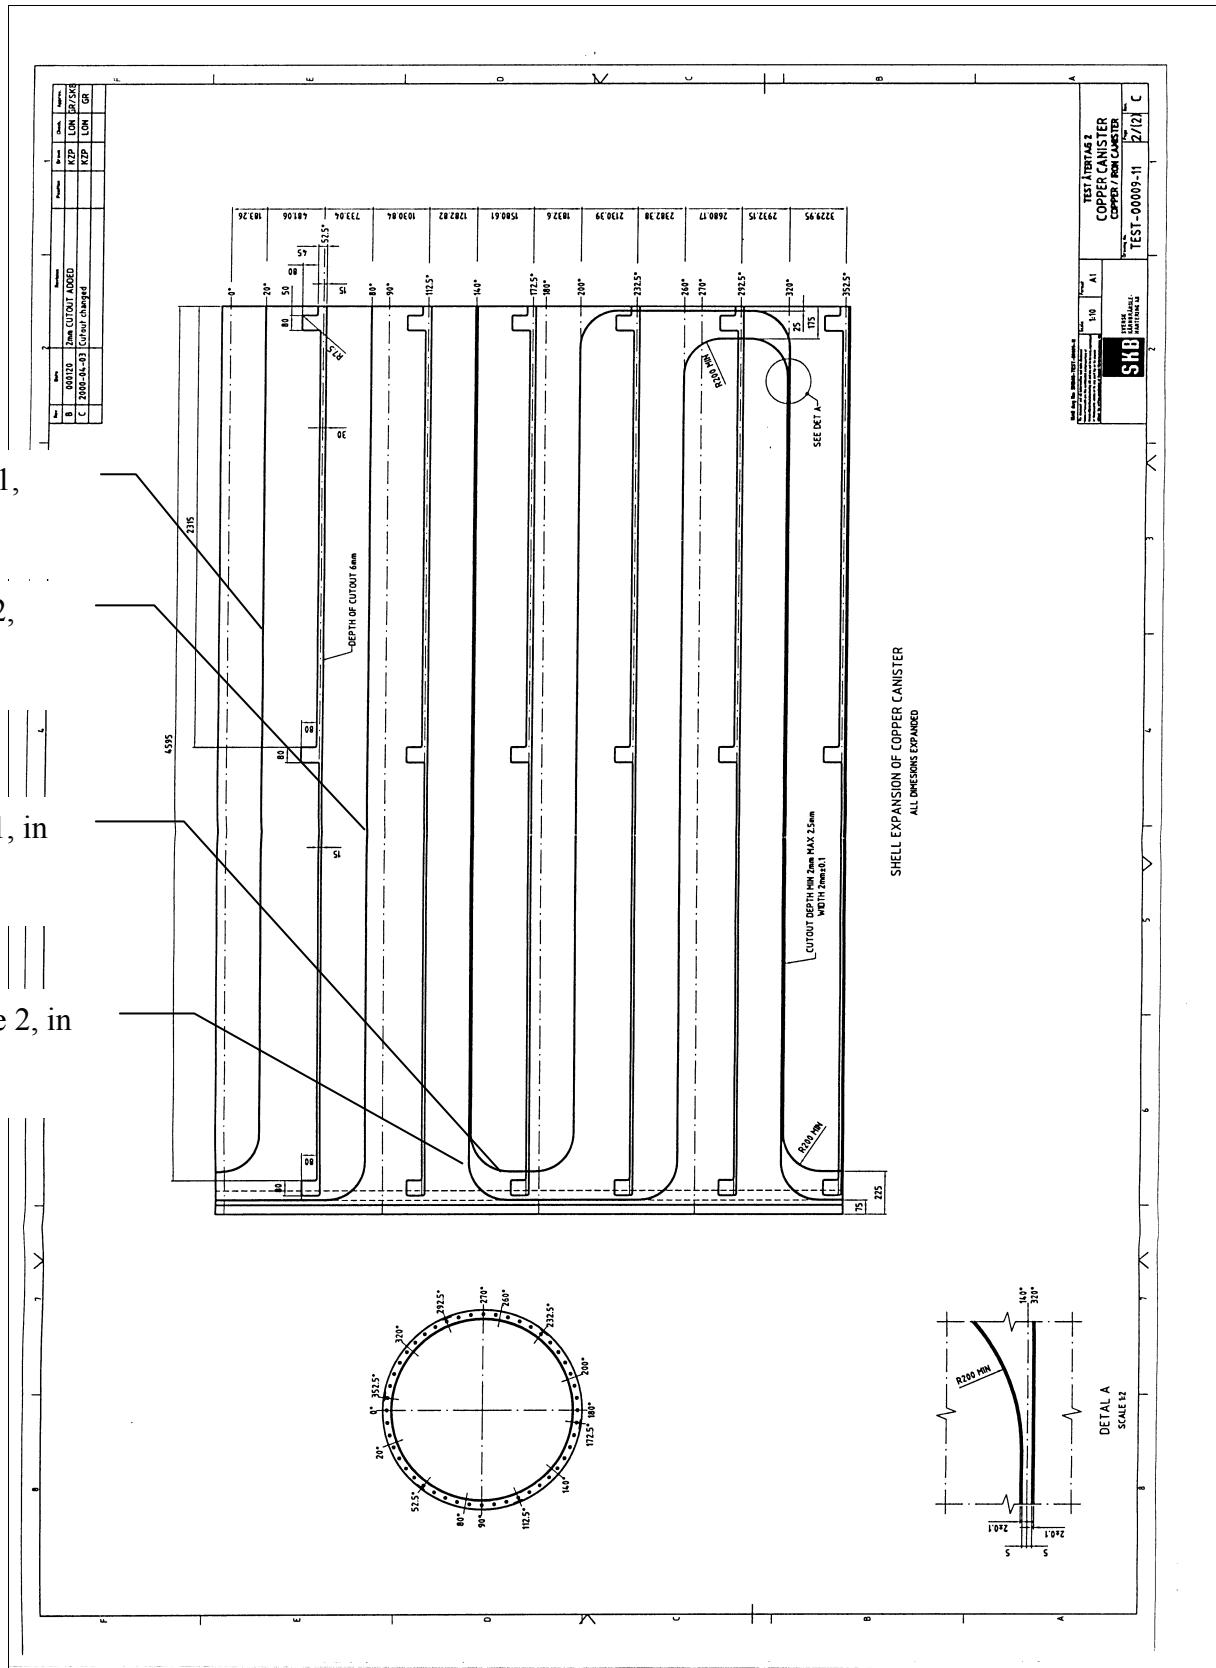

**Figure 4-2.** Laying of two optical fibre cables with protection tube of Inconel 625 (outer diameter 2 mm) for measurement of the canister surface temperature (surface unfolded).

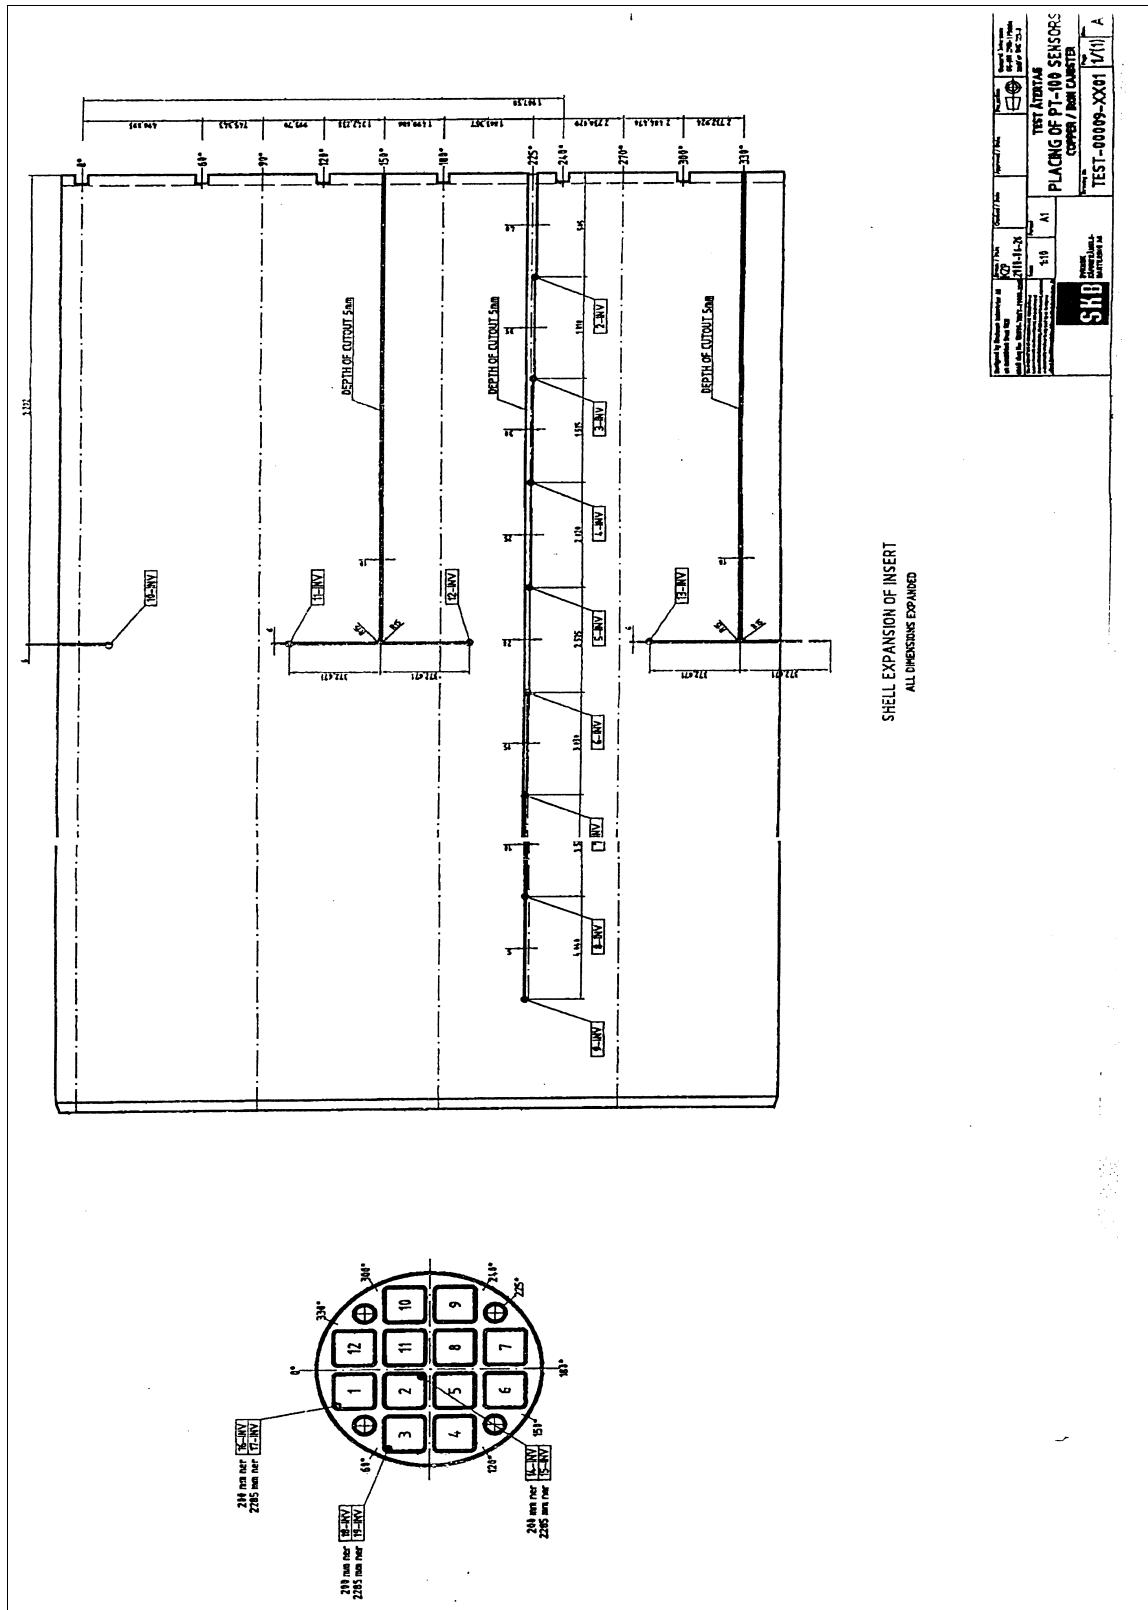


**Figur 4-3.** Location of thermocouples inside the canister

## 4.6 Instruments at the plug

Three force transducers and three displacement transducers have been placed on the plug to measure the force of the anchors and the displacement of the plug. The location of these transducers can be described in relation to Fig 4-4, which shows a schematic view of the plug with the slots, rods and cables.

The rods are numbered 1-9 anti-clockwise and number 1 is assumed to be the northern rod in direction A. The force transducers are placed on rods 3, 6, and 9. The displacement transducers are placed between the rods 5 cm from the rock surface of the hole and according to Table 4-6. They are fixed on the rock surface and measure thus the displacement relative the rock.

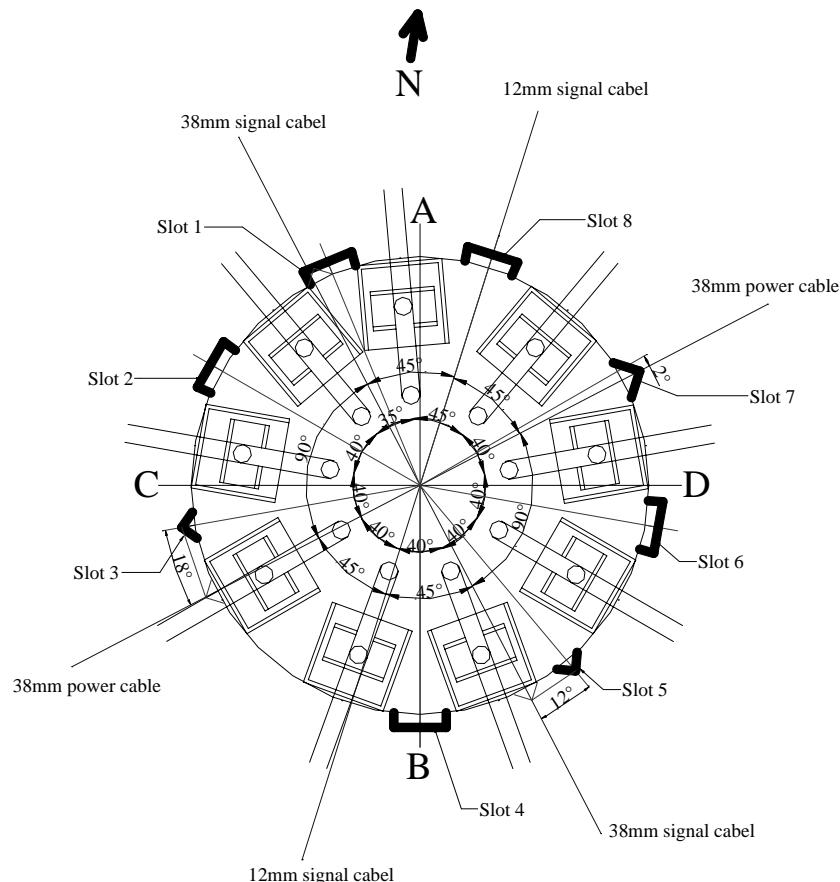

**Figure 4-4.** Schematic view of the deposition hole, showing the position of the slots, the rods and the cables from the canister.

**Table 4-6. Location of displacement transducers**

Transducer No.	Located between rods No.
1	4 and 5
2	7 and 8
3	1 and 2

## **References**

**/1-1/ Sanden T, Börgesson L.** Report on instrument positions and preparation of bentonite blocks for instruments and cables May 2000. SKB IPR-00-14




# **Appendix A**


## **Measured data**





**Total pressure - Cylinder 1 (001026-051101)**  
**Geokon**

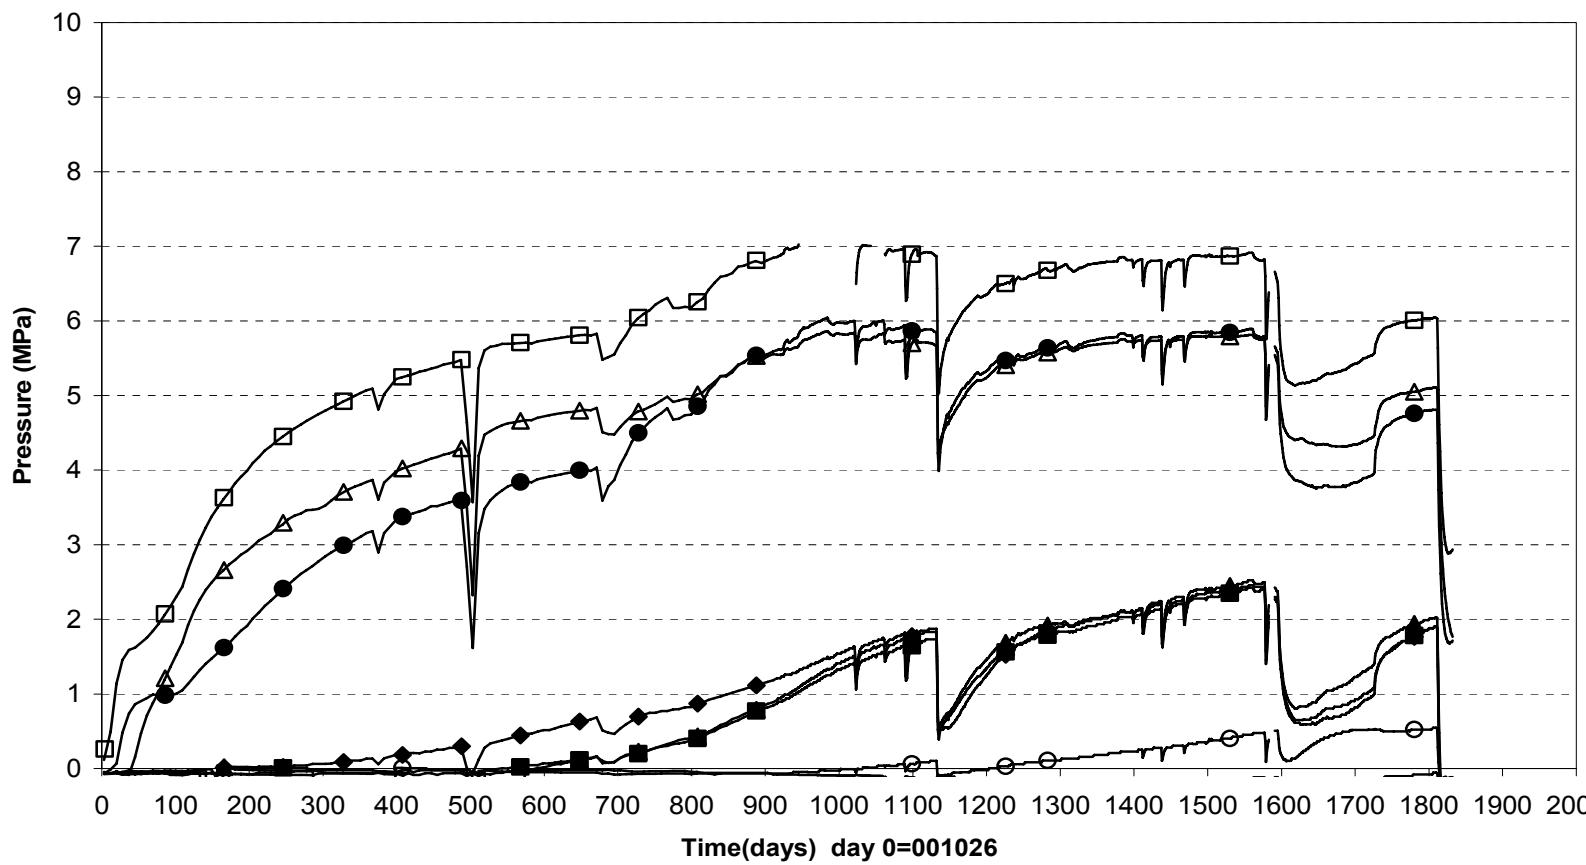


○ P101(Cyl.1\center\50)	× P102(cyl.1\center\50)	▲ P103(Cyl.1\A\585)	◆ P106(Cyl.1\B\585)	■ P108(Cyl.1\C\585)
□ P105(Cyl1\A\785)	△ P107(Cyl.1\B\785)	● P109(Cyl1\C\785)		

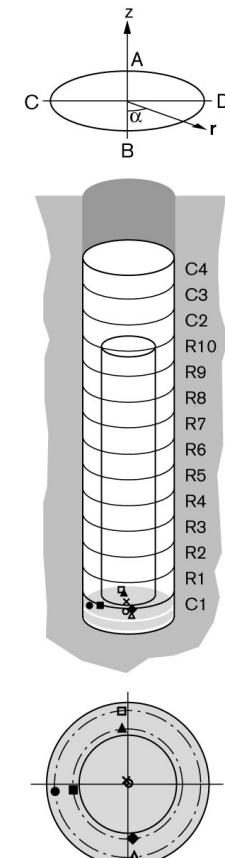


**Total pressure - Ring 5 (001026-051101)**  
**Geokon**

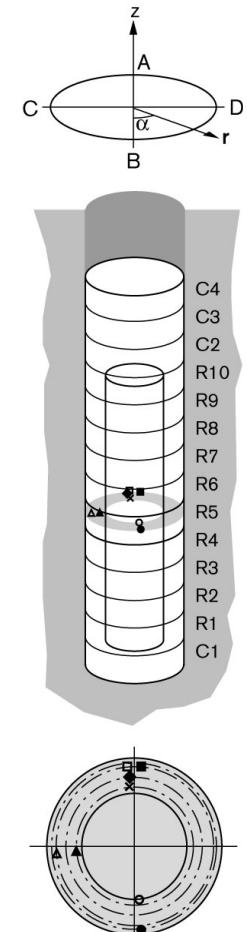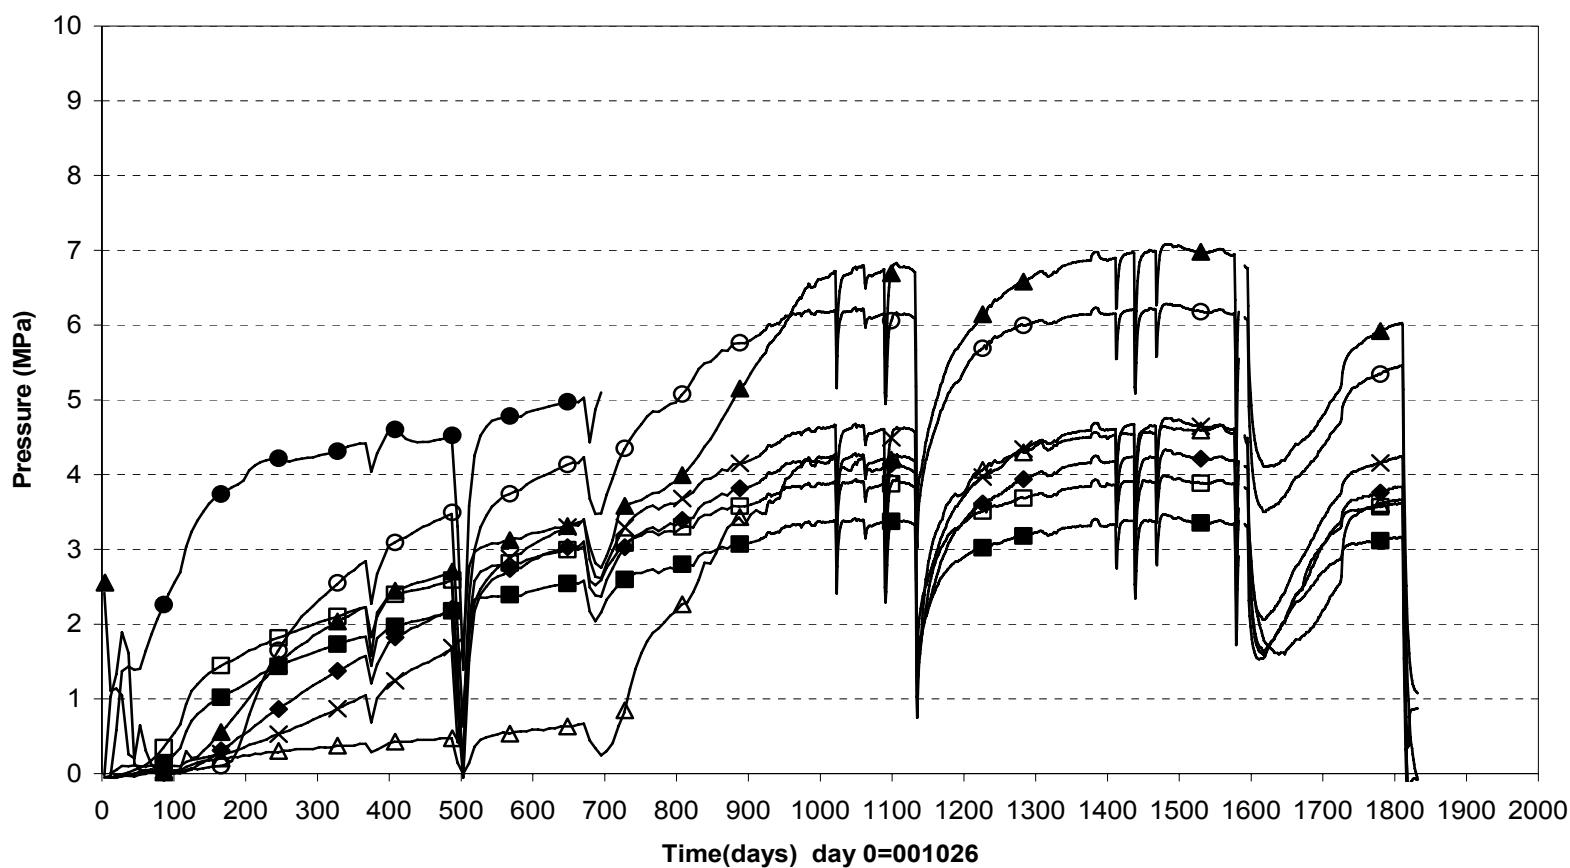


**Total pressure - Ring 10 (001026-051101)**  
**Geokon**

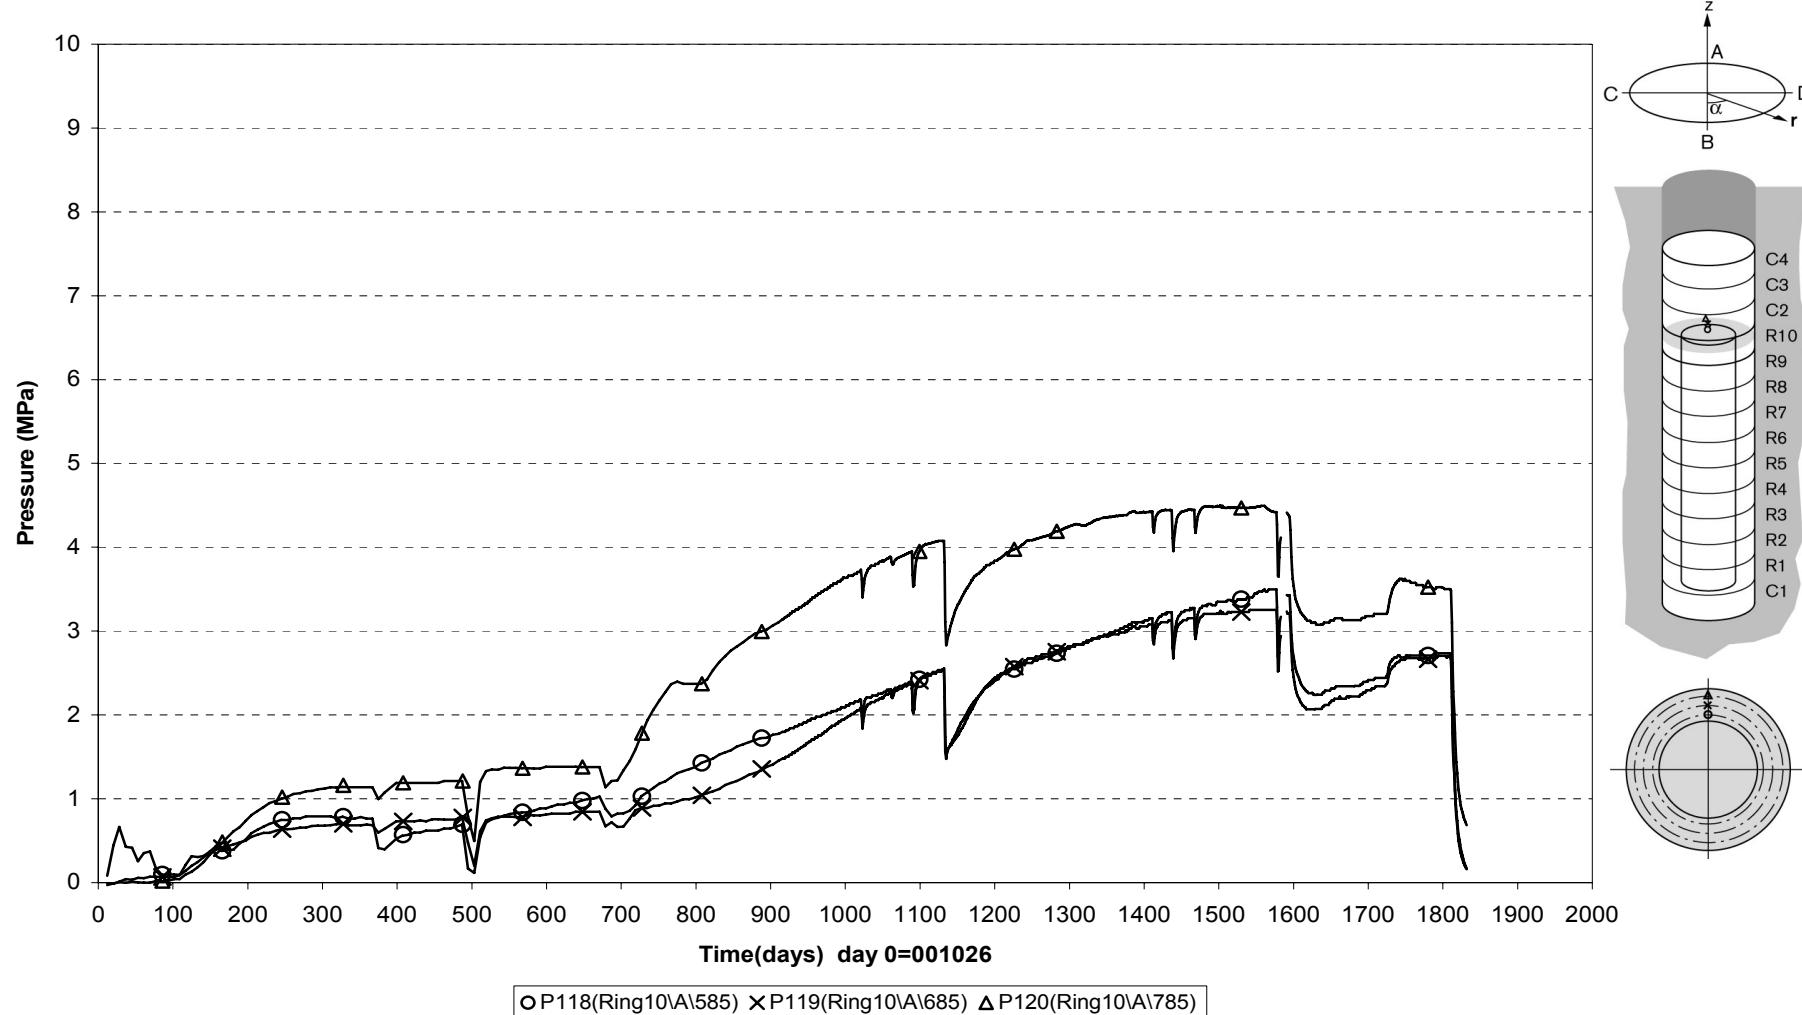



**Total pressure - Cylinder 3 (001026-051101)**  
**Geokon**

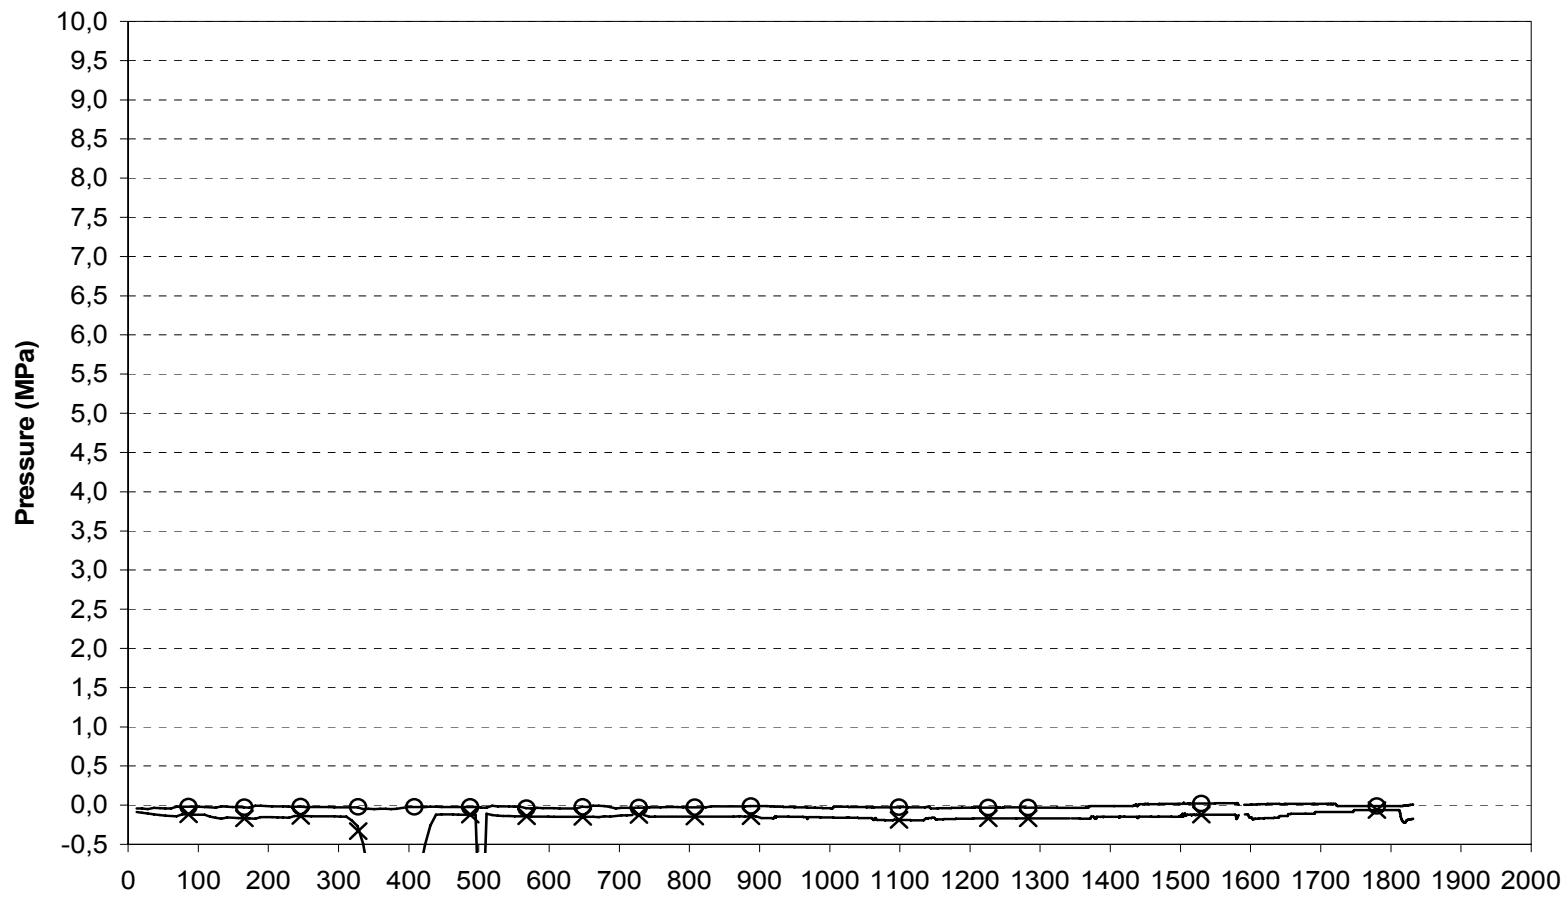



○ P125(Cyl.3\center\50) × P126(Cyl.3\A\585)

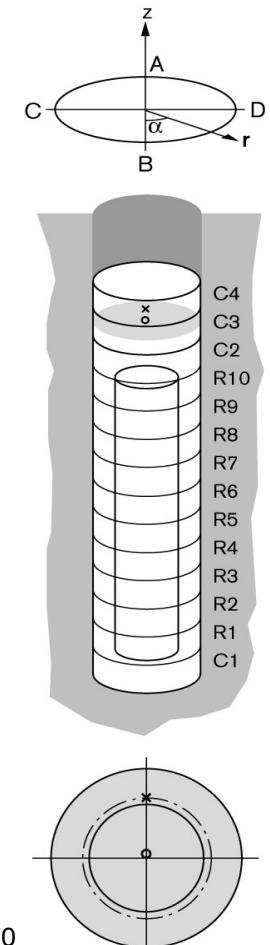


**Total pressure - Ring 10 (001026-051101)**  
**Kulite**

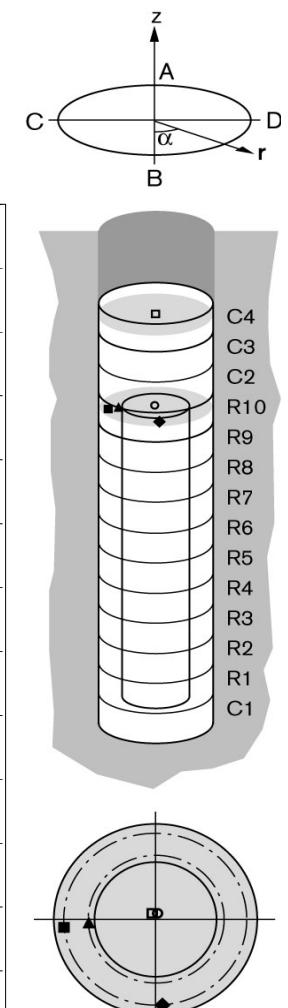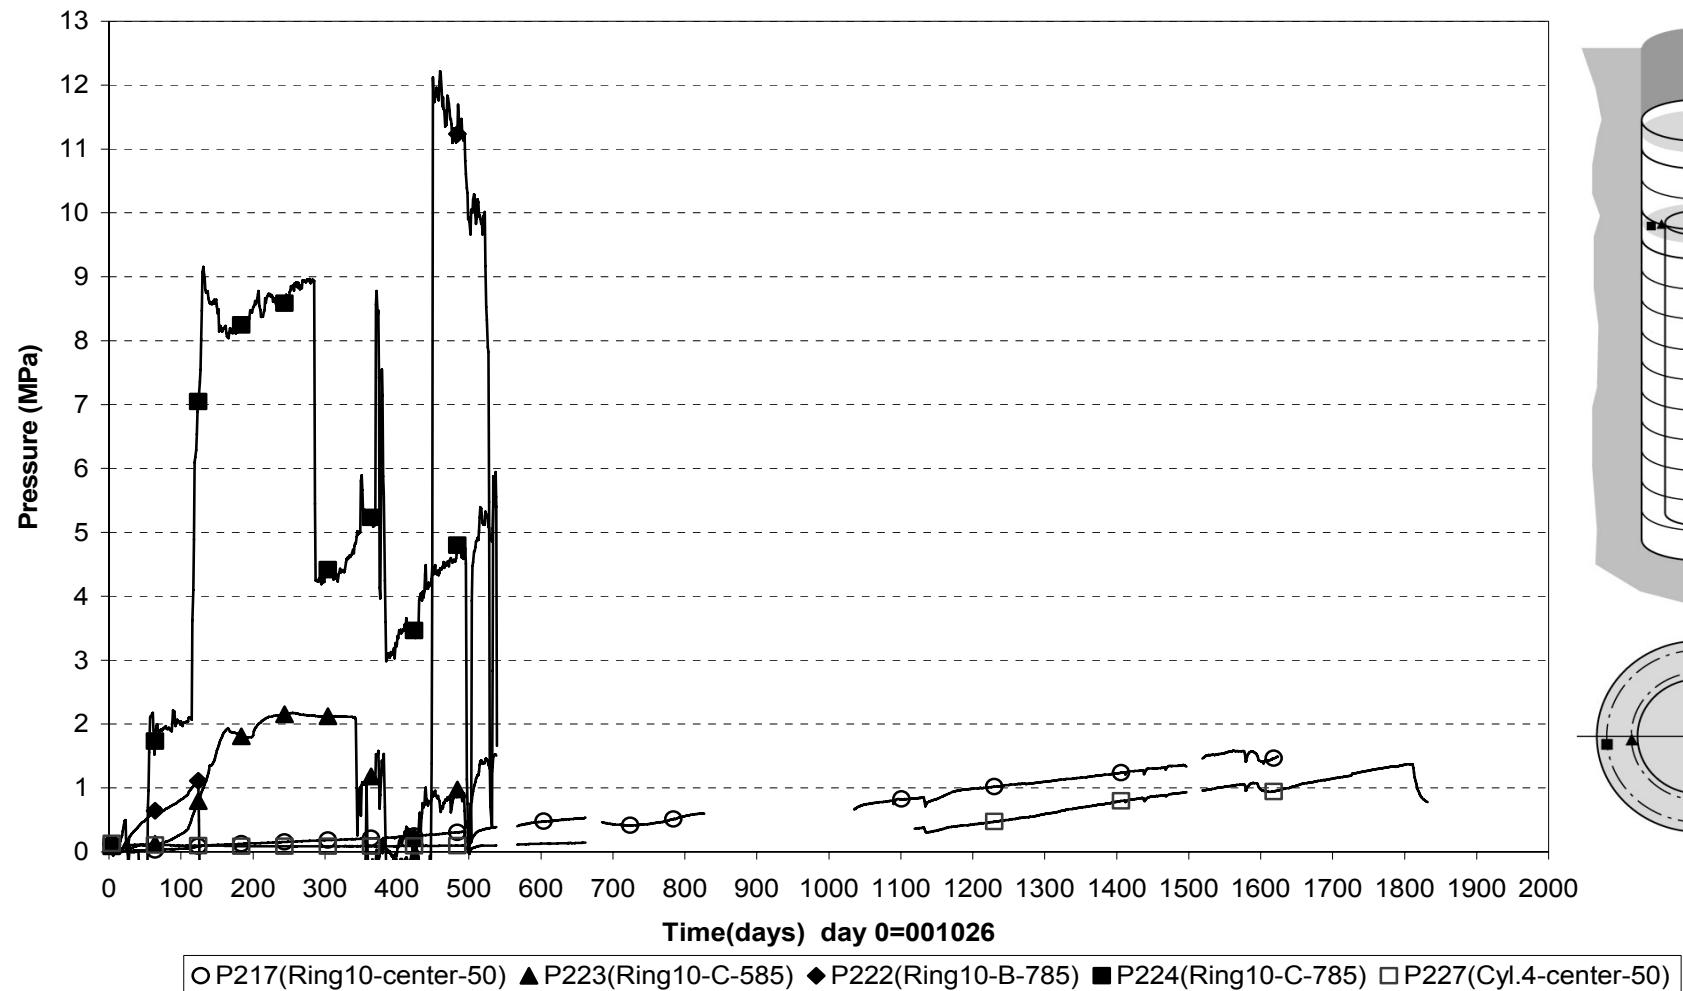



**Suction in the buffer - Cyl.1 (001026-051101)**  
**Wescor**

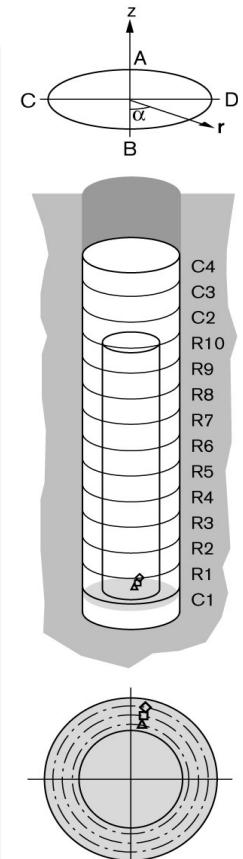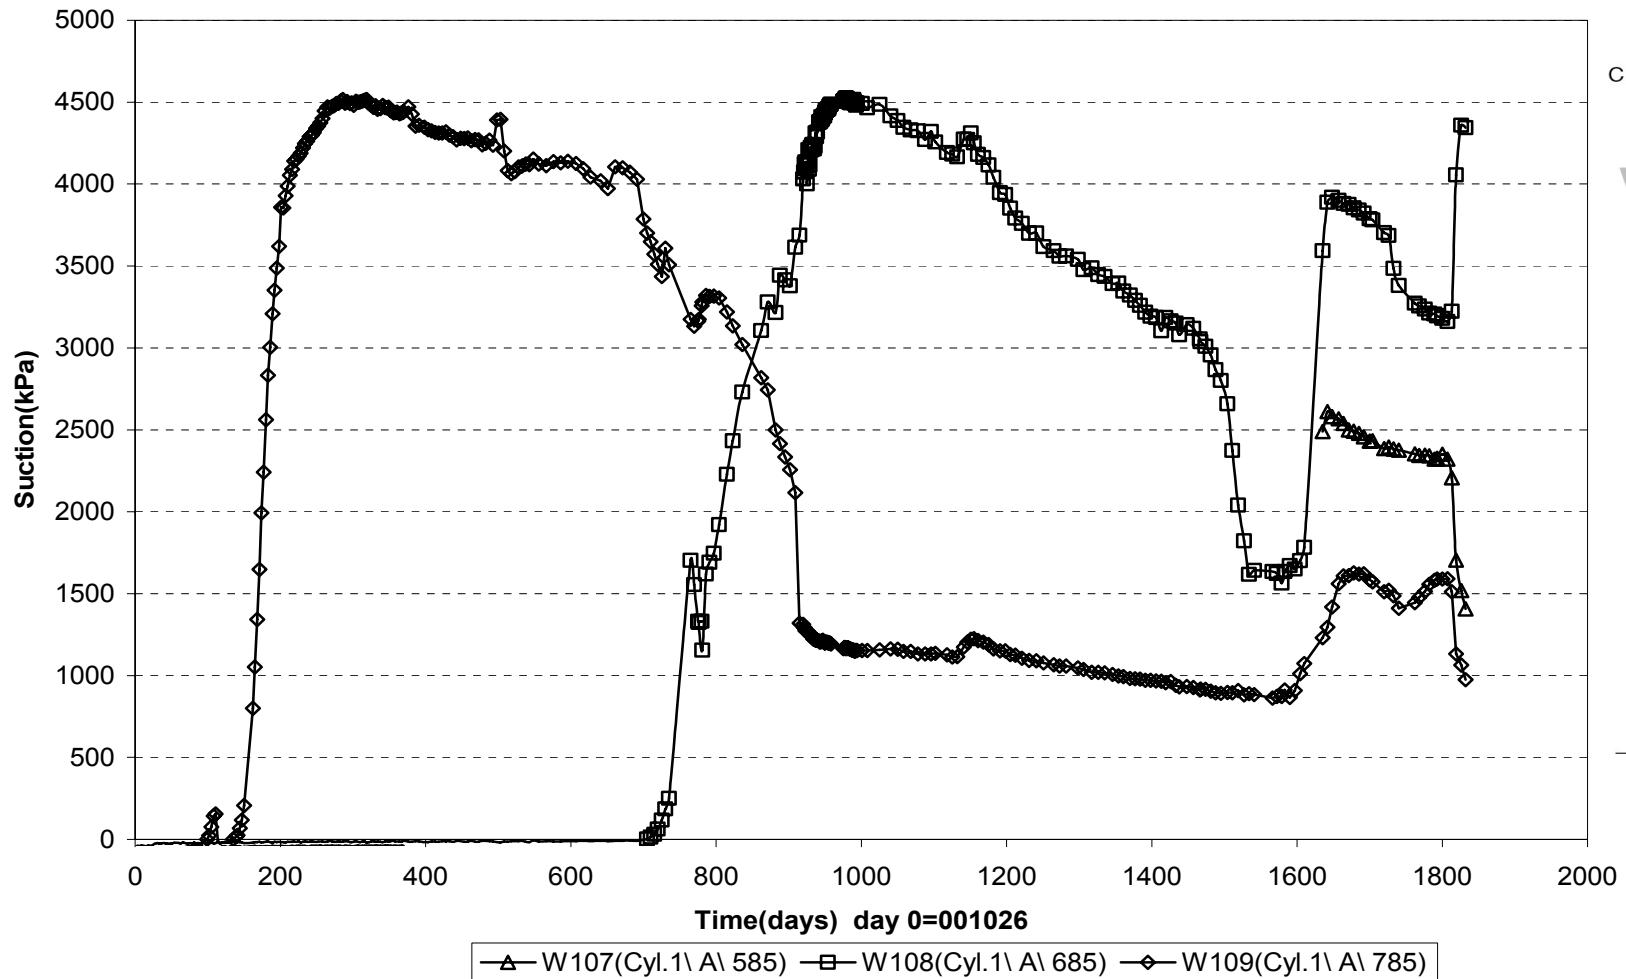



**Suction in the buffer - Cyl.1 (001026-051101)**  
**Wescor**

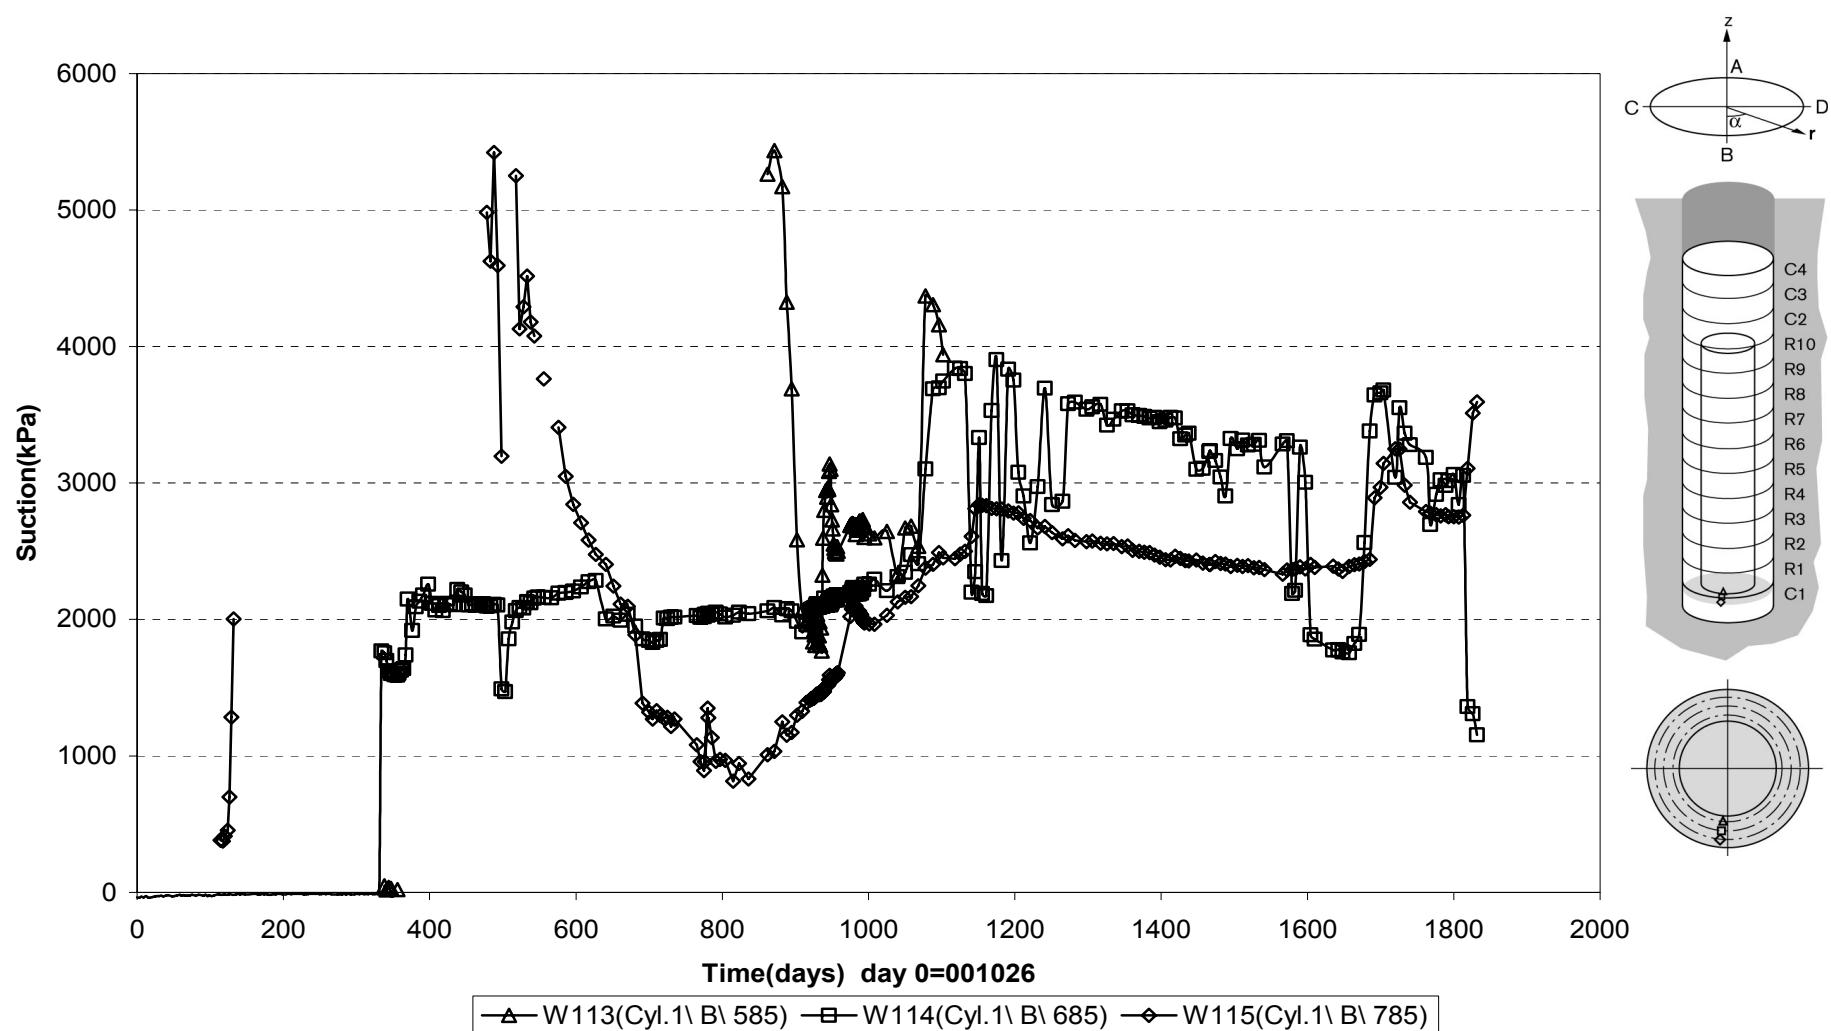



**Suction in the buffer - Cyl.1 (001026-051101)**  
**Wescor**

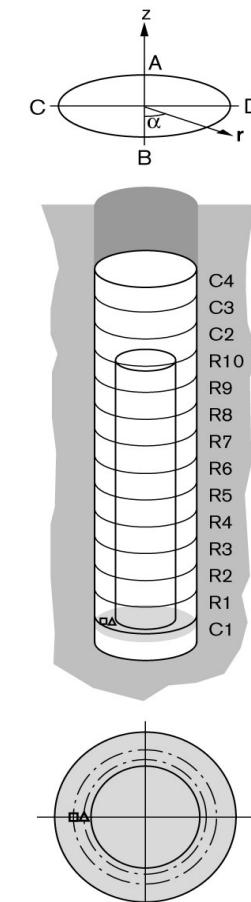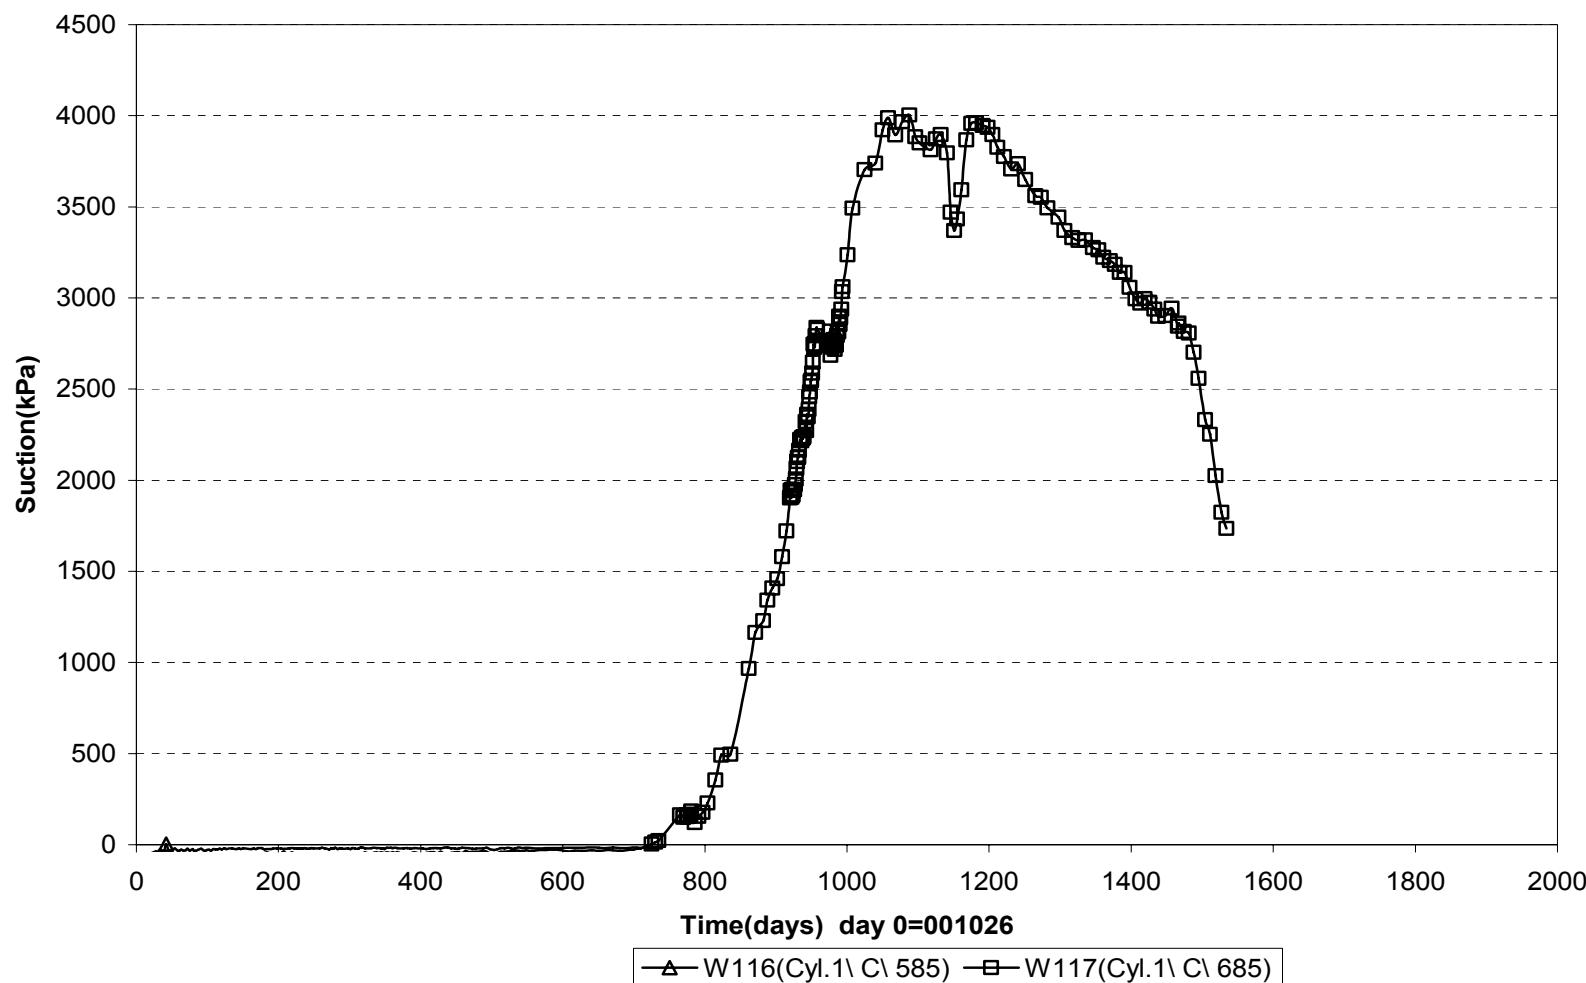


**Suction in the buffer - Ring 5 (001026-051101)**  
**Wescor**

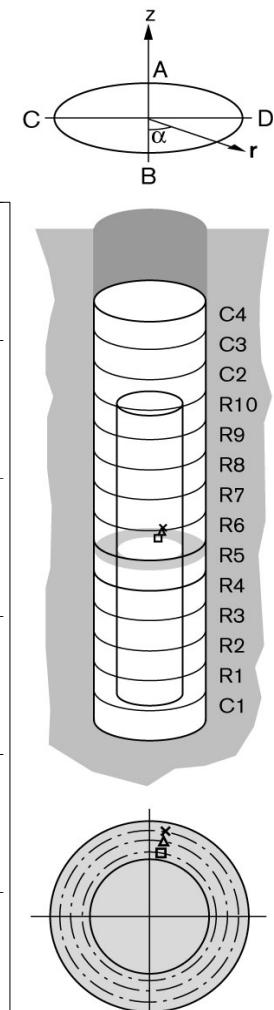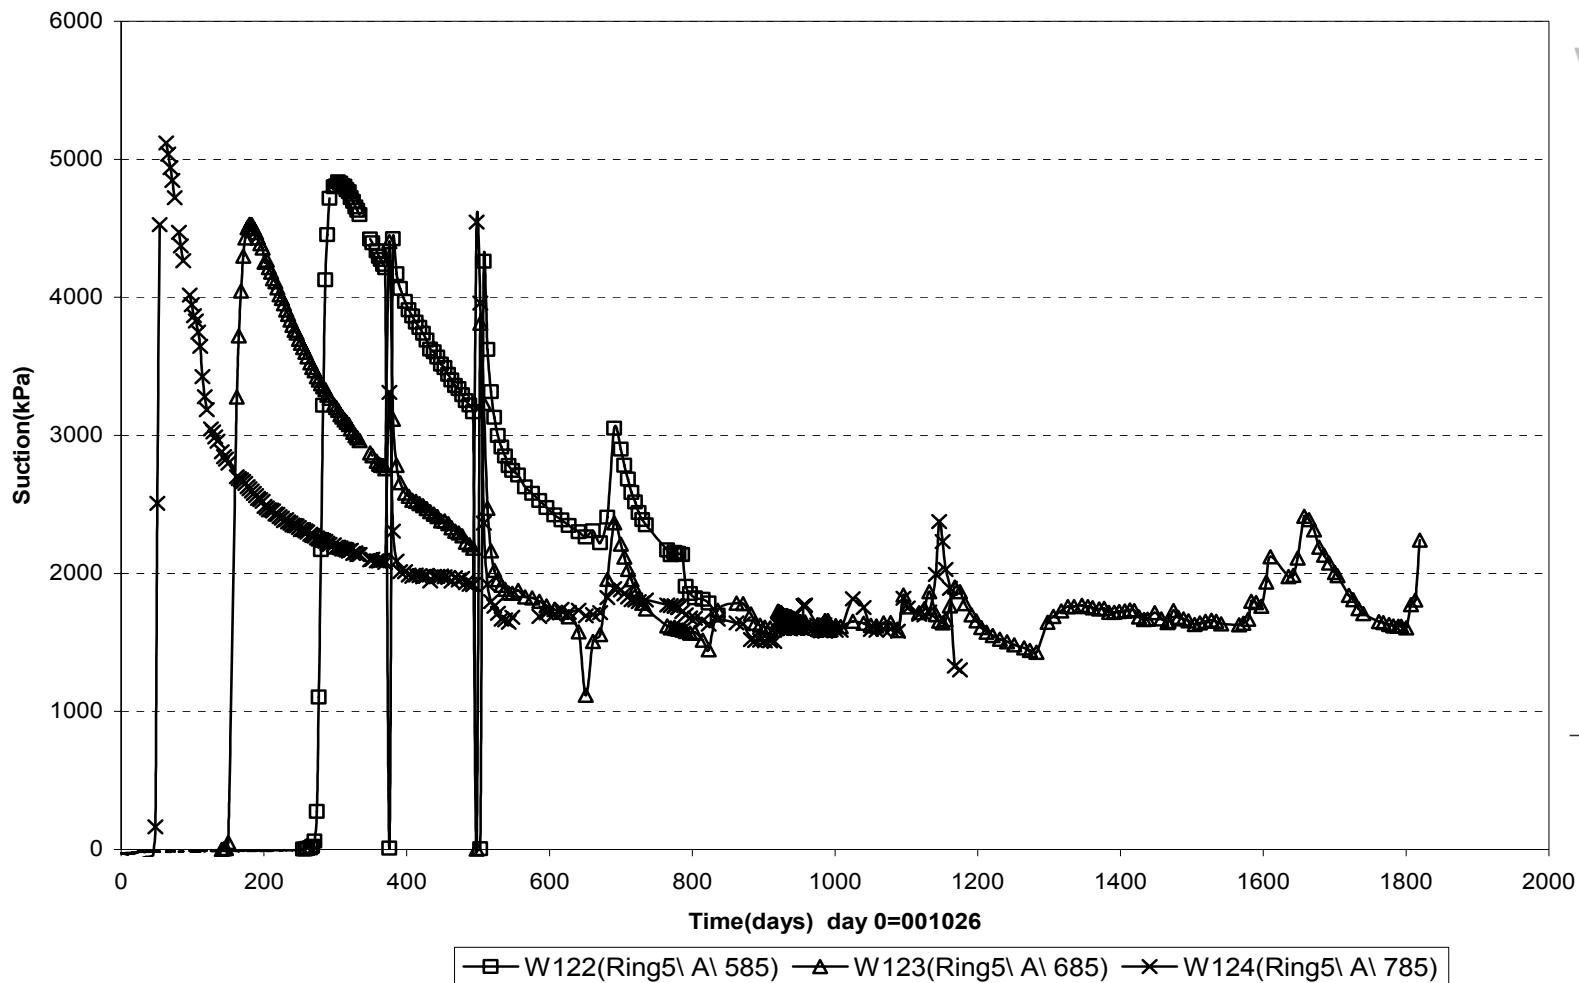



**Suction in the buffer - Ring 5 (001026-051101)**  
**Wescor**

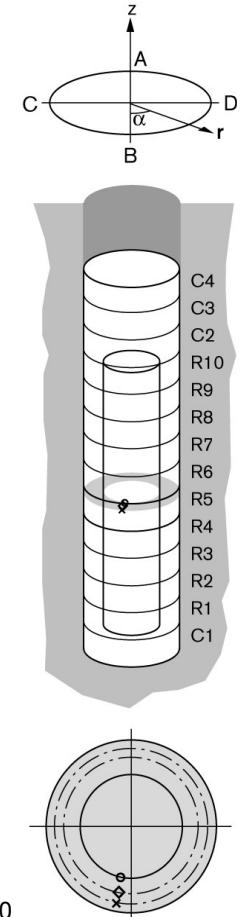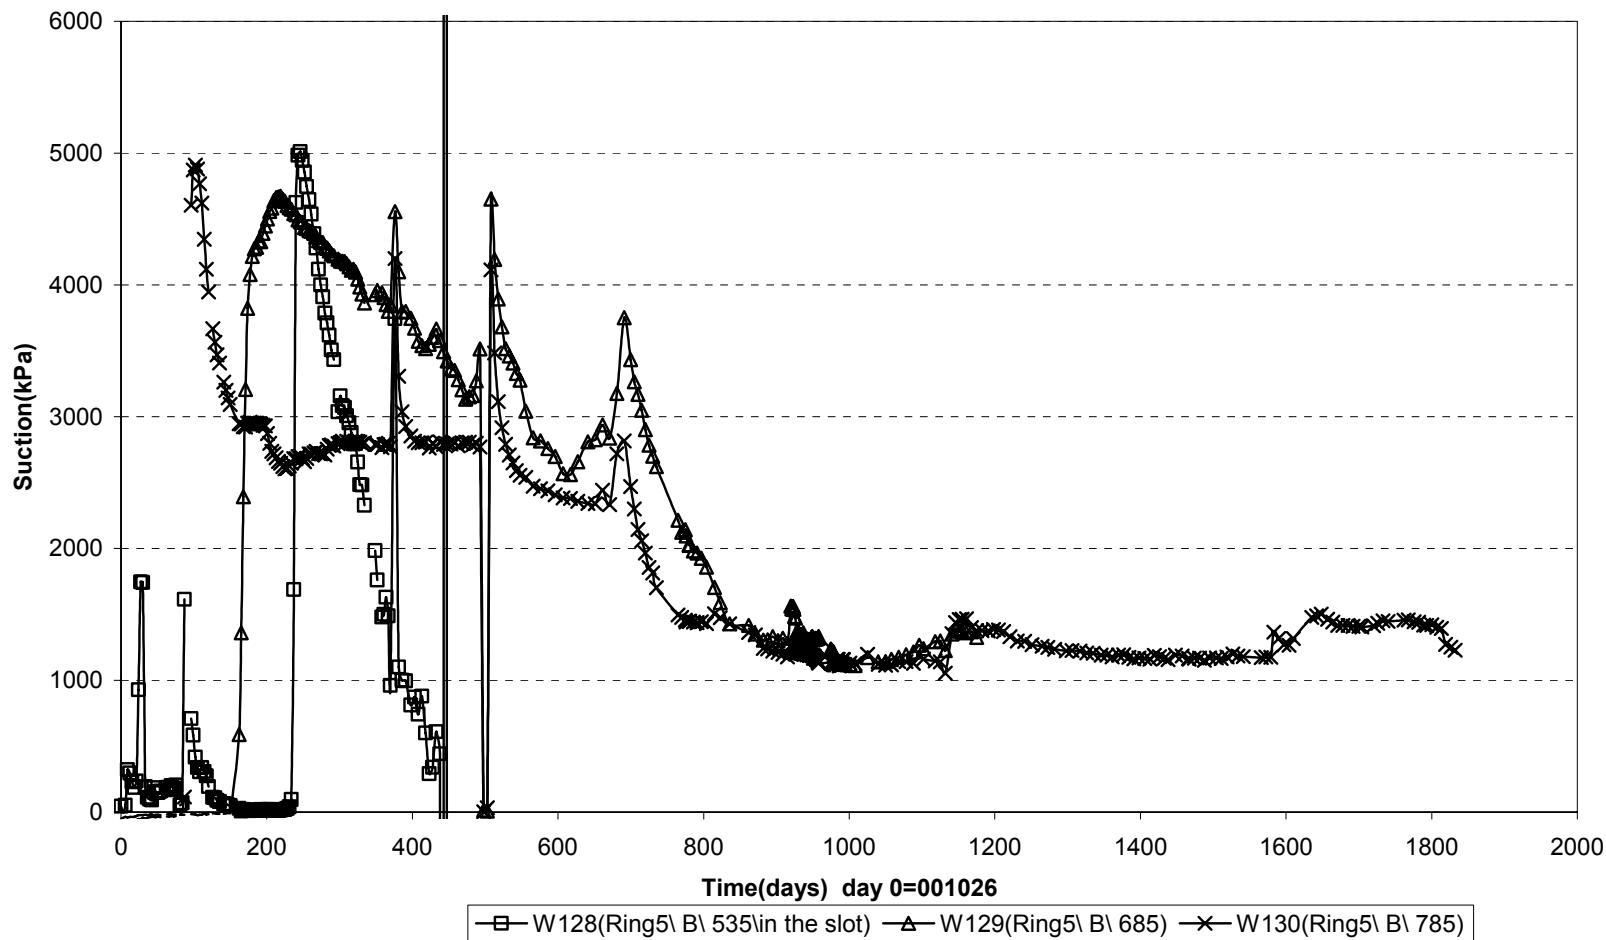



**Suction in the buffer - Ring 5 (001026-051101)**  
**Wescor**

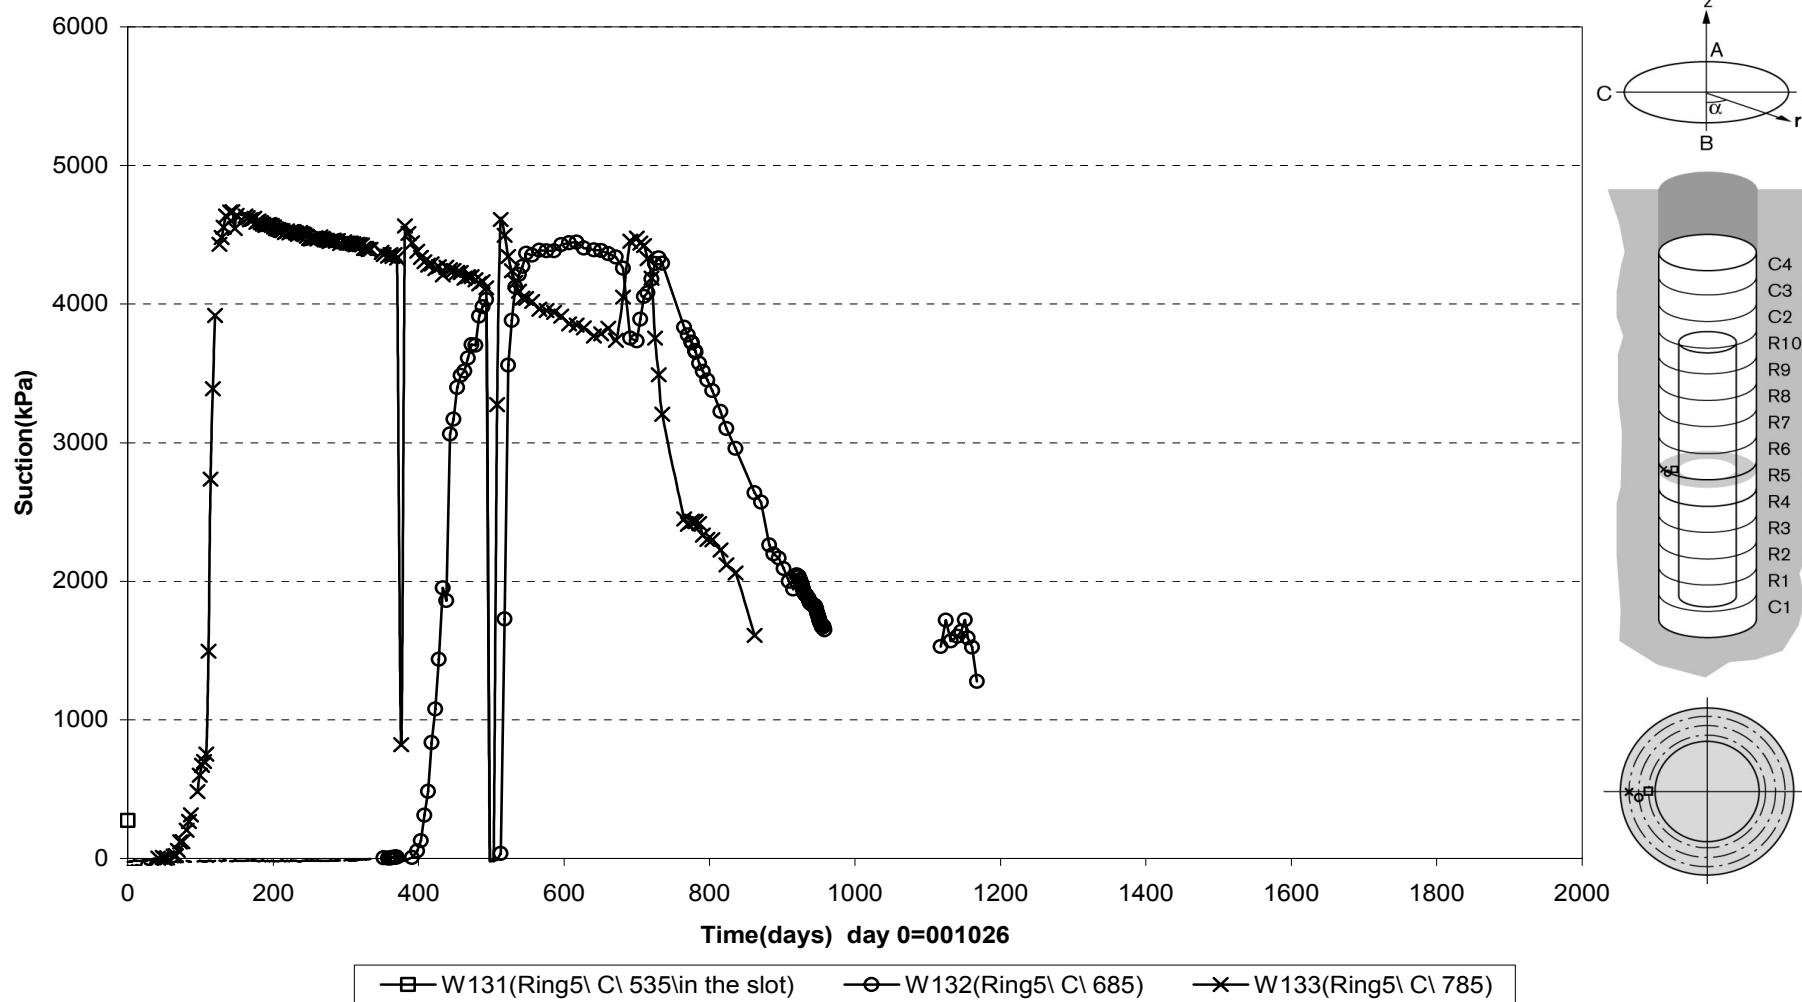



**Suction in the buffer - Ring 10 (001026-051101)**  
**Wescor**

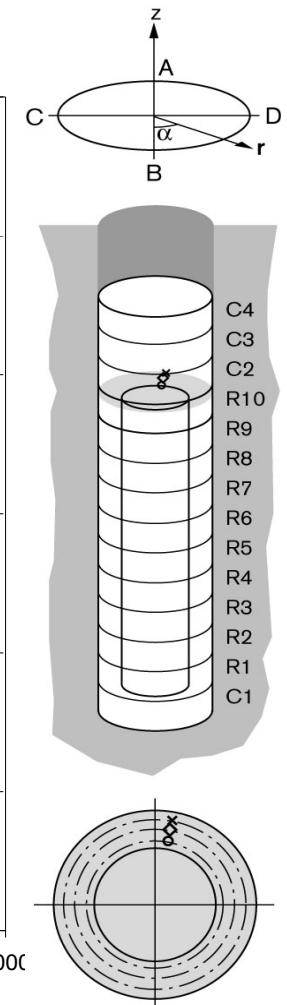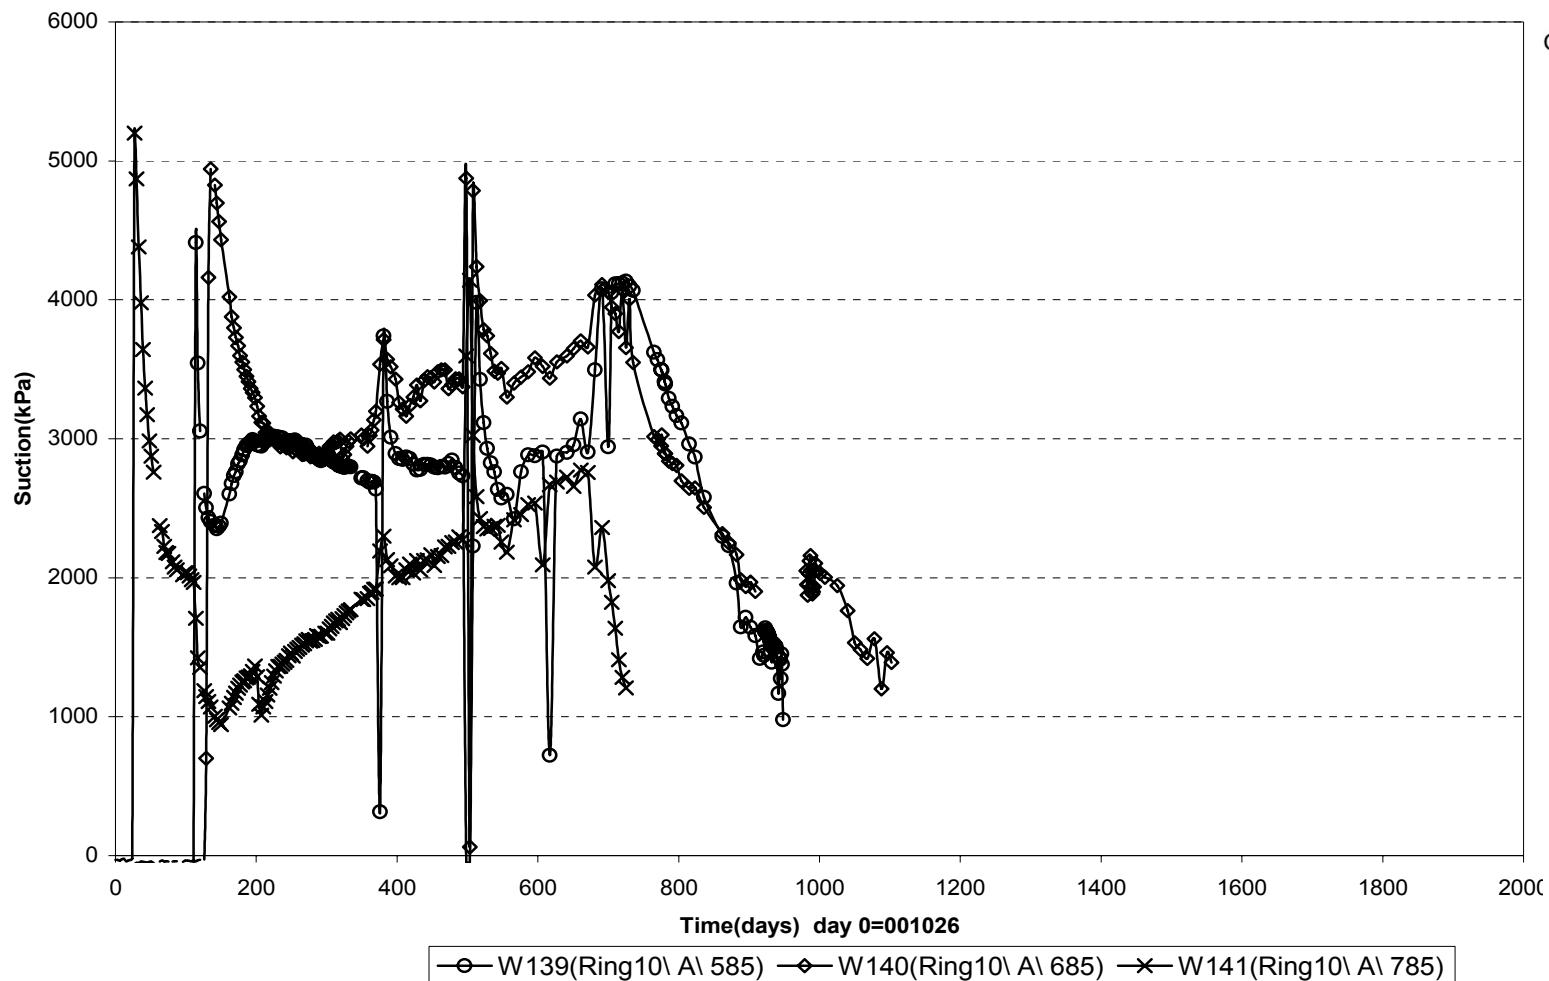



**Suction in the buffer - Ring 10 (001026-051101)**  
**Wescor**

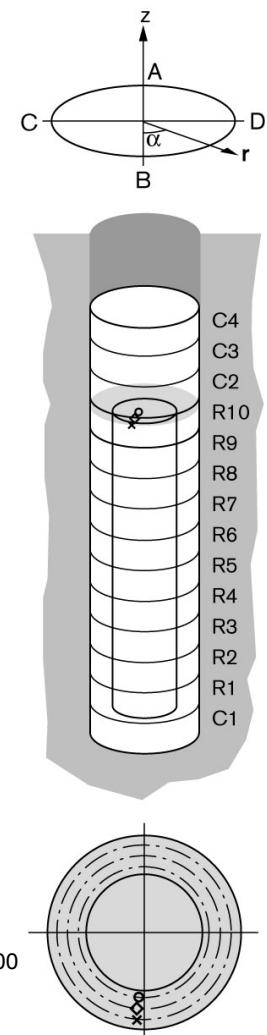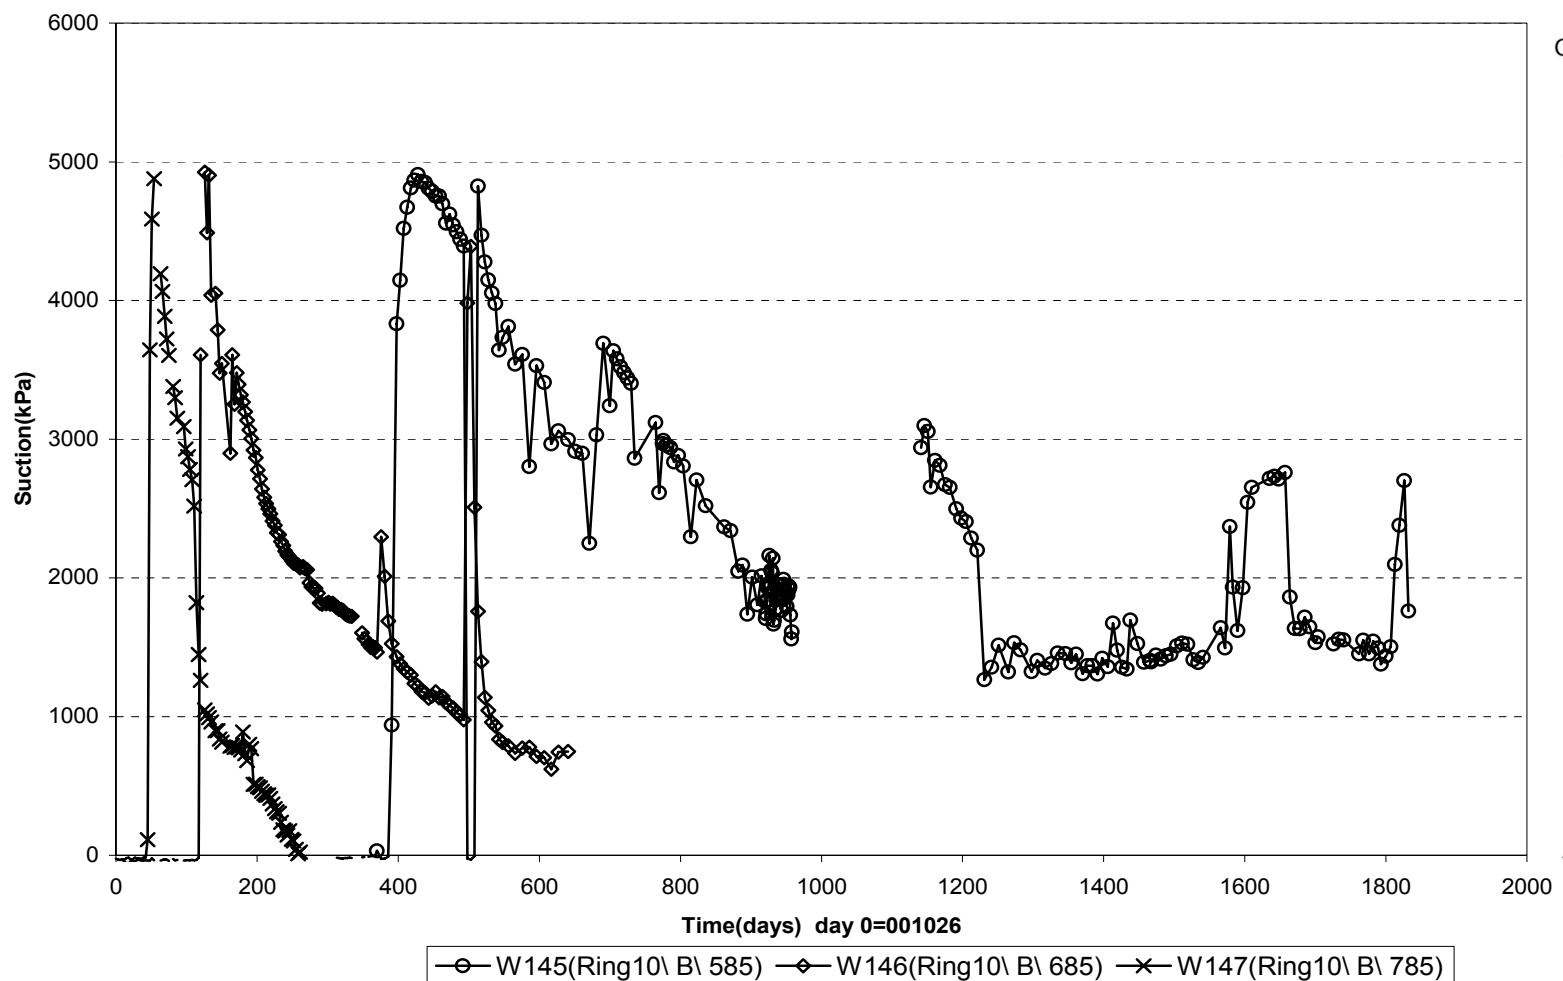


**Suction in the buffer - Ring 10 (001026-051101)**  
**Wescor**

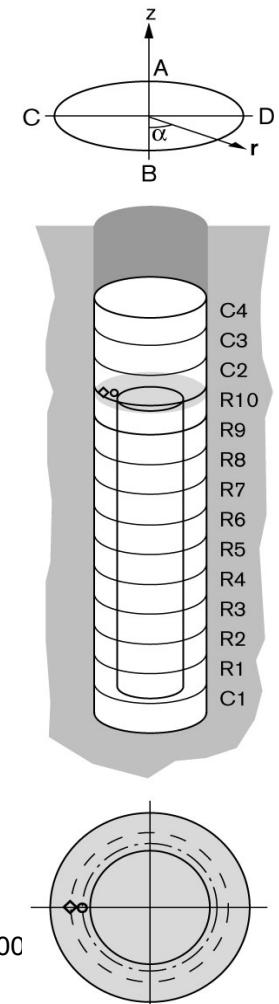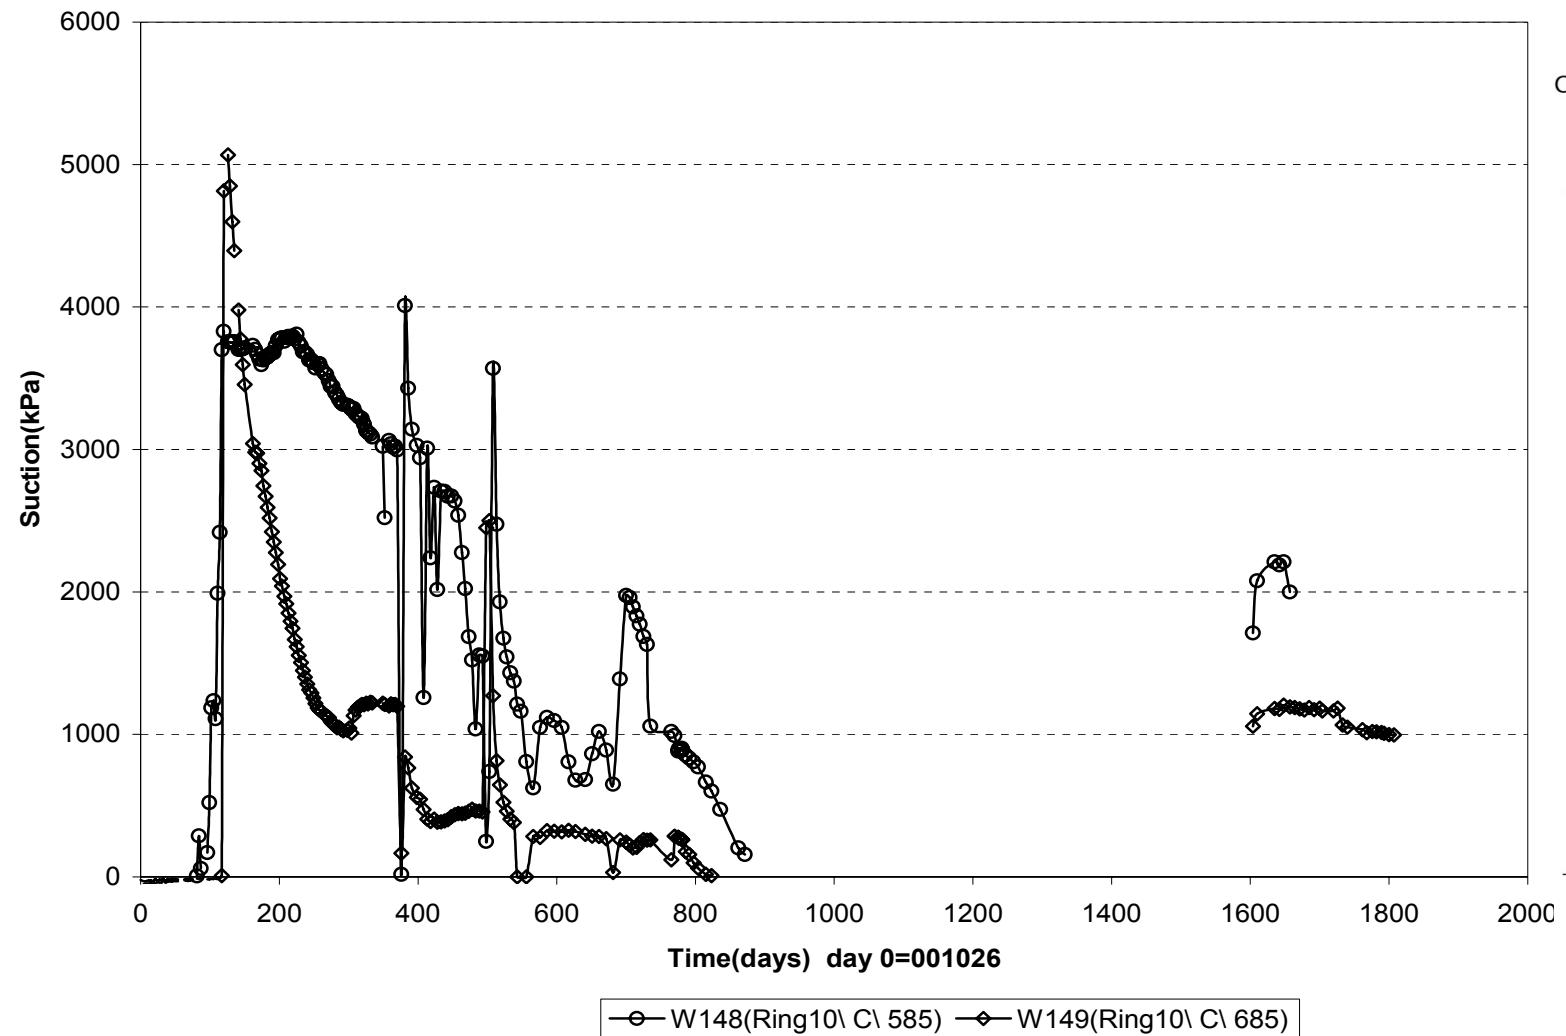



**Suction in the buffer - Cyl.3 (001026-051101)**  
**Wescor**

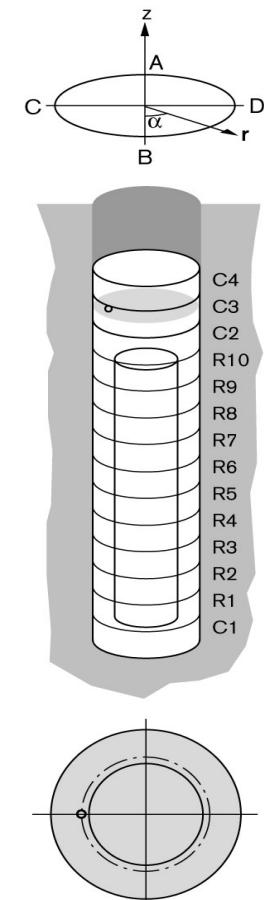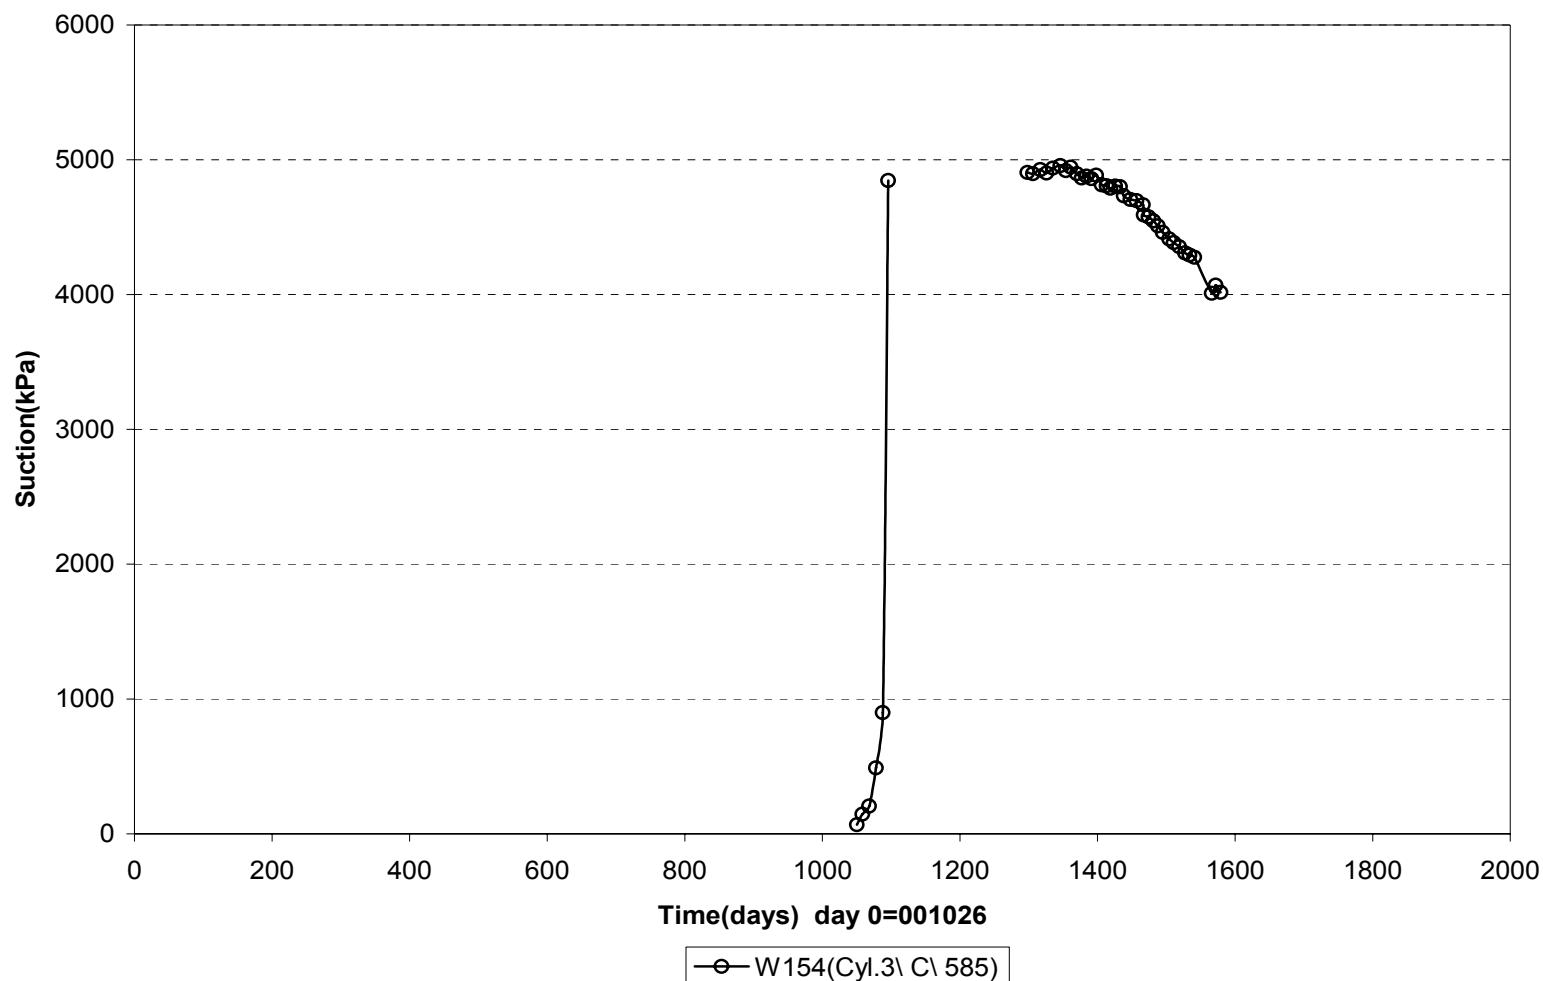


**Relative humidity - Cylinder 1 (001026-051101)**  
**Vaisala**

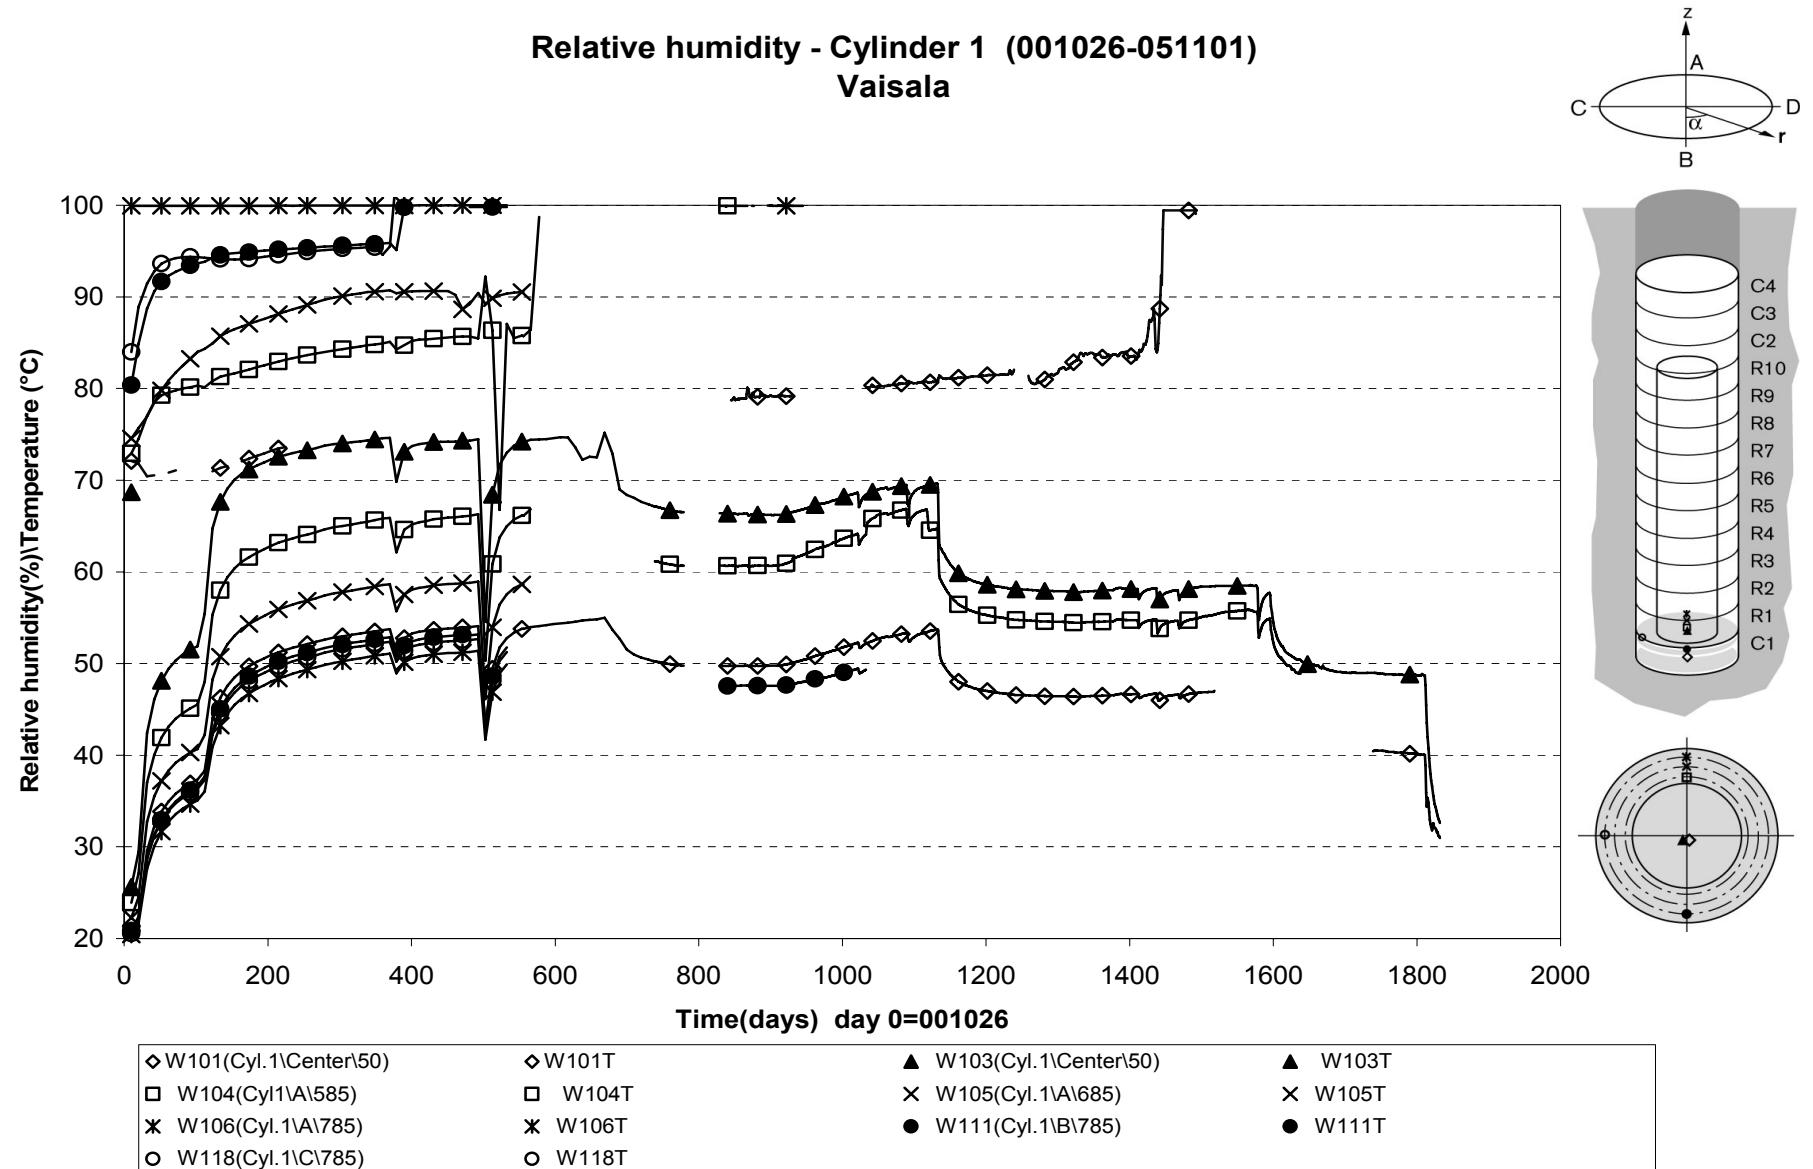



**Relative humidity- Ring 5 (001026-051101)**  
**Vaisala**

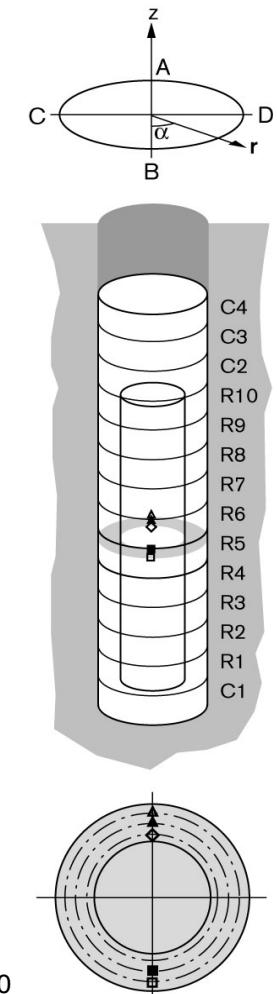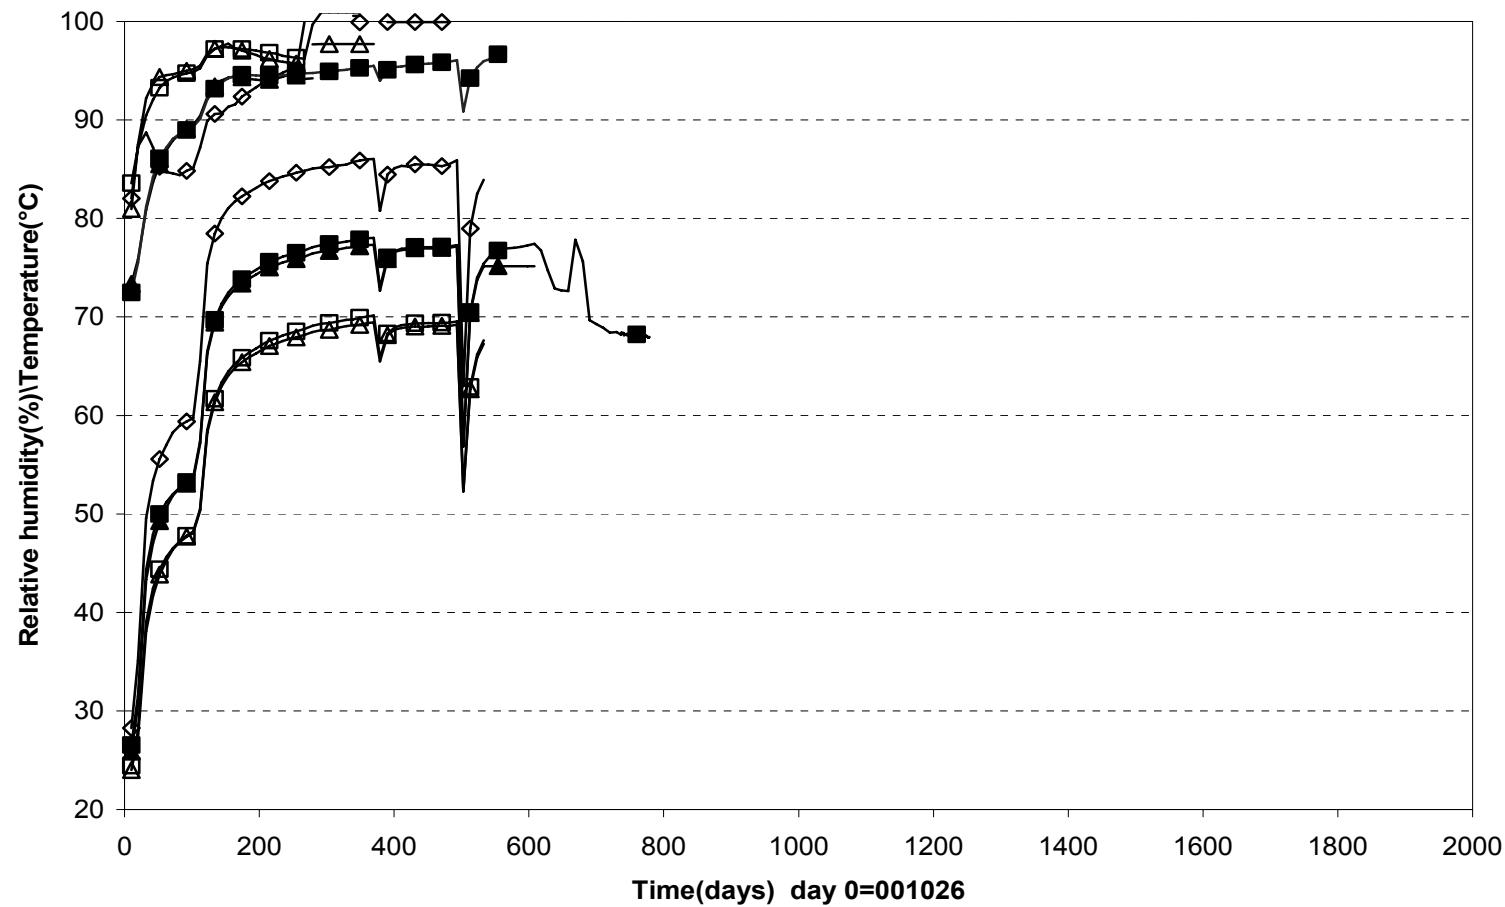


**Relative humidity - Ring 10 (001026-051101)**  
**Vaisala**

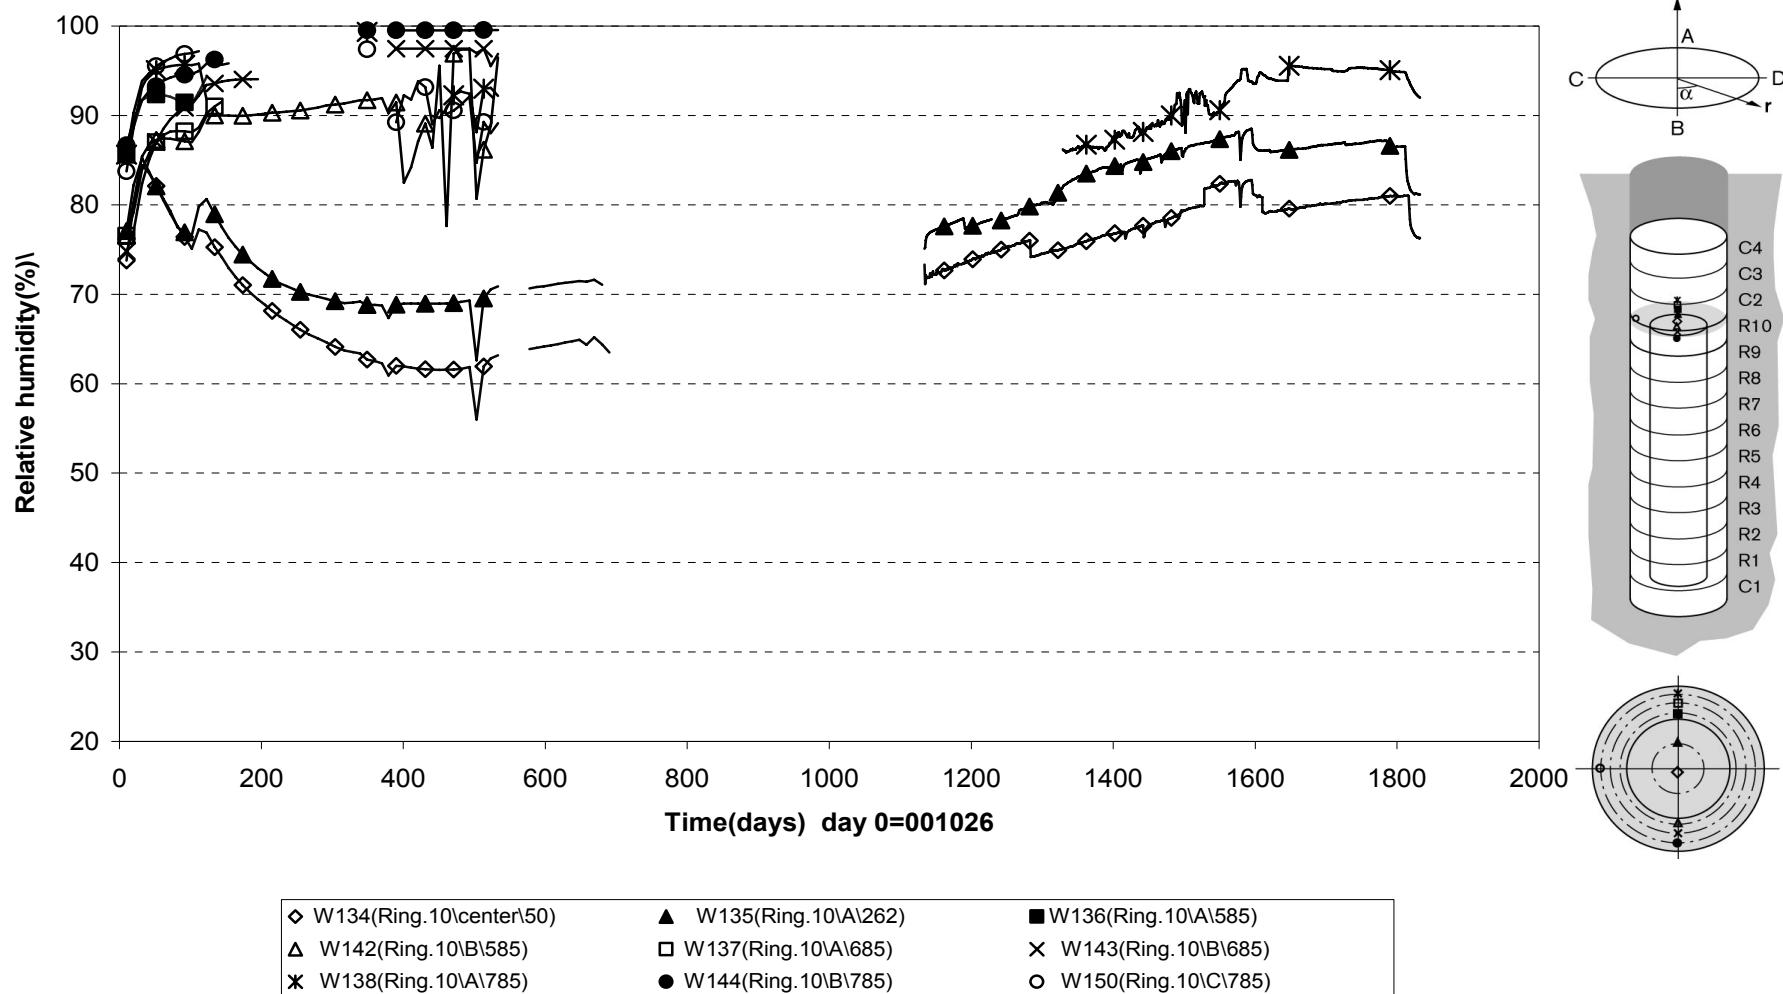



**Relative humidity - Ring 10 (001026-051101)**  
**Vaisala**

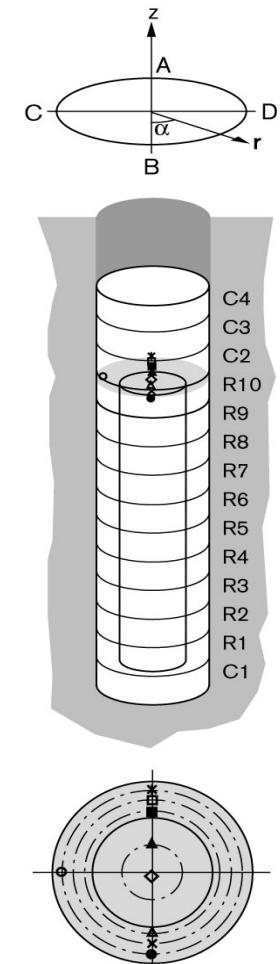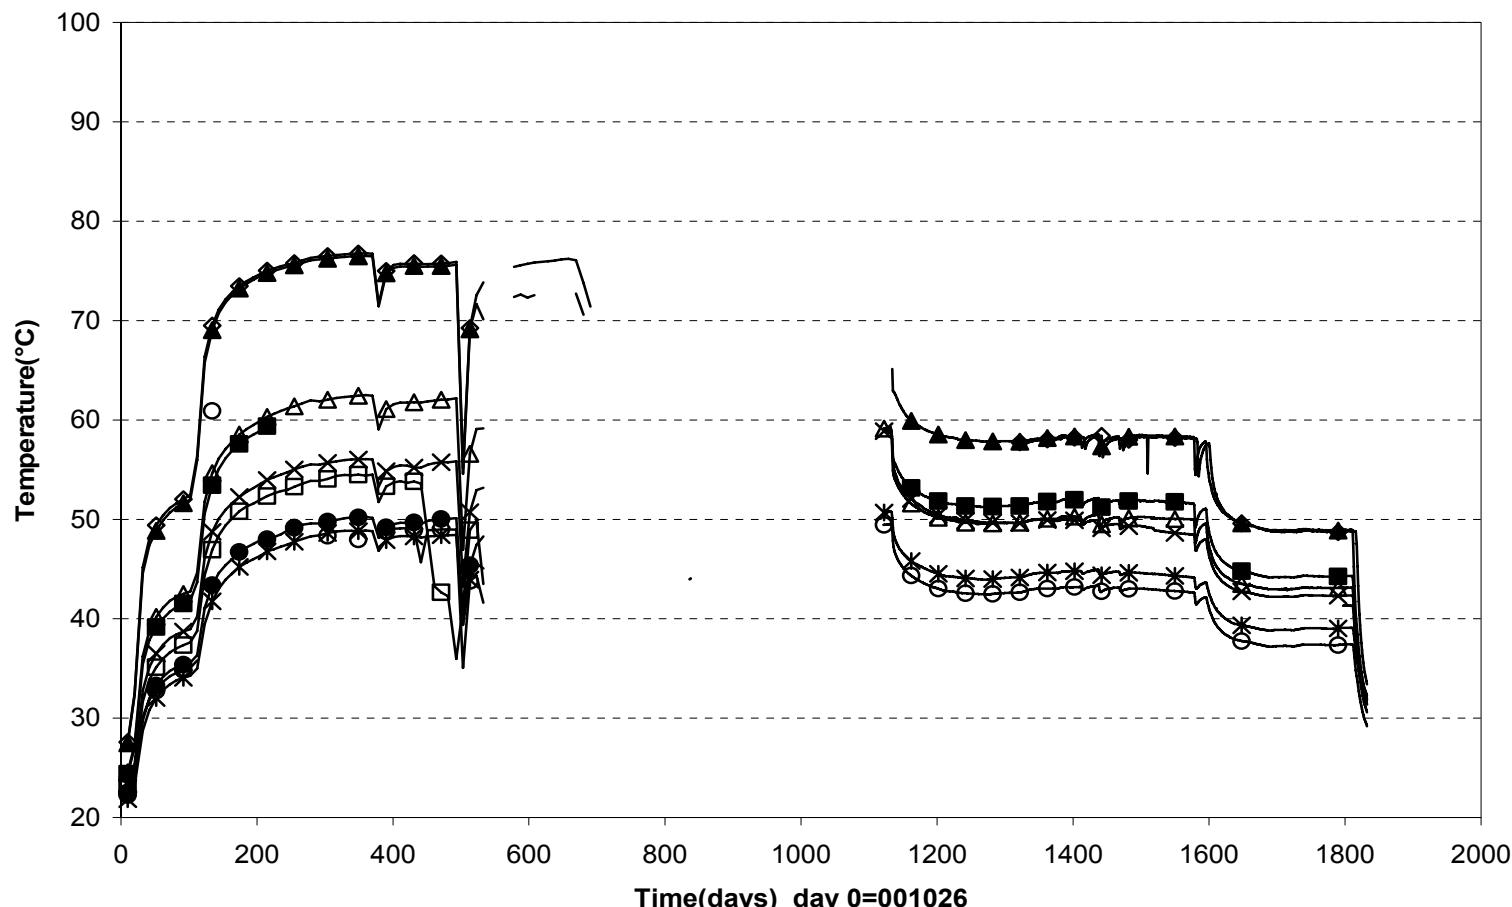


**Relative humidity - Cylinder 3 and Cylinder 4 (001026-051101)**  
**Vaisala**

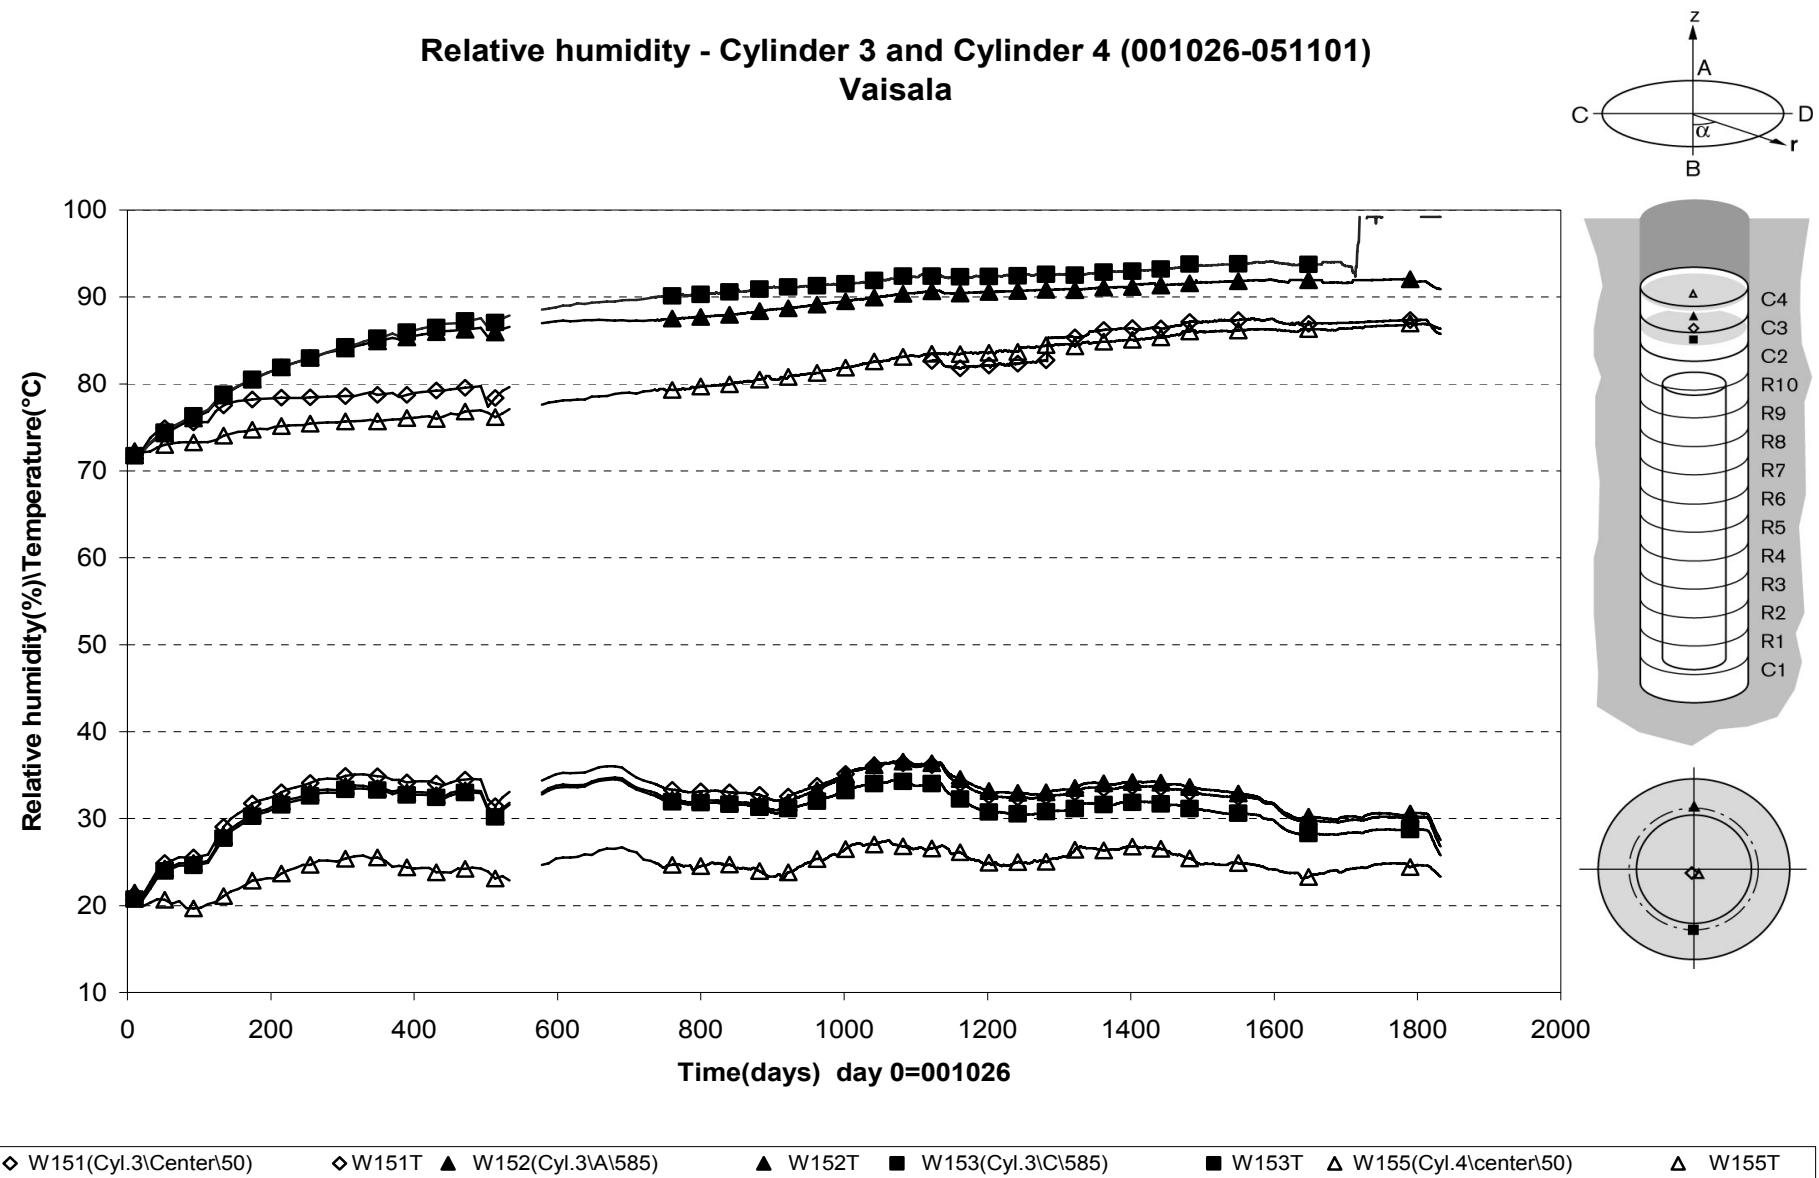


Pore water pressure - Ring 5 and Ring 10 (001026-051101)  
Geokon

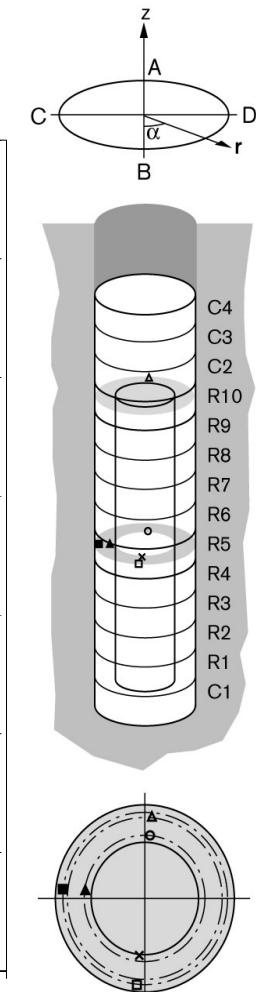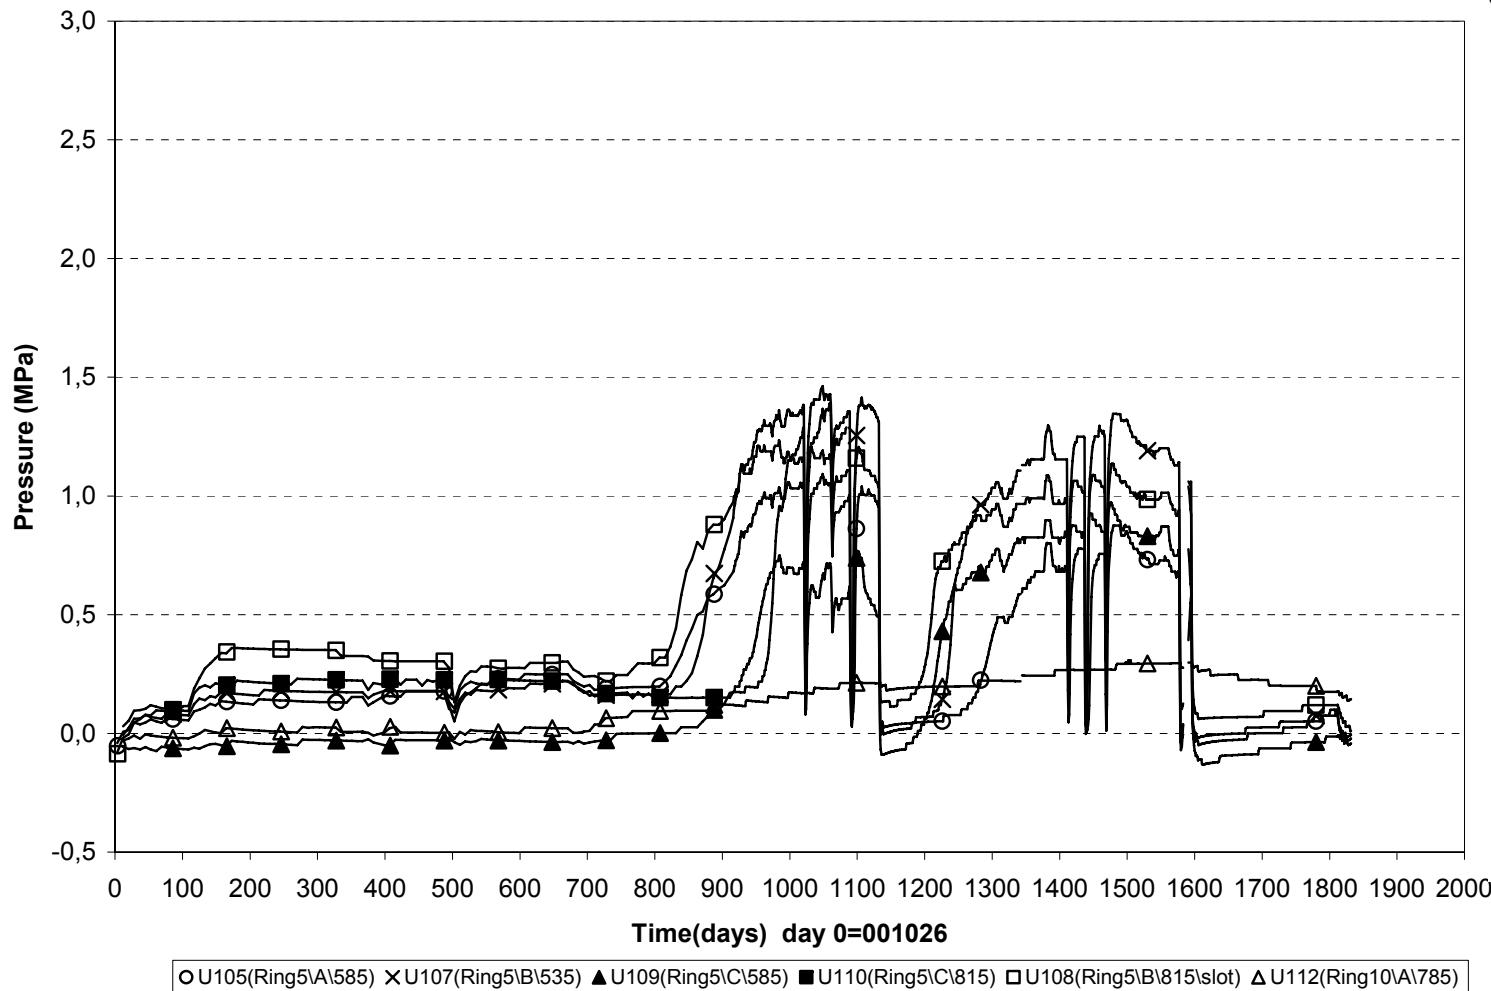


Pore water pressure - Cylinder 1 and Cylinder 3 (001026-051101)  
Geokon

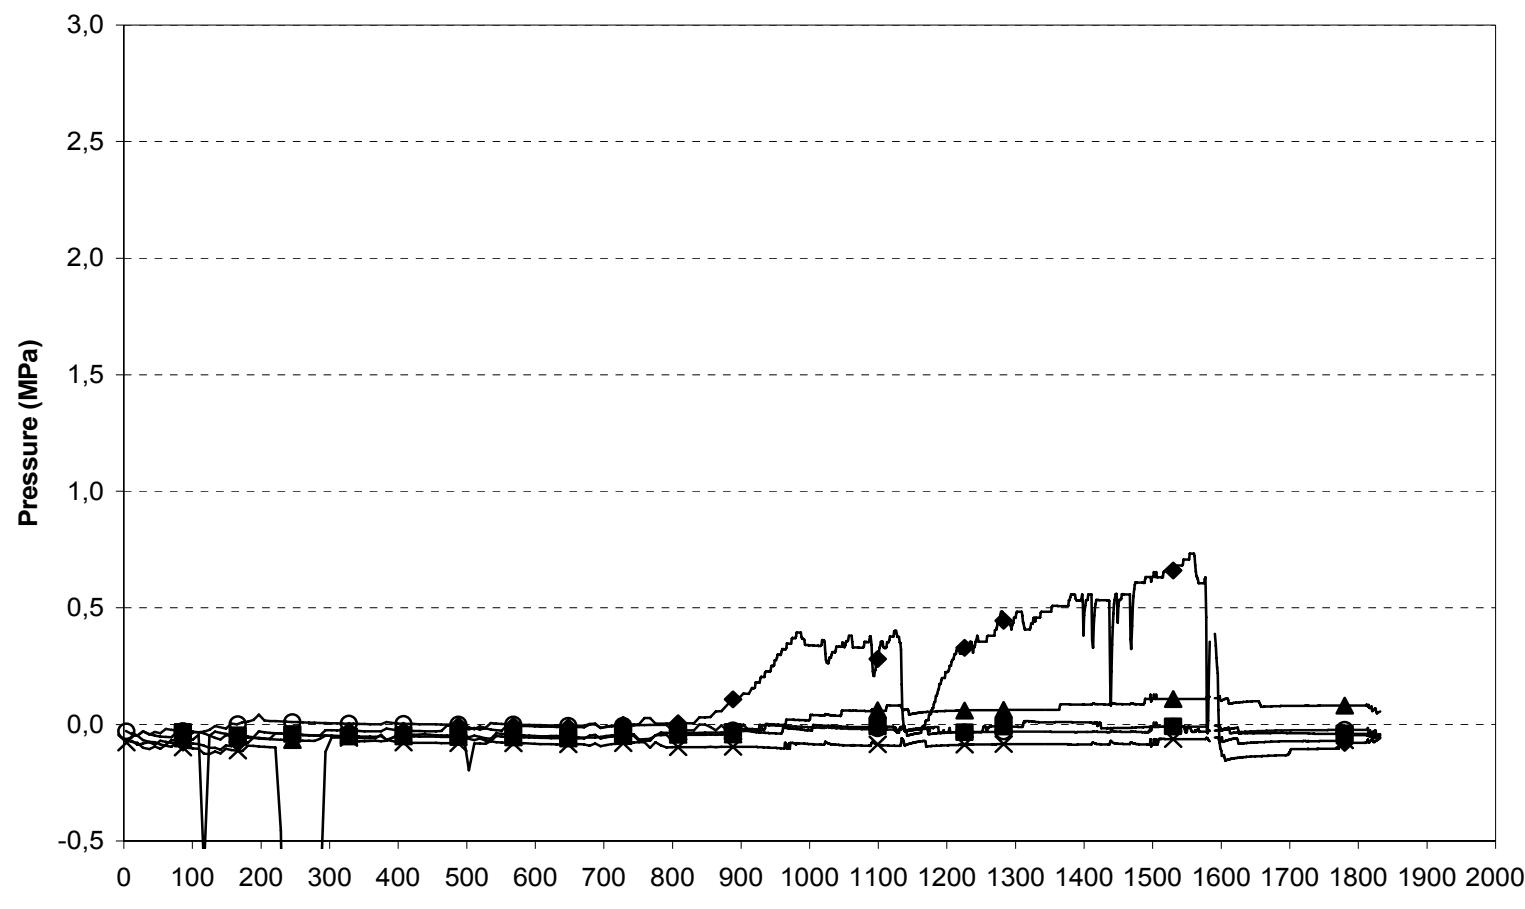


○ U101(Cyl.1\center\50) ✕ U102(Cyl.1\center\50) ▲ U103(Cyl.1\A\585) ◆ U104(Cyl.1\A\785) ■ U113(Cyl.3\center\50)

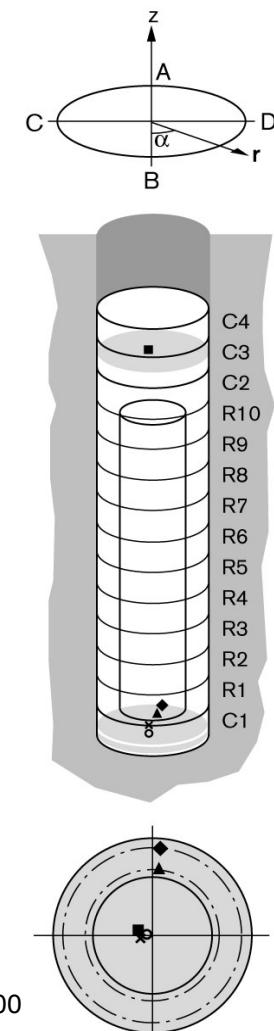


Pore water pressure - Ring 10 & Cylinder 4 (001026-051101)  
Kulite

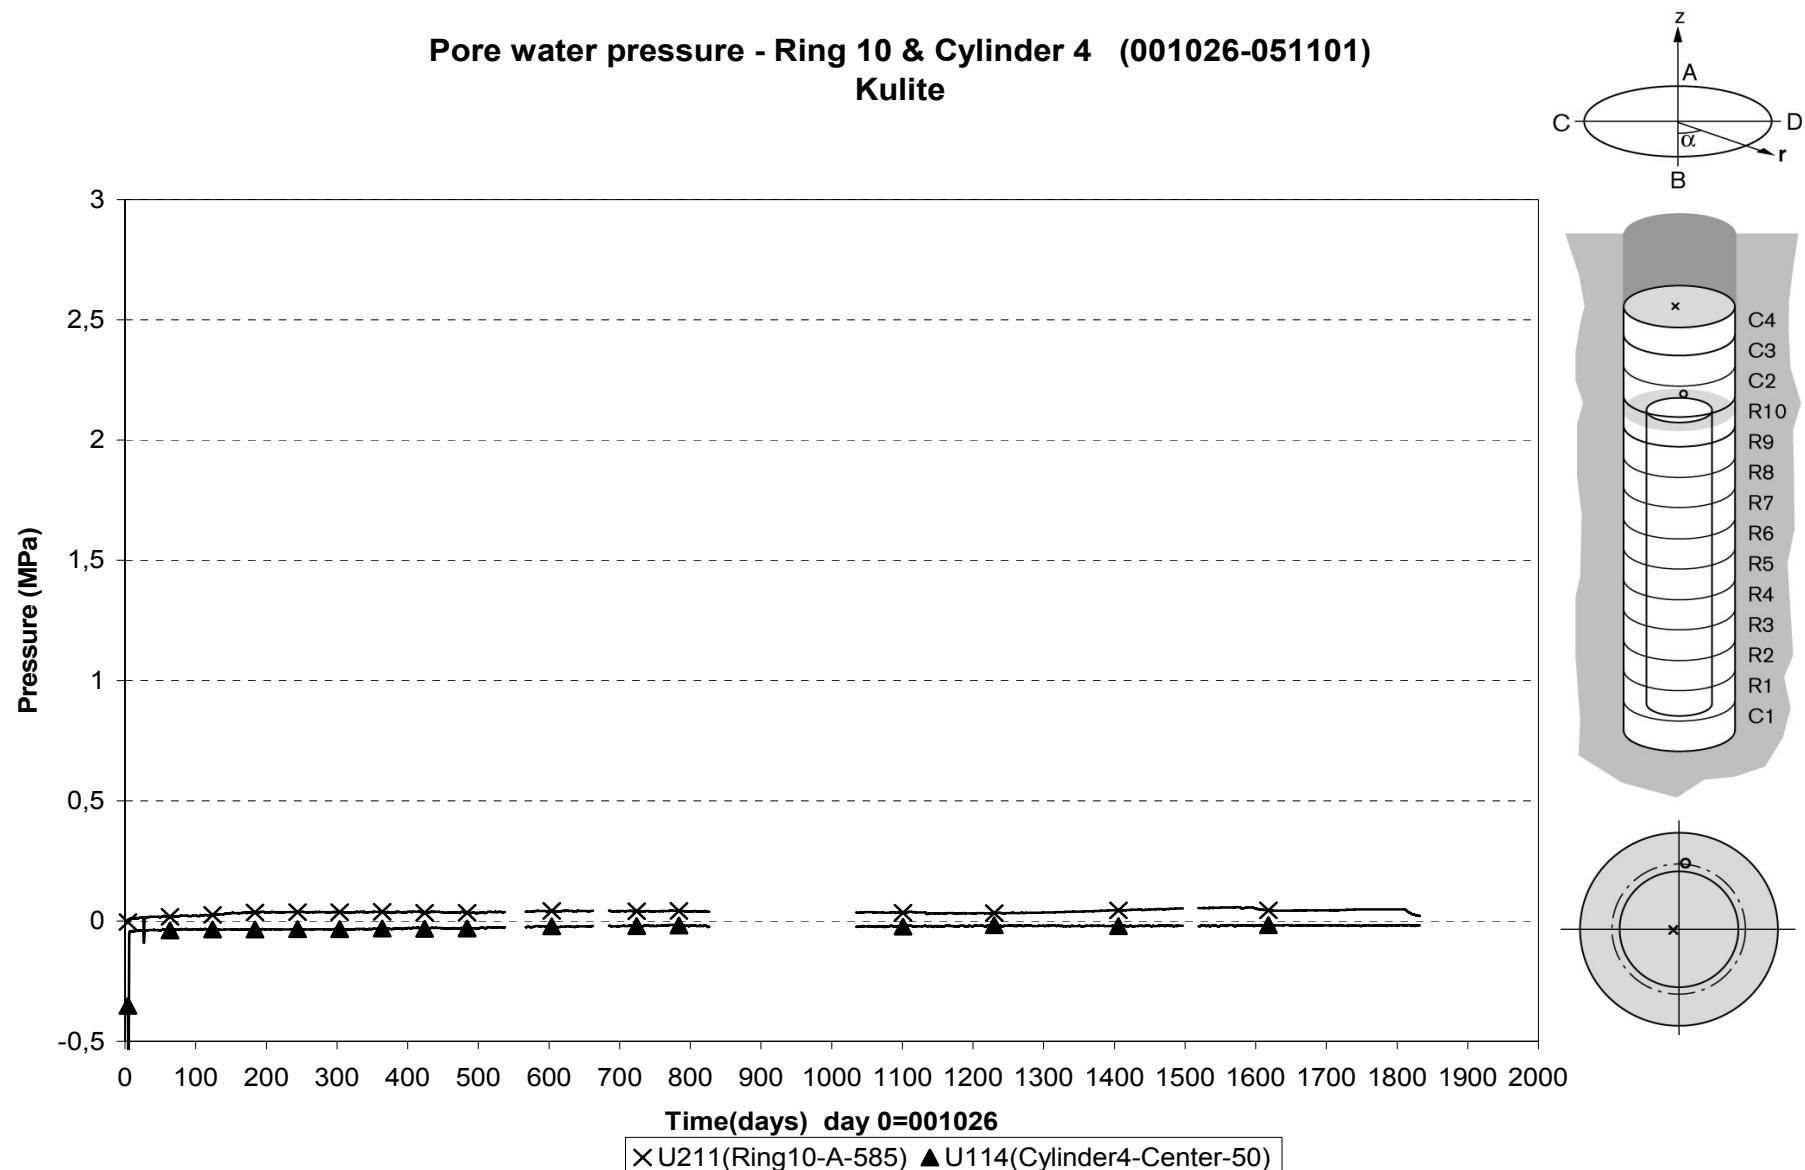


### Inflow into filter (001026-051101)

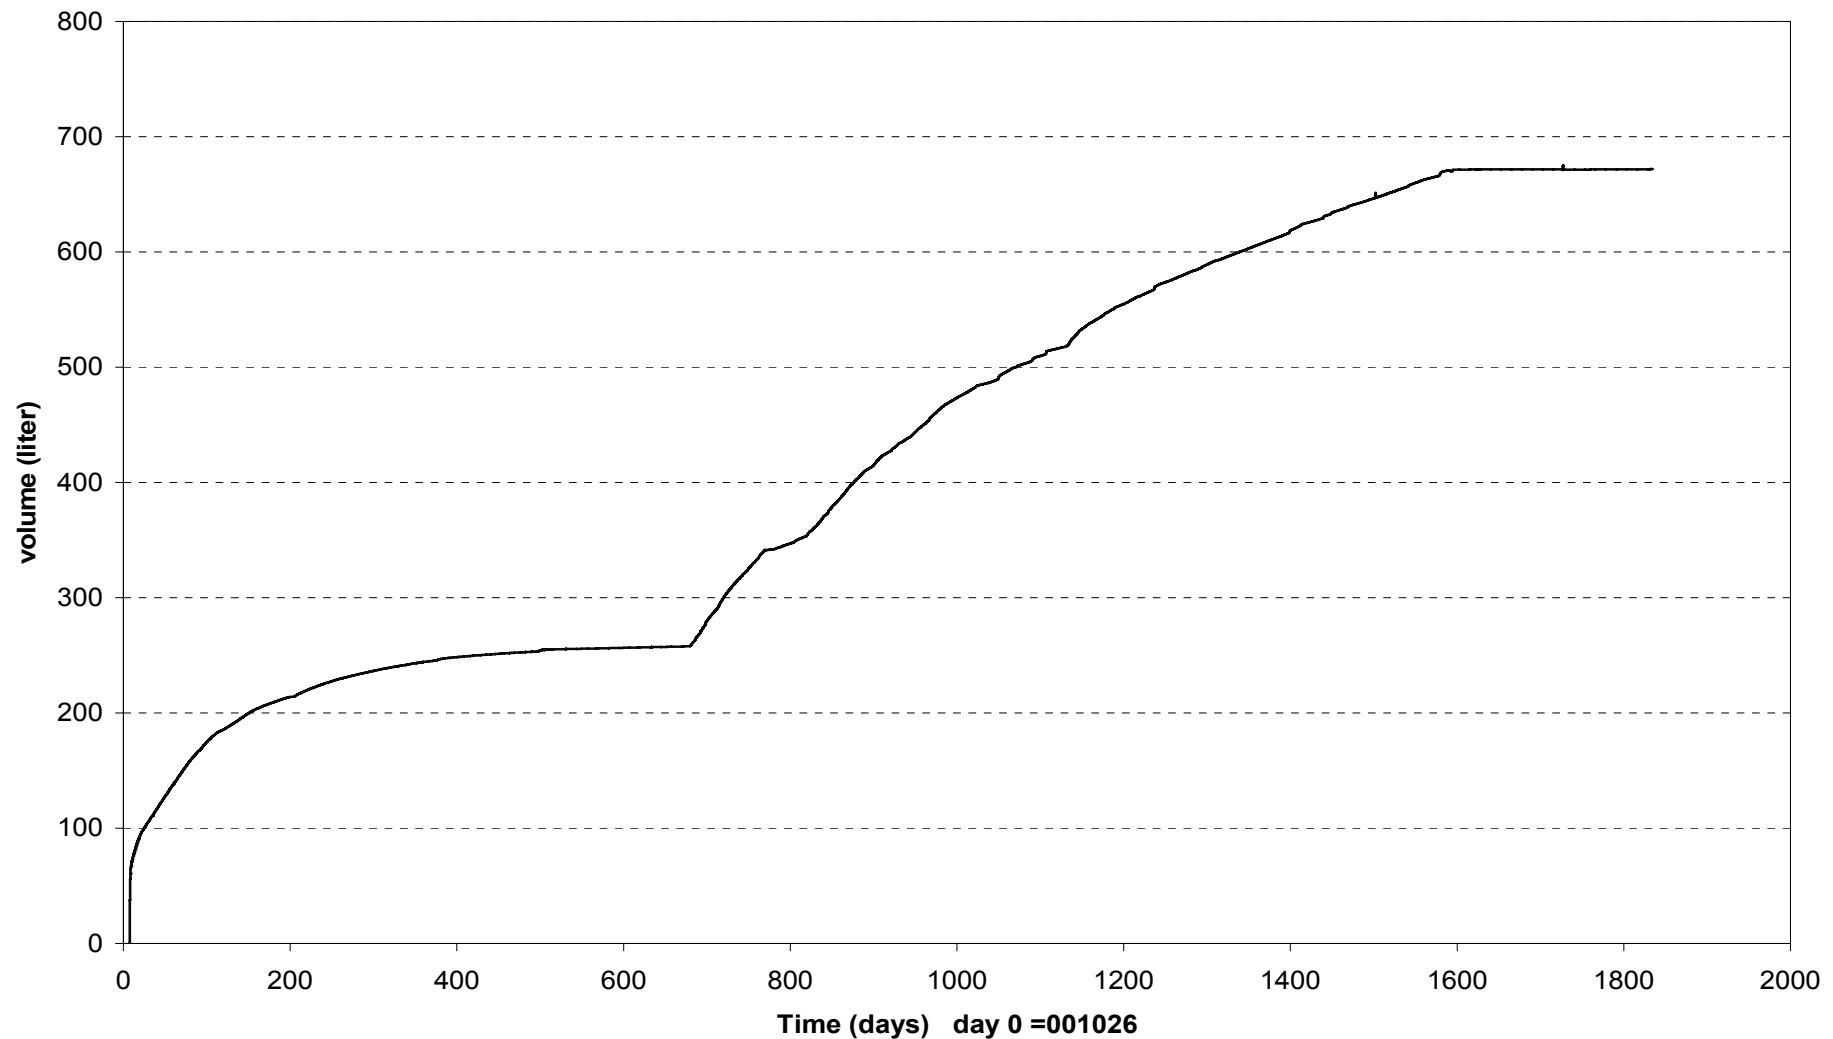


### Forces on plug (001026-051101)

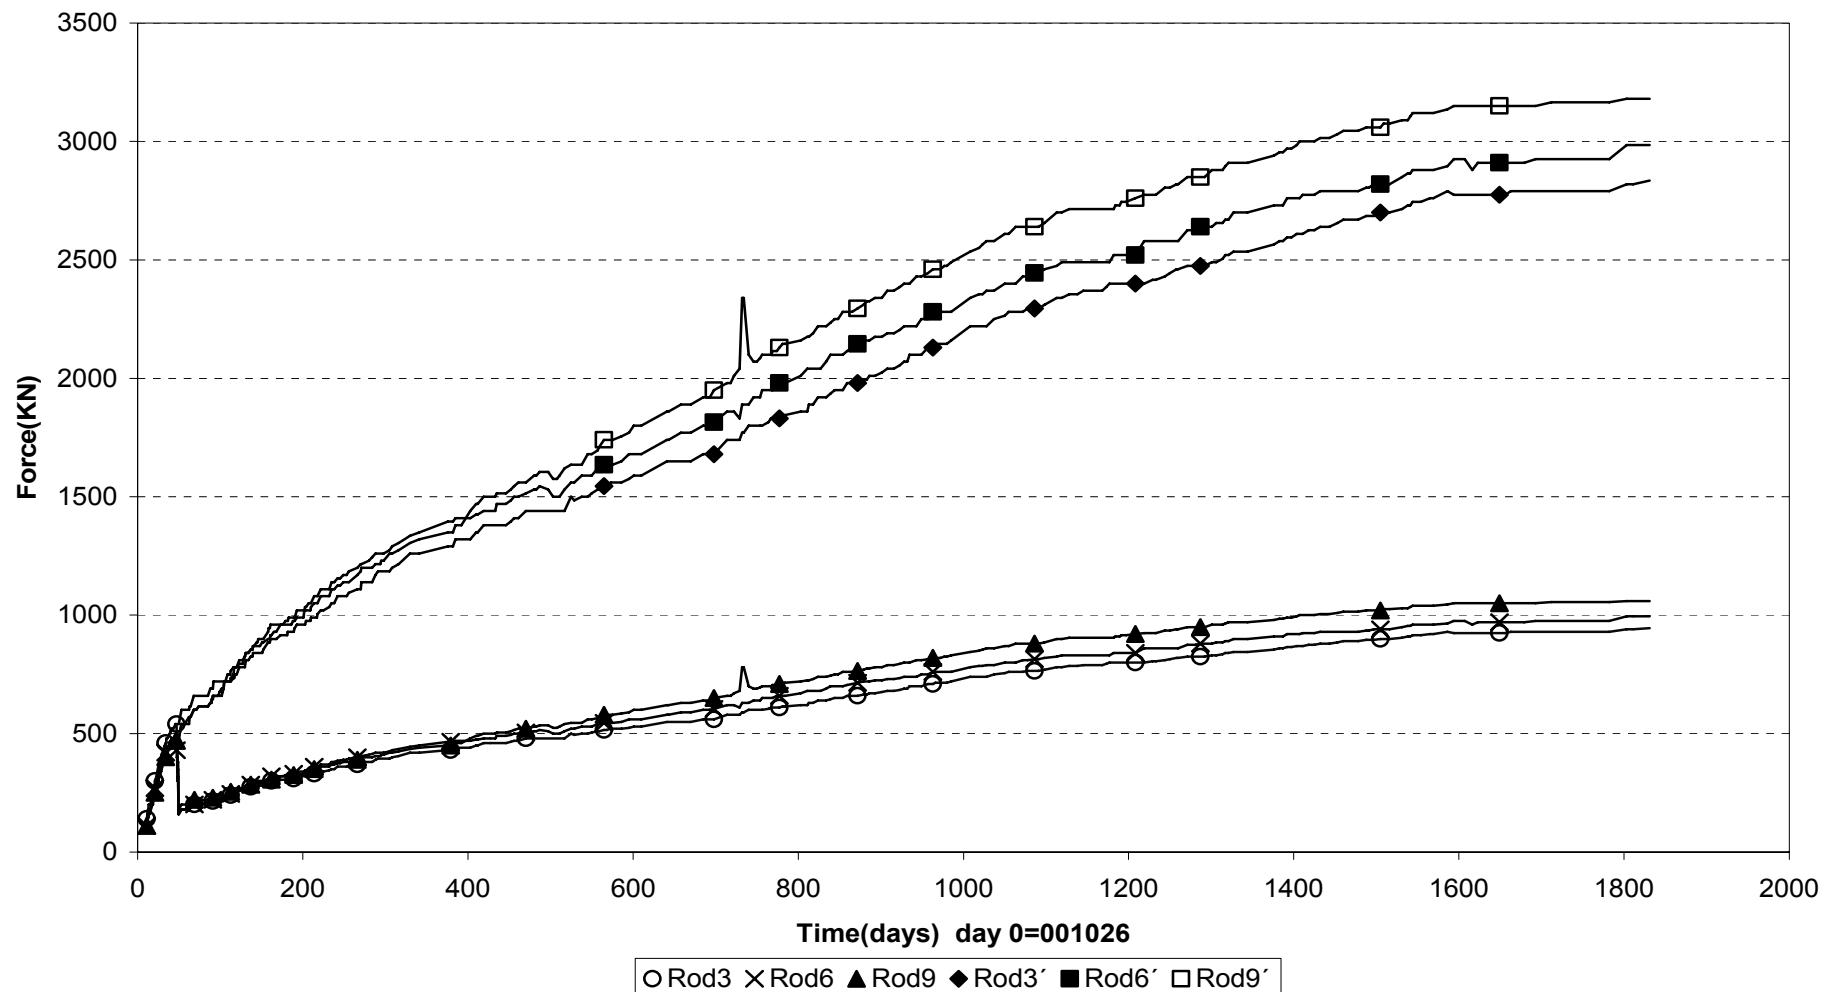


### Displacement of plug (001026-051101)


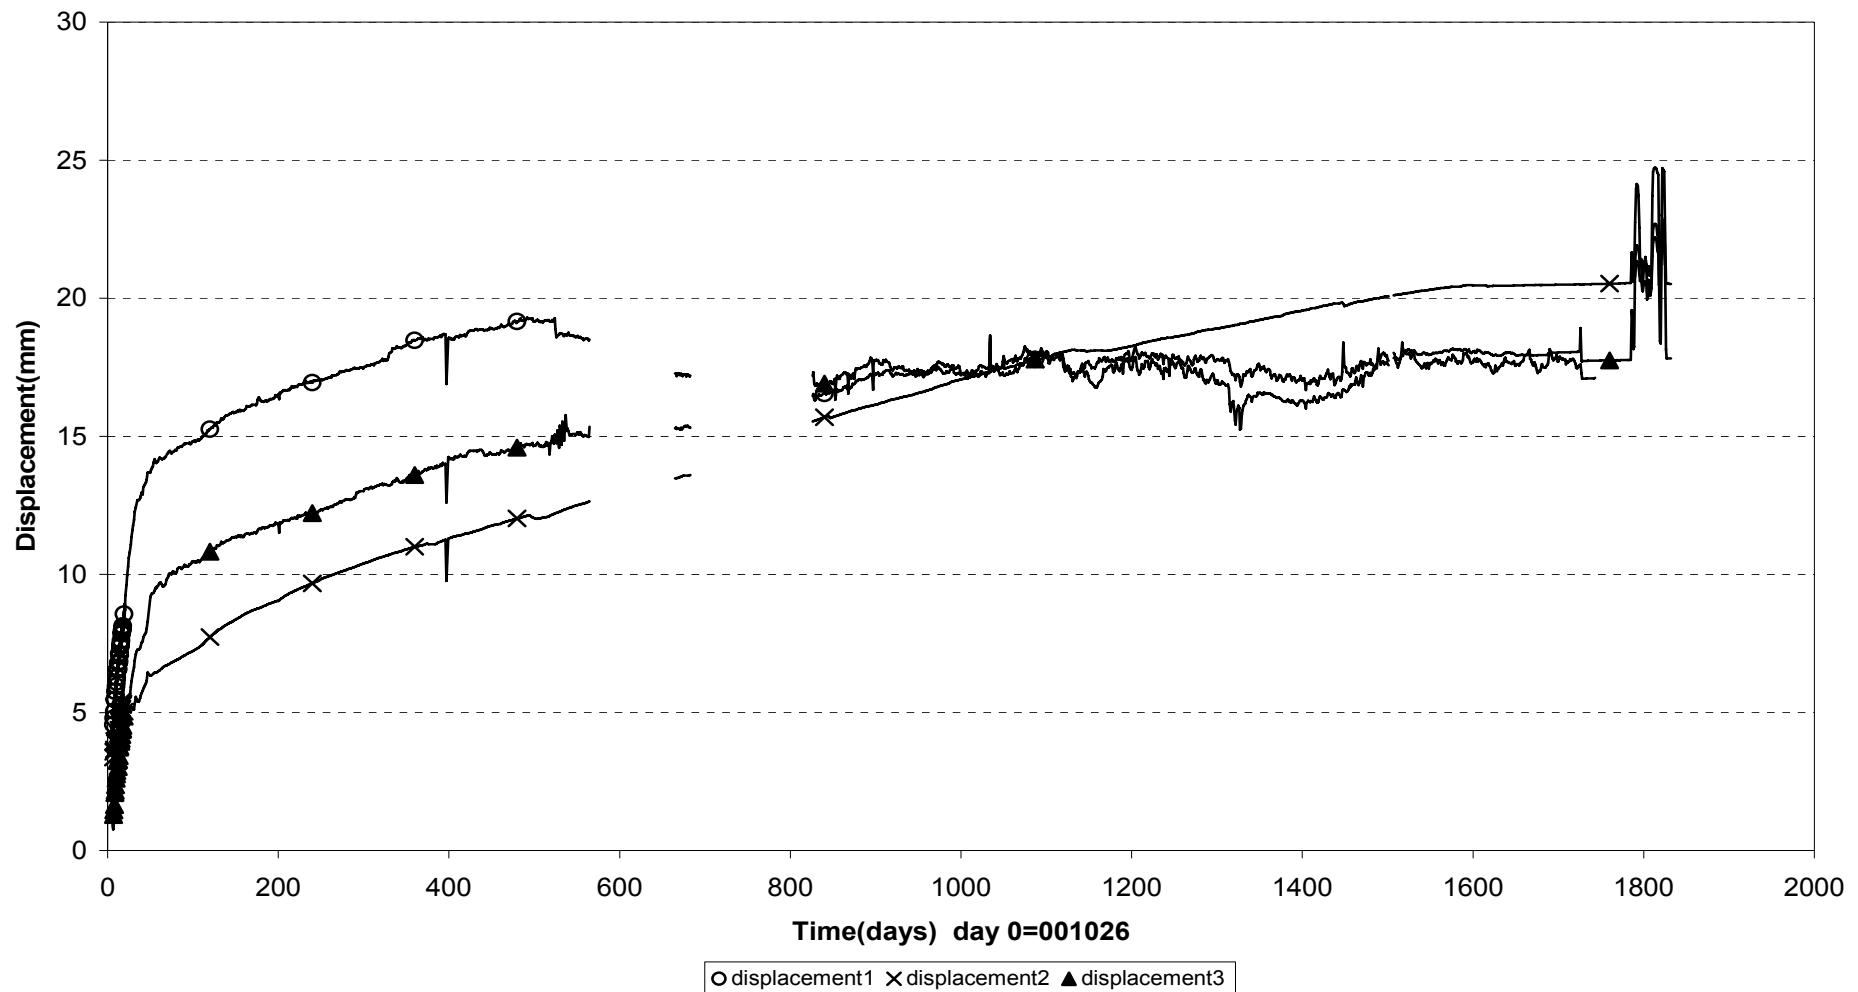




### Canister power (001026-051101)

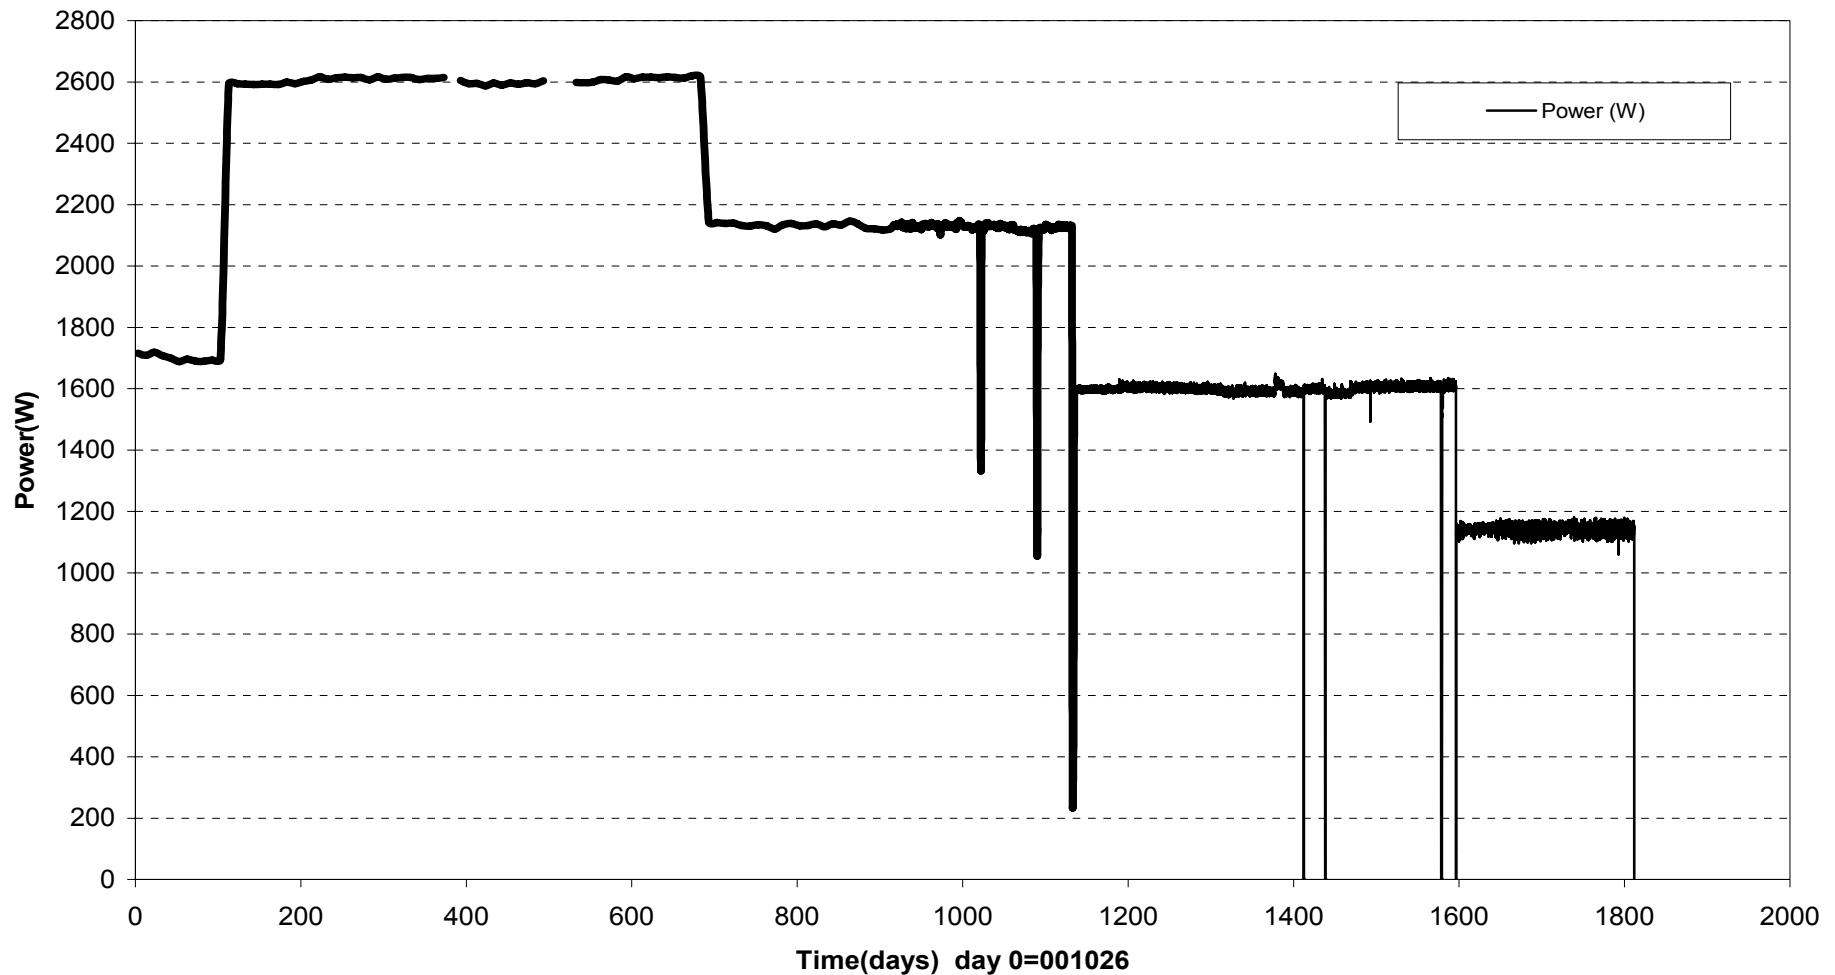


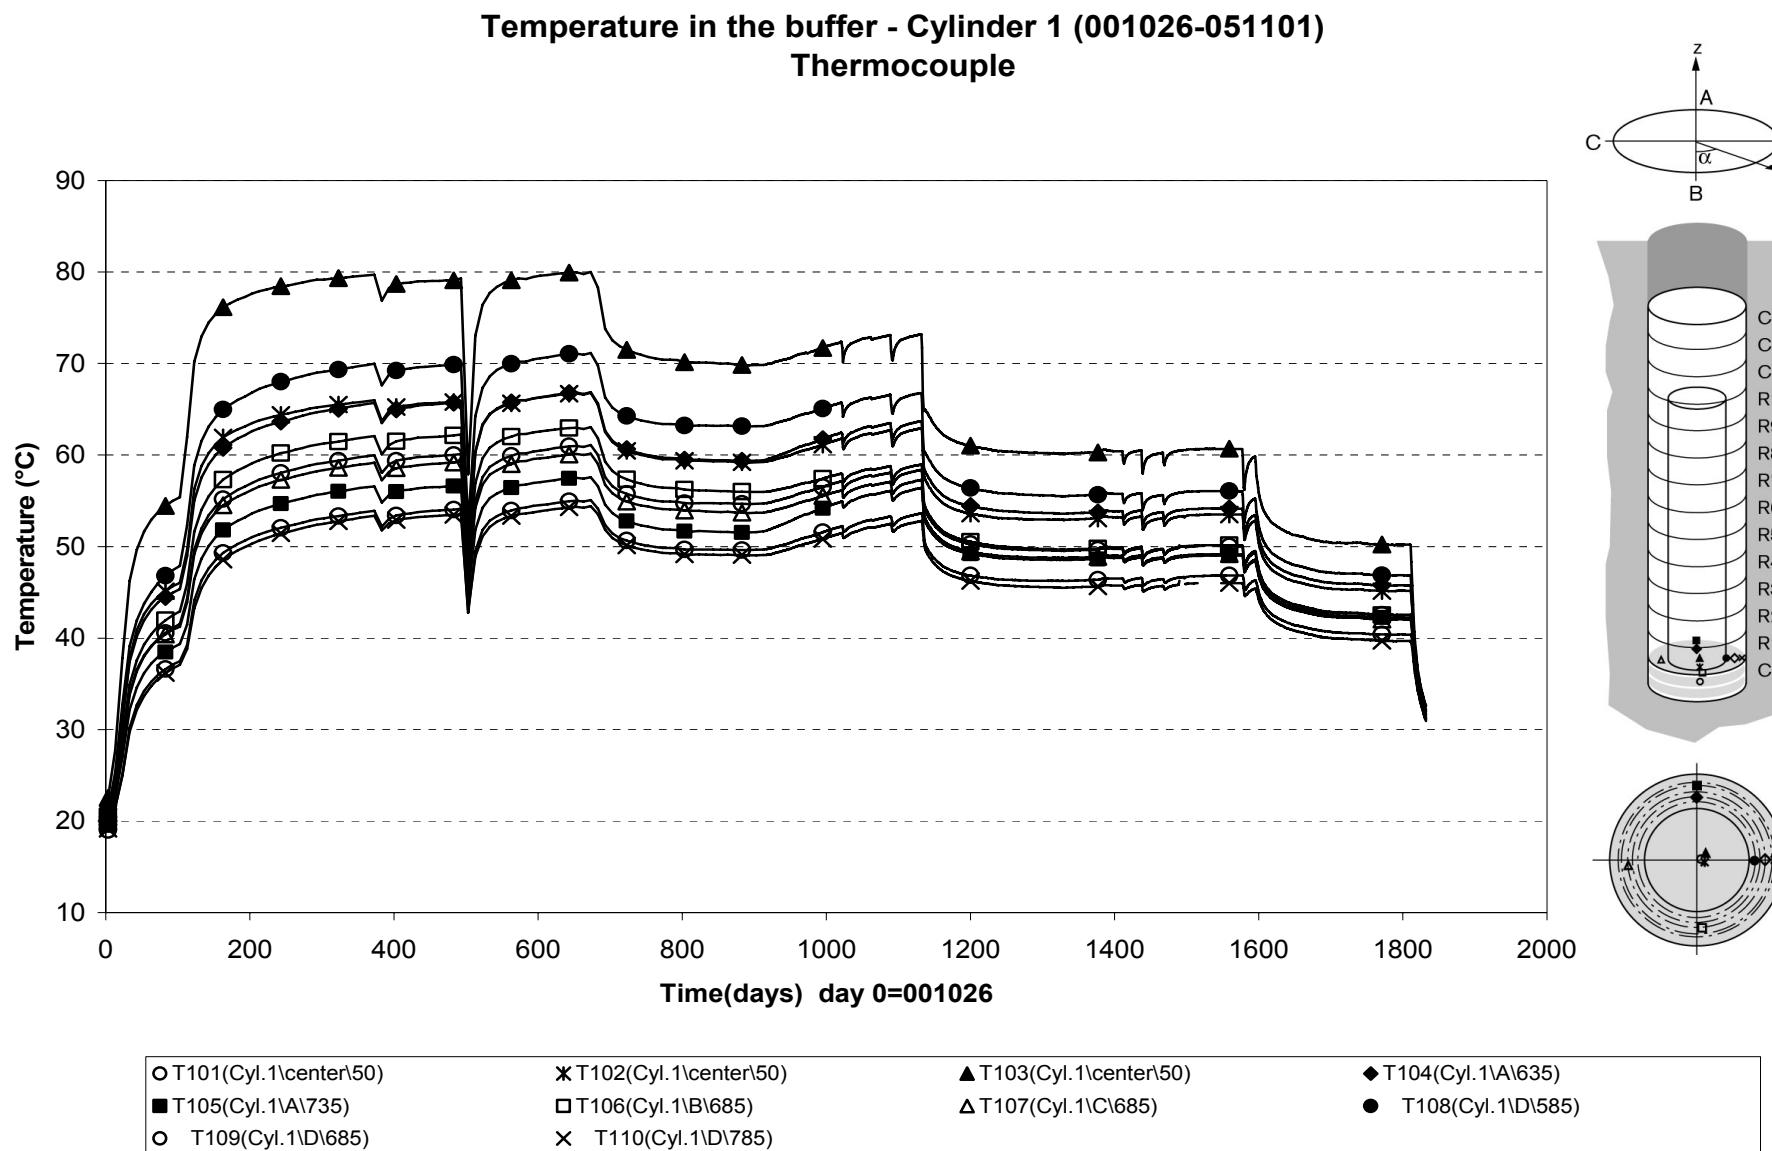


**Temperature in the buffer - Ring 5 (001026-051101)**  
**Thermocouple**

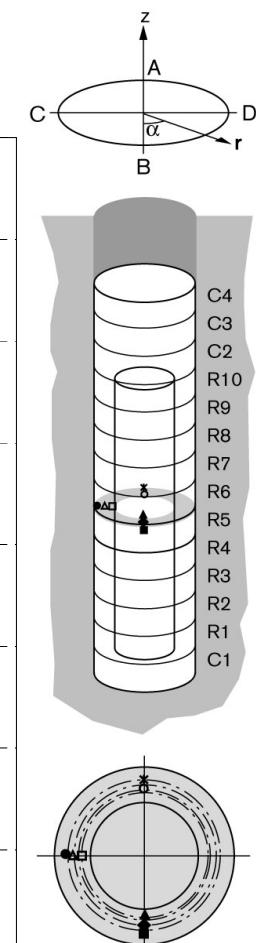
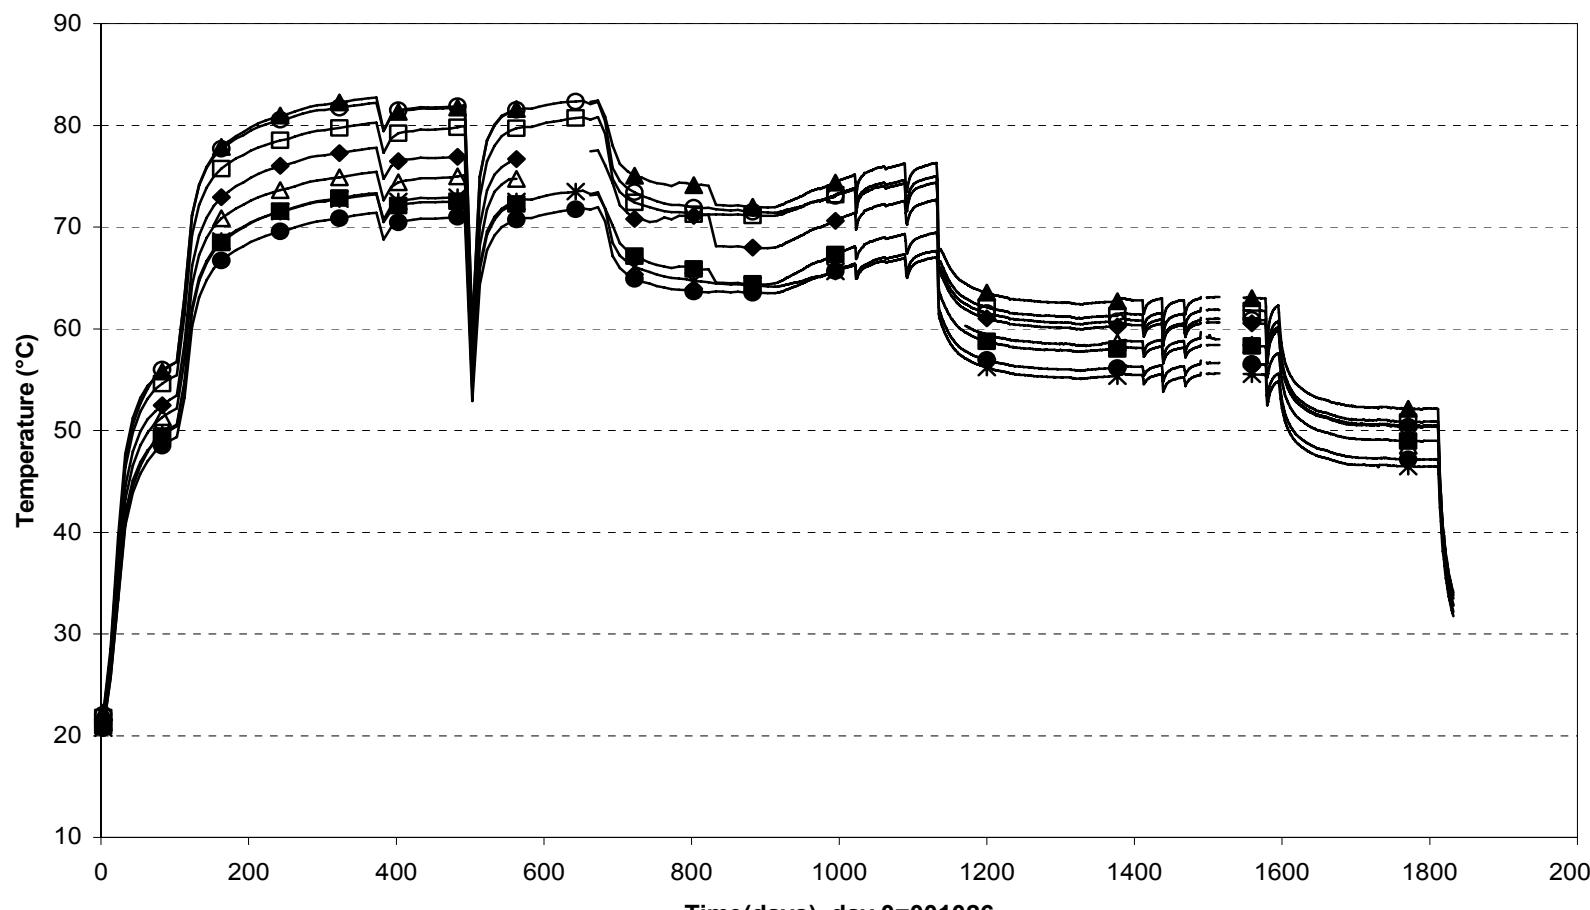


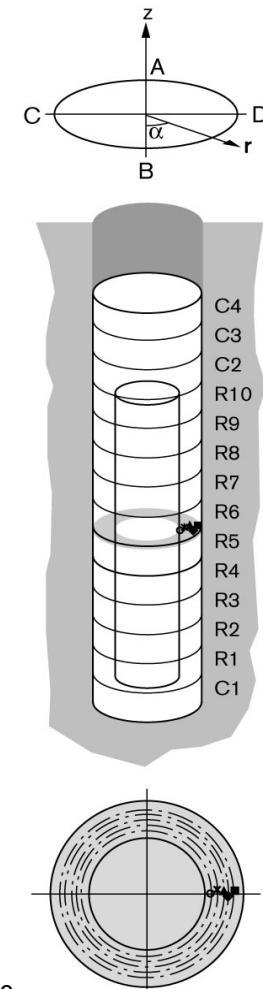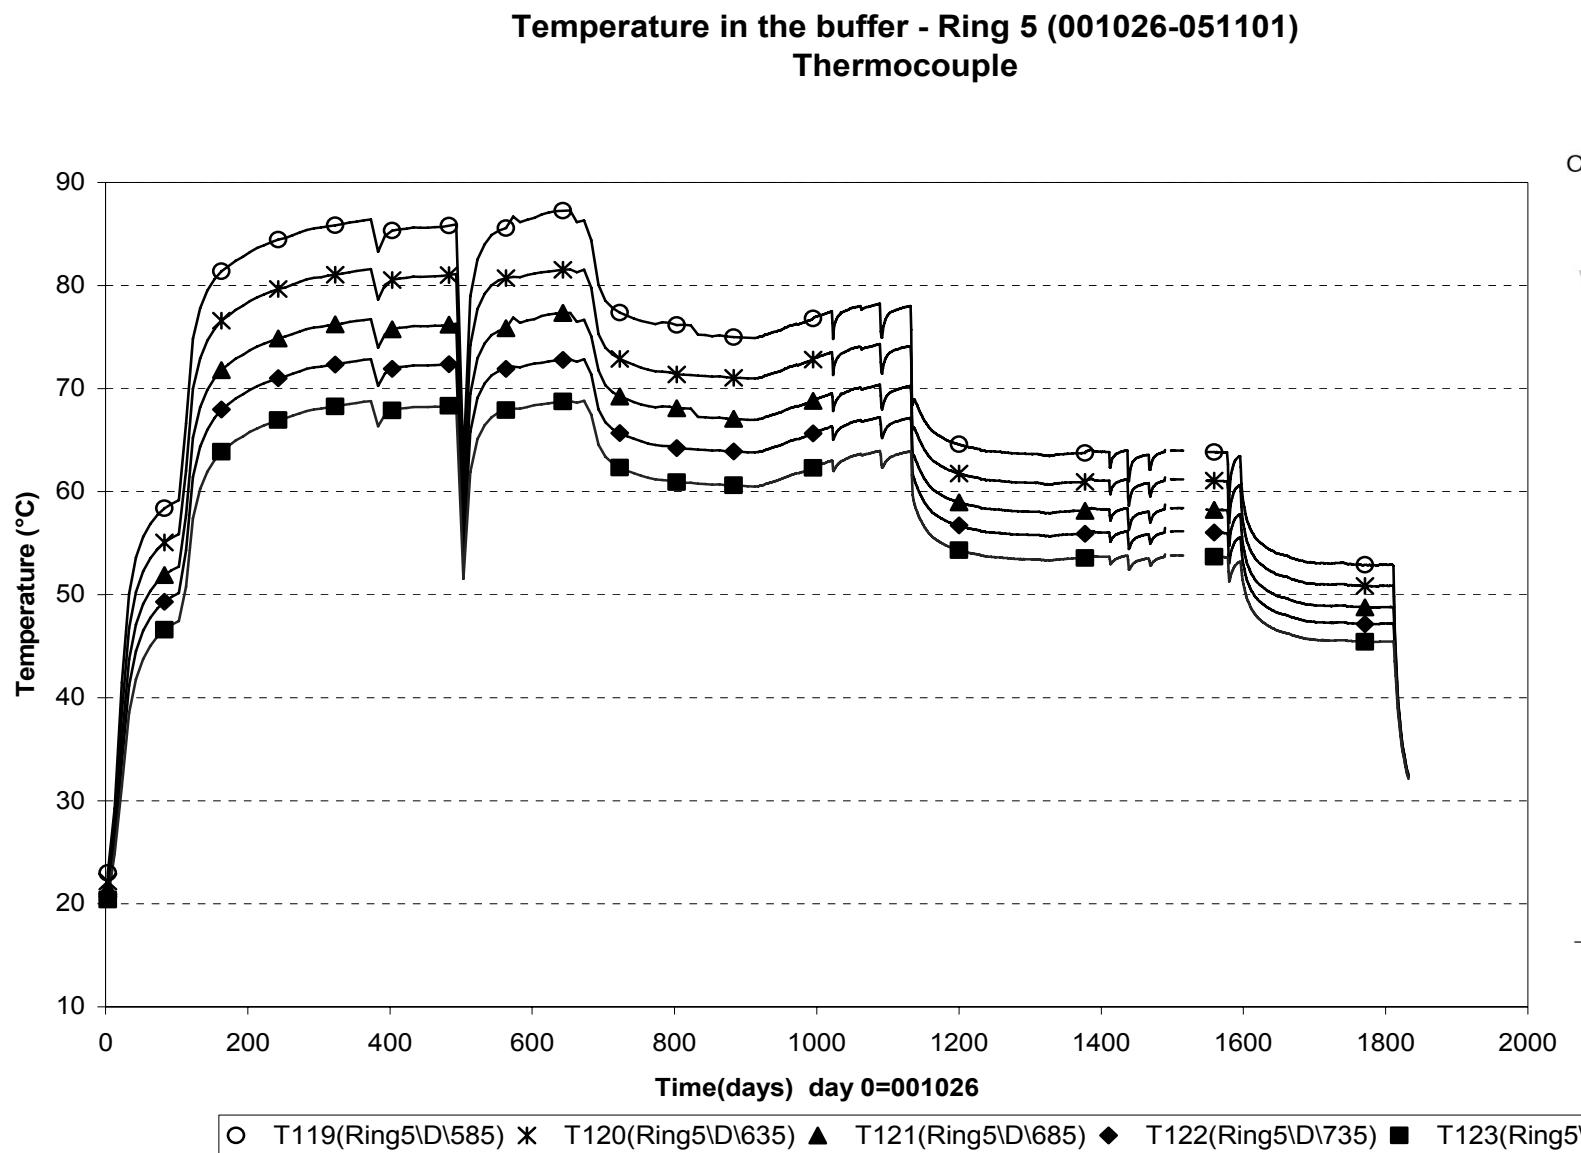



**Temperature in the buffer - Ring 10 (001026-051101)**  
**Thermocouple**

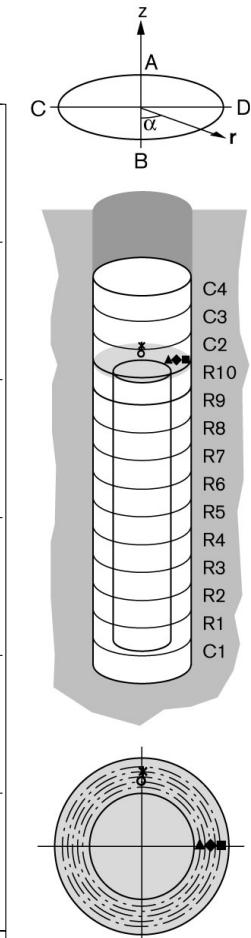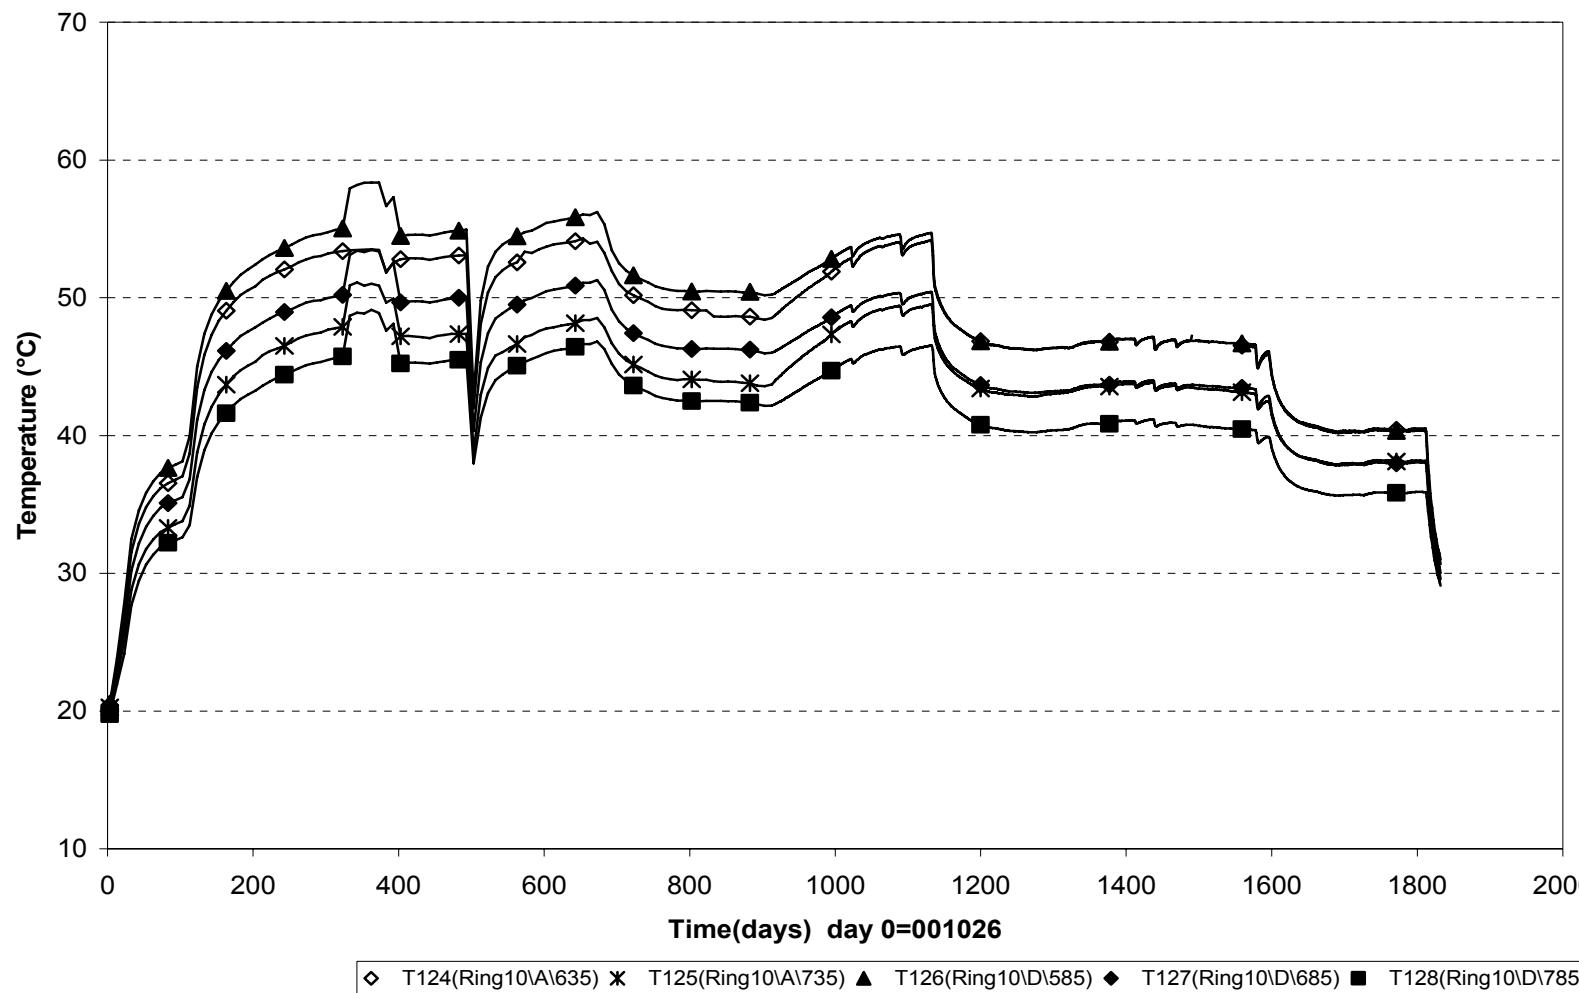



**Temperature in the buffer - Cylinder 3 and Cylinder 4 (001026-051101)**  
**Thermocouple**

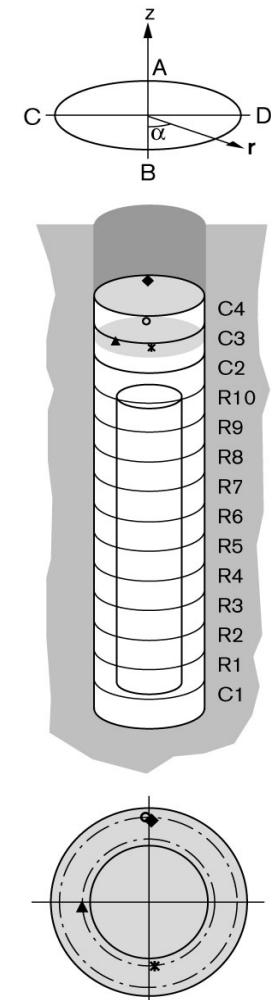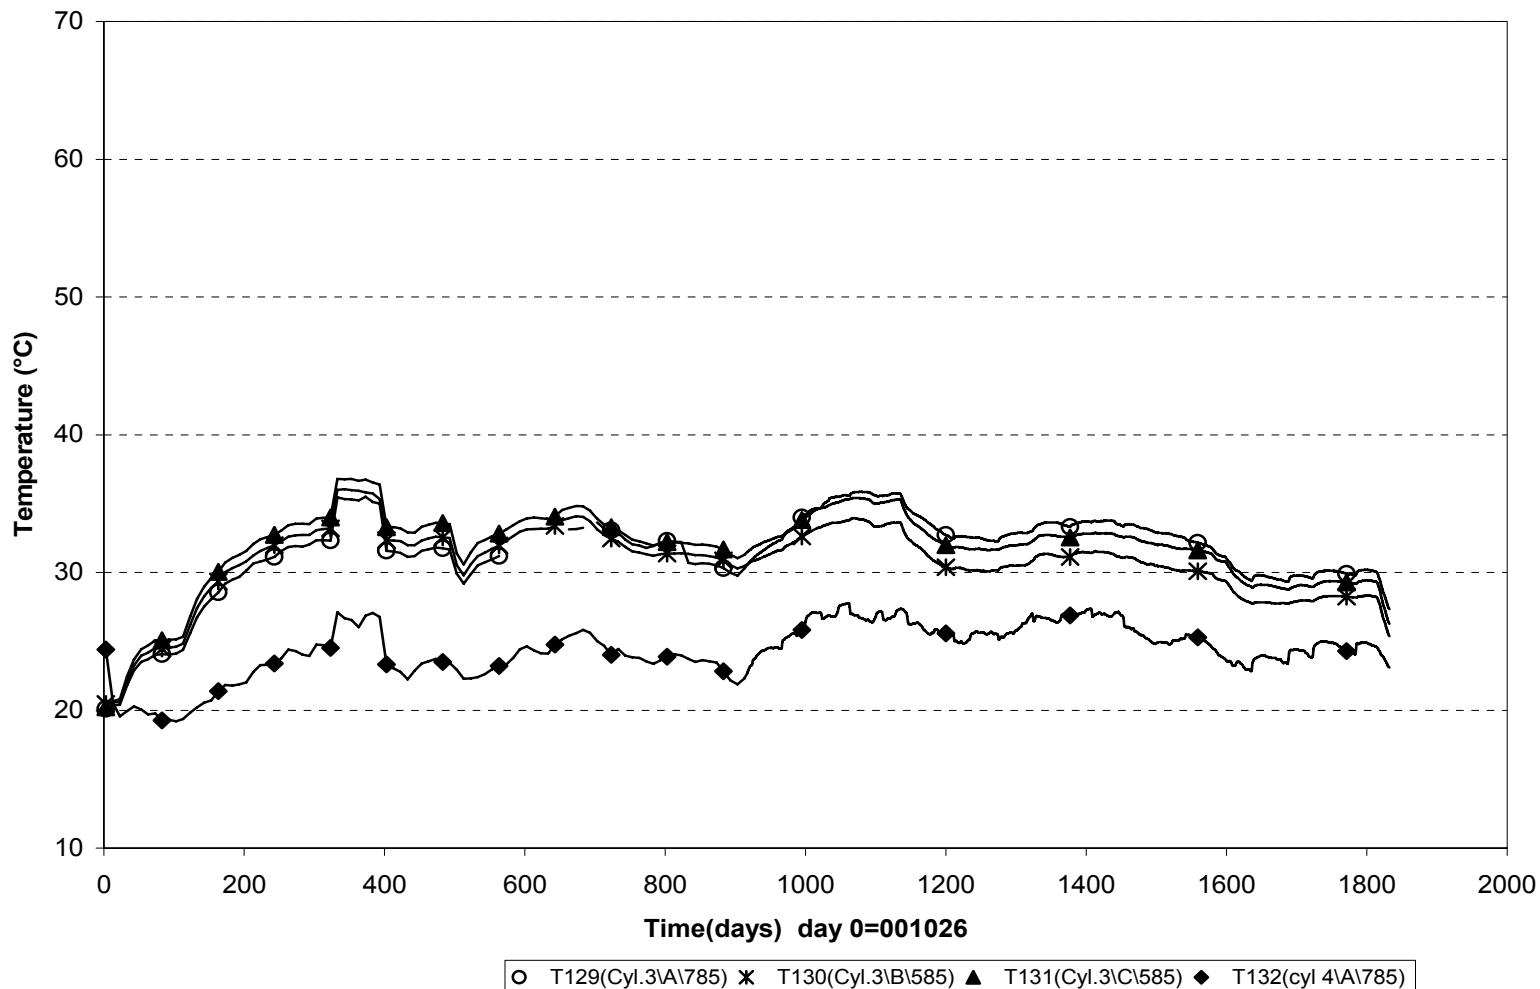



**Temperature in the rock - below the dep. hole (001026-051101)**  
**Thermocouple**

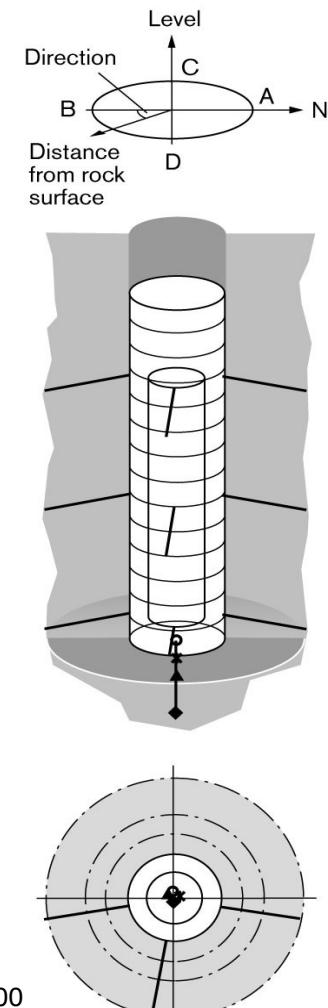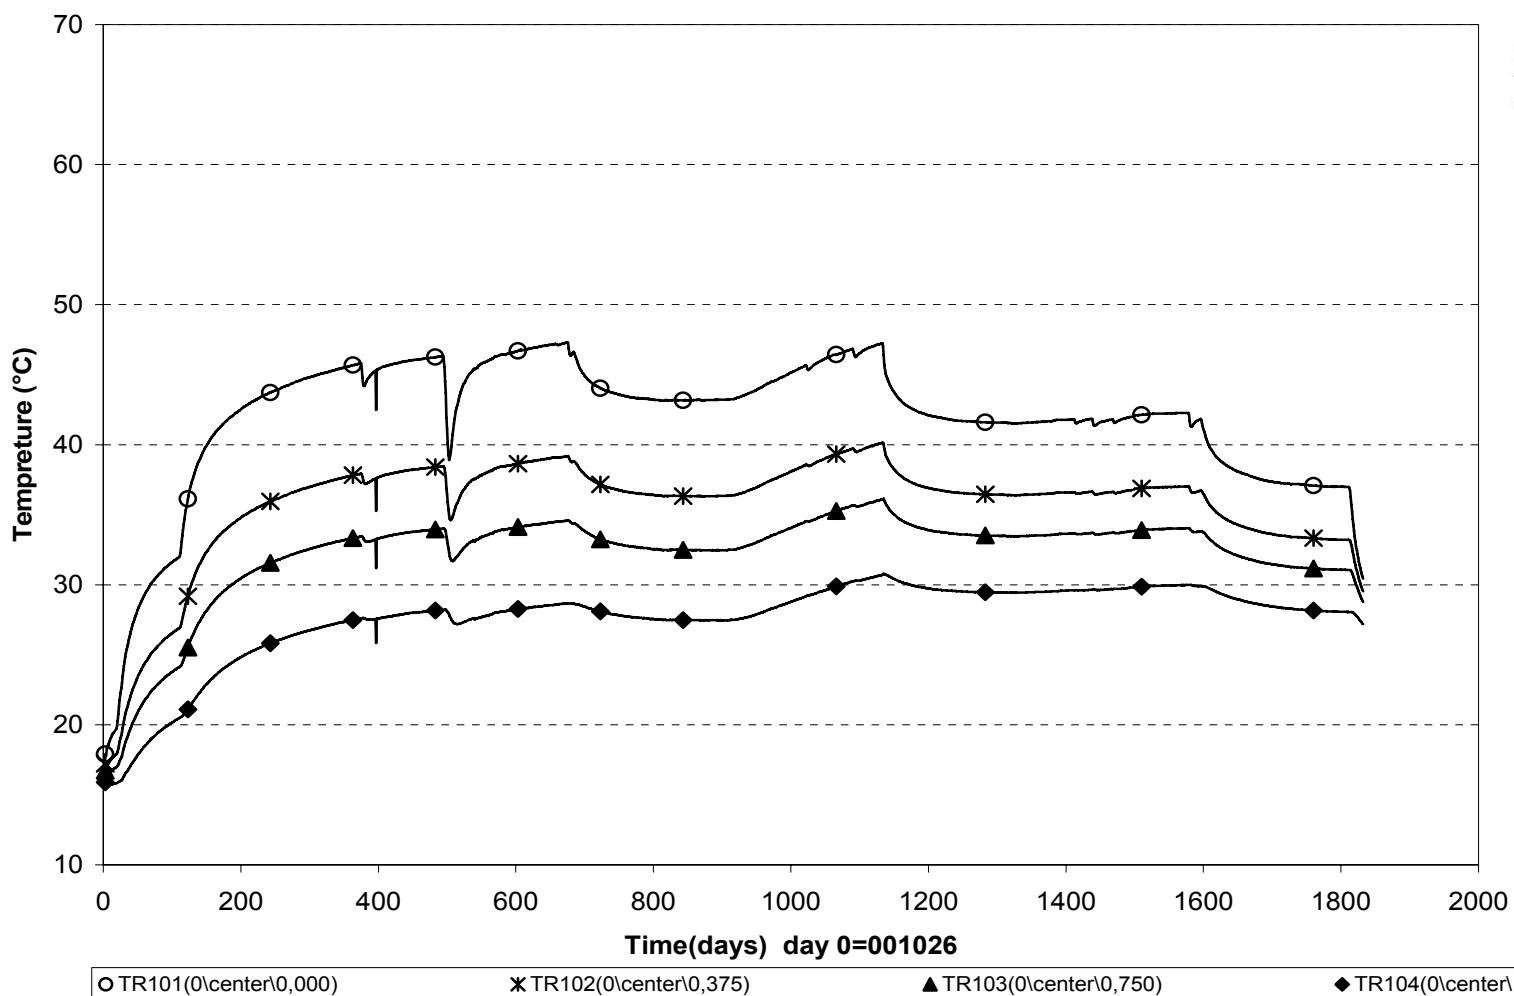



**Temperature in the rock - level 0,6 m (001026-051101)**  
**Thermocouple**

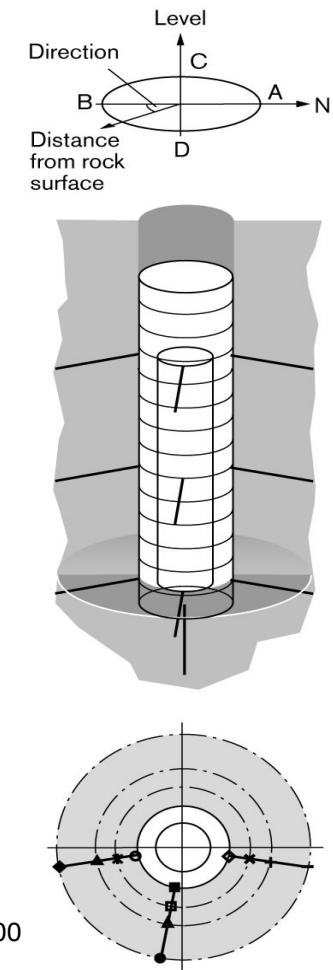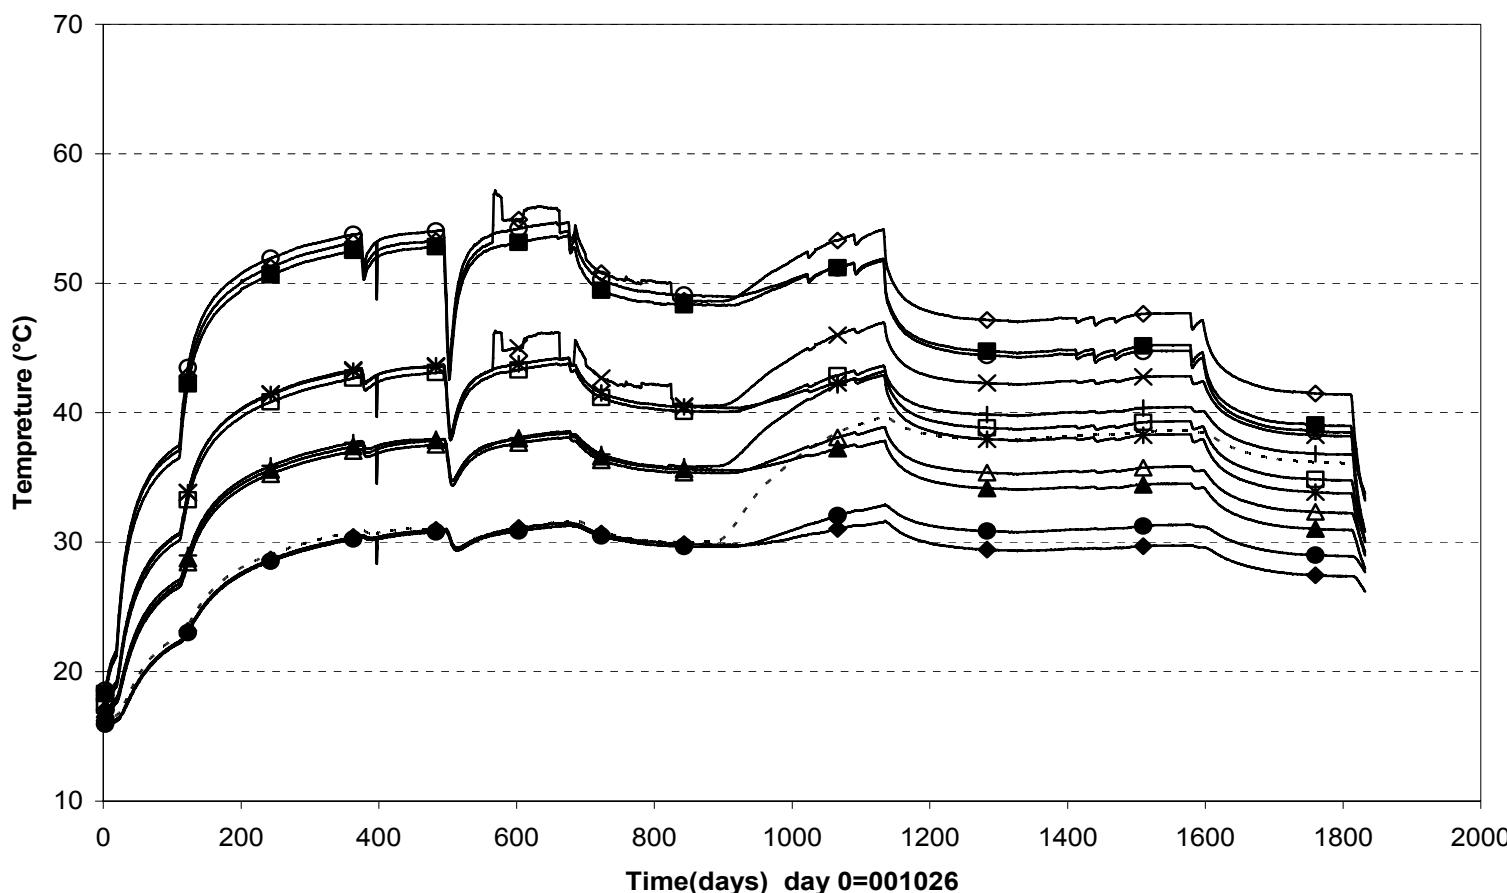


**Temperature in the rock - level 3,01 m (001026-051101)**  
**Thermocouple**

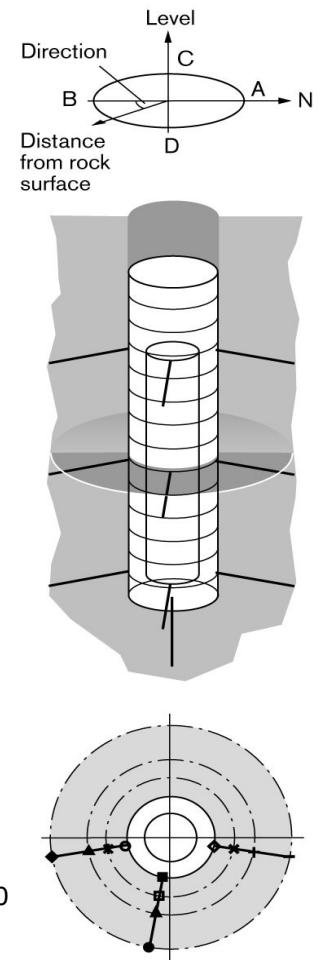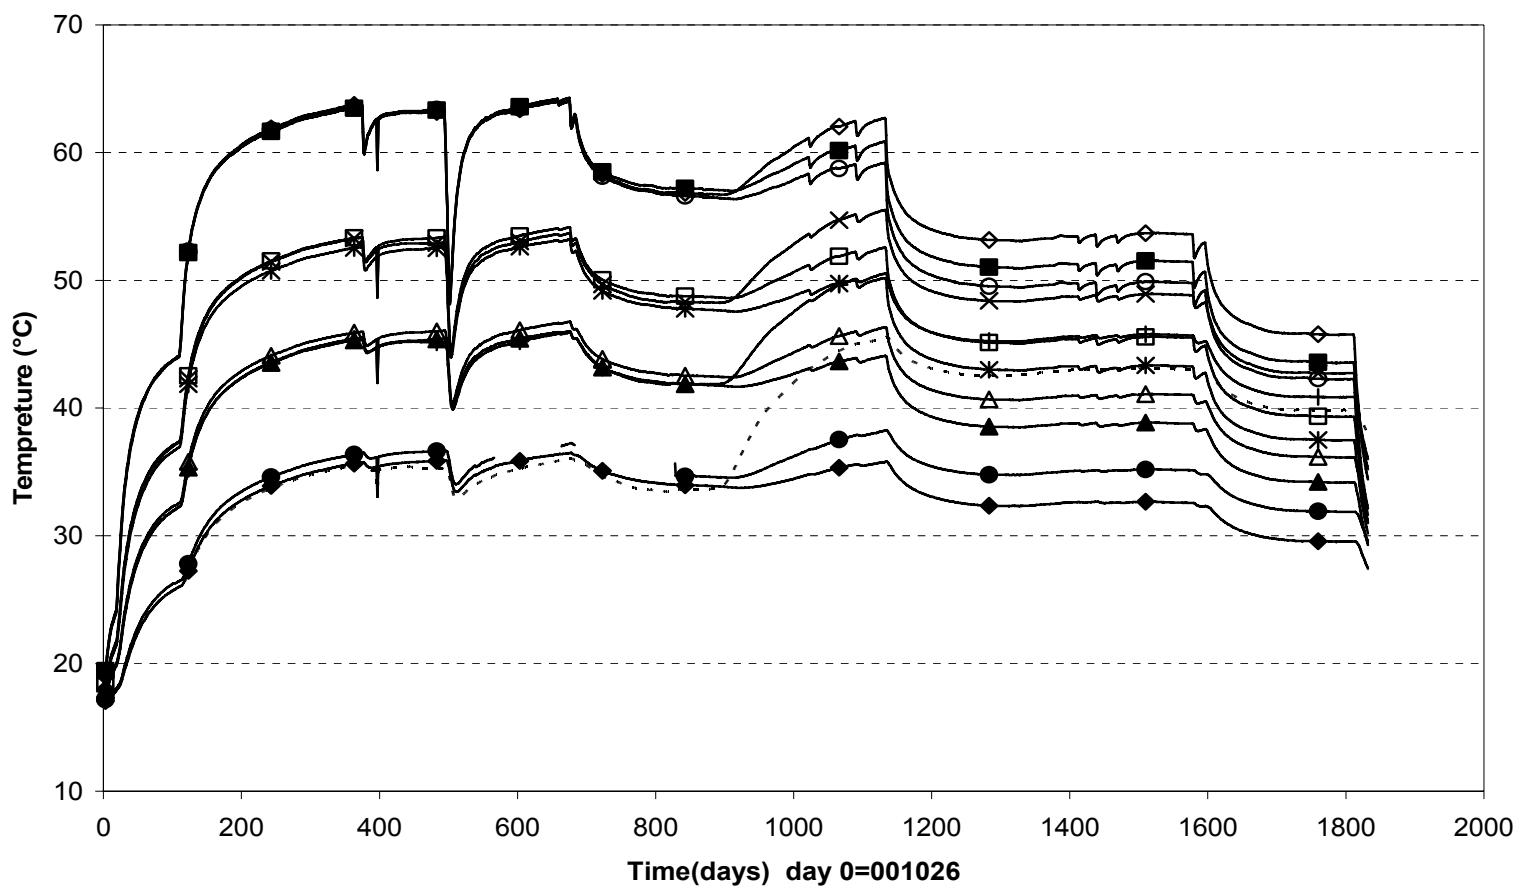


**Temperature in the rock - level 5,4 m (001026-051101)**  
**Thermocouple**

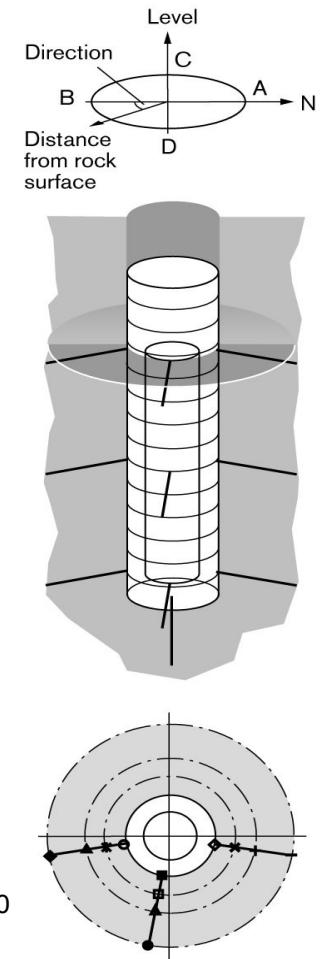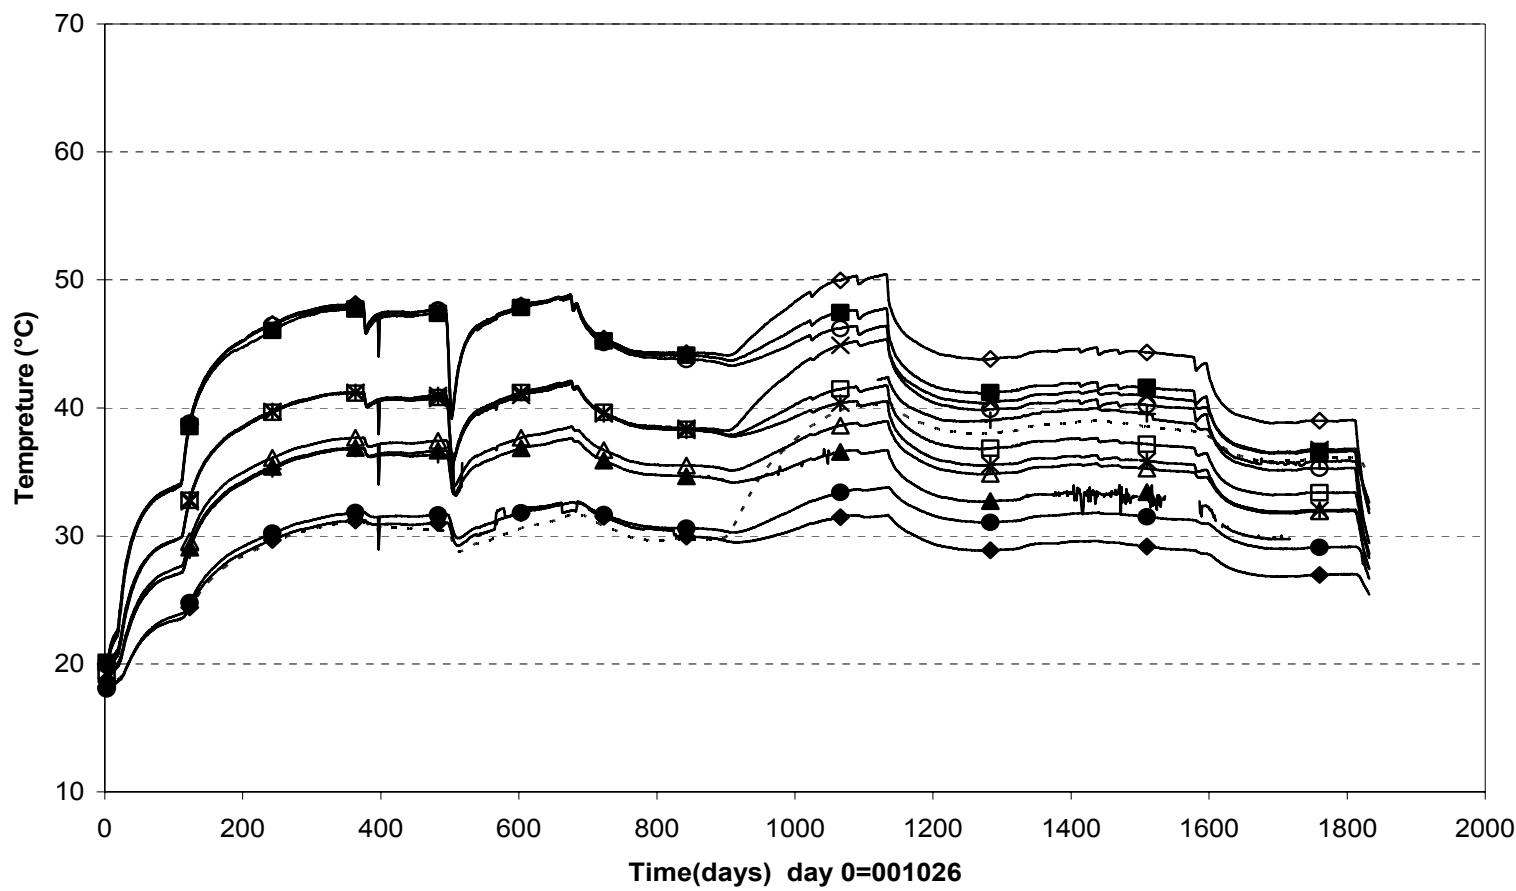



**Max.temperature on the canister surface (001026-051101)**  
**Optical fiber cables**

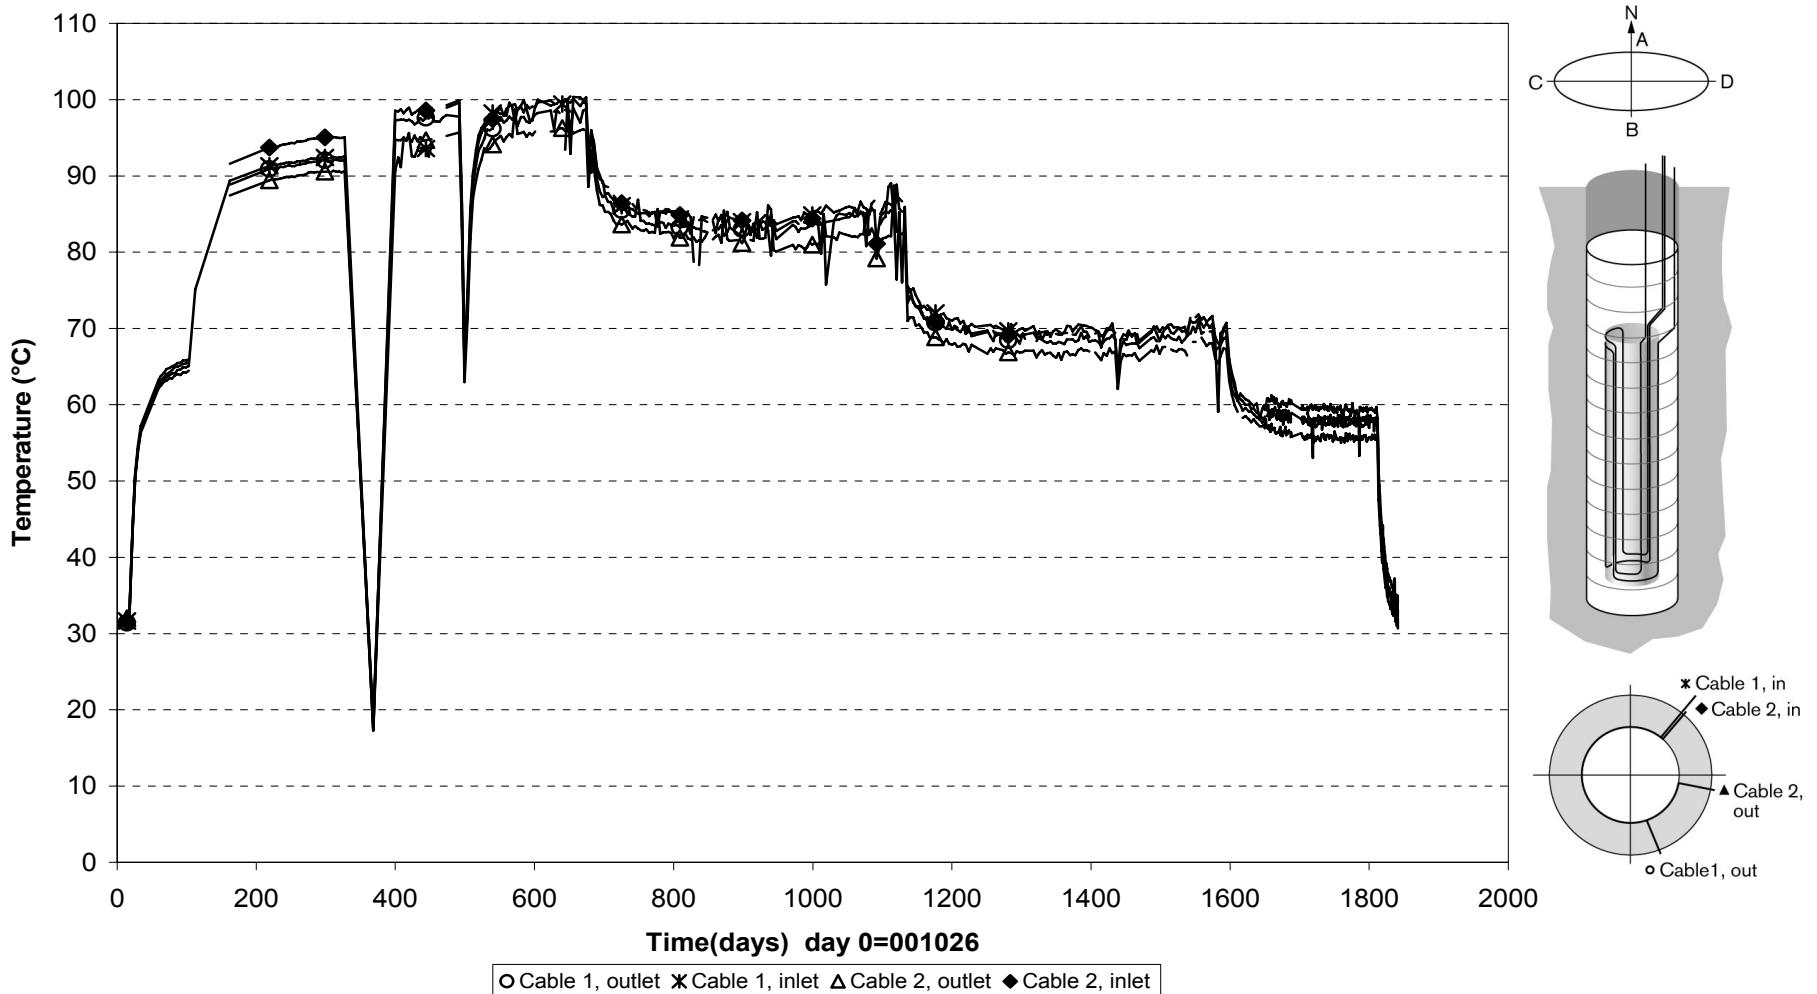


**Temperature profile on the canister surface (051101)**  
**Optical fiber cables**

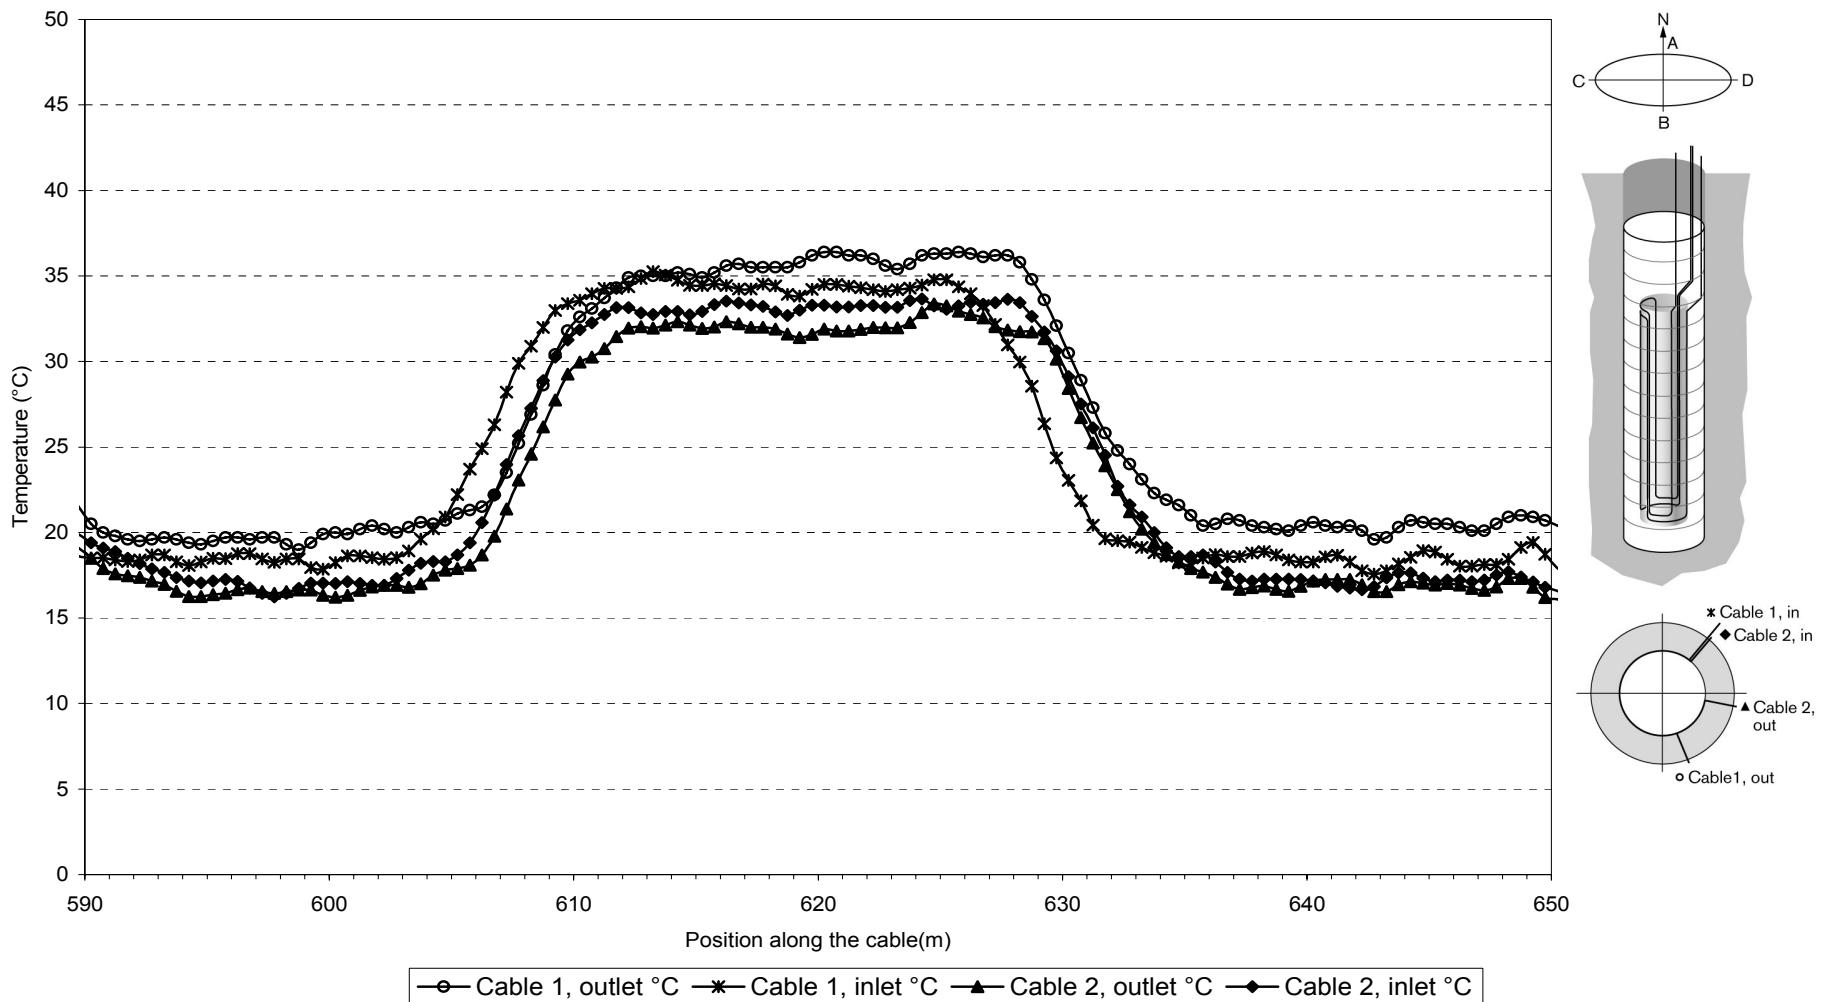


**Temperature inside the canister (001026-051101)**  
**PT-100**

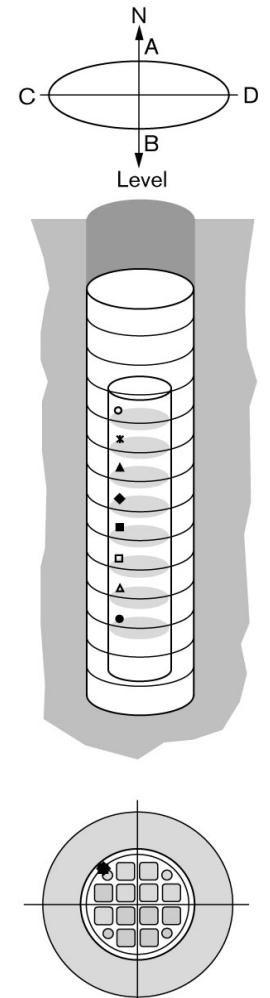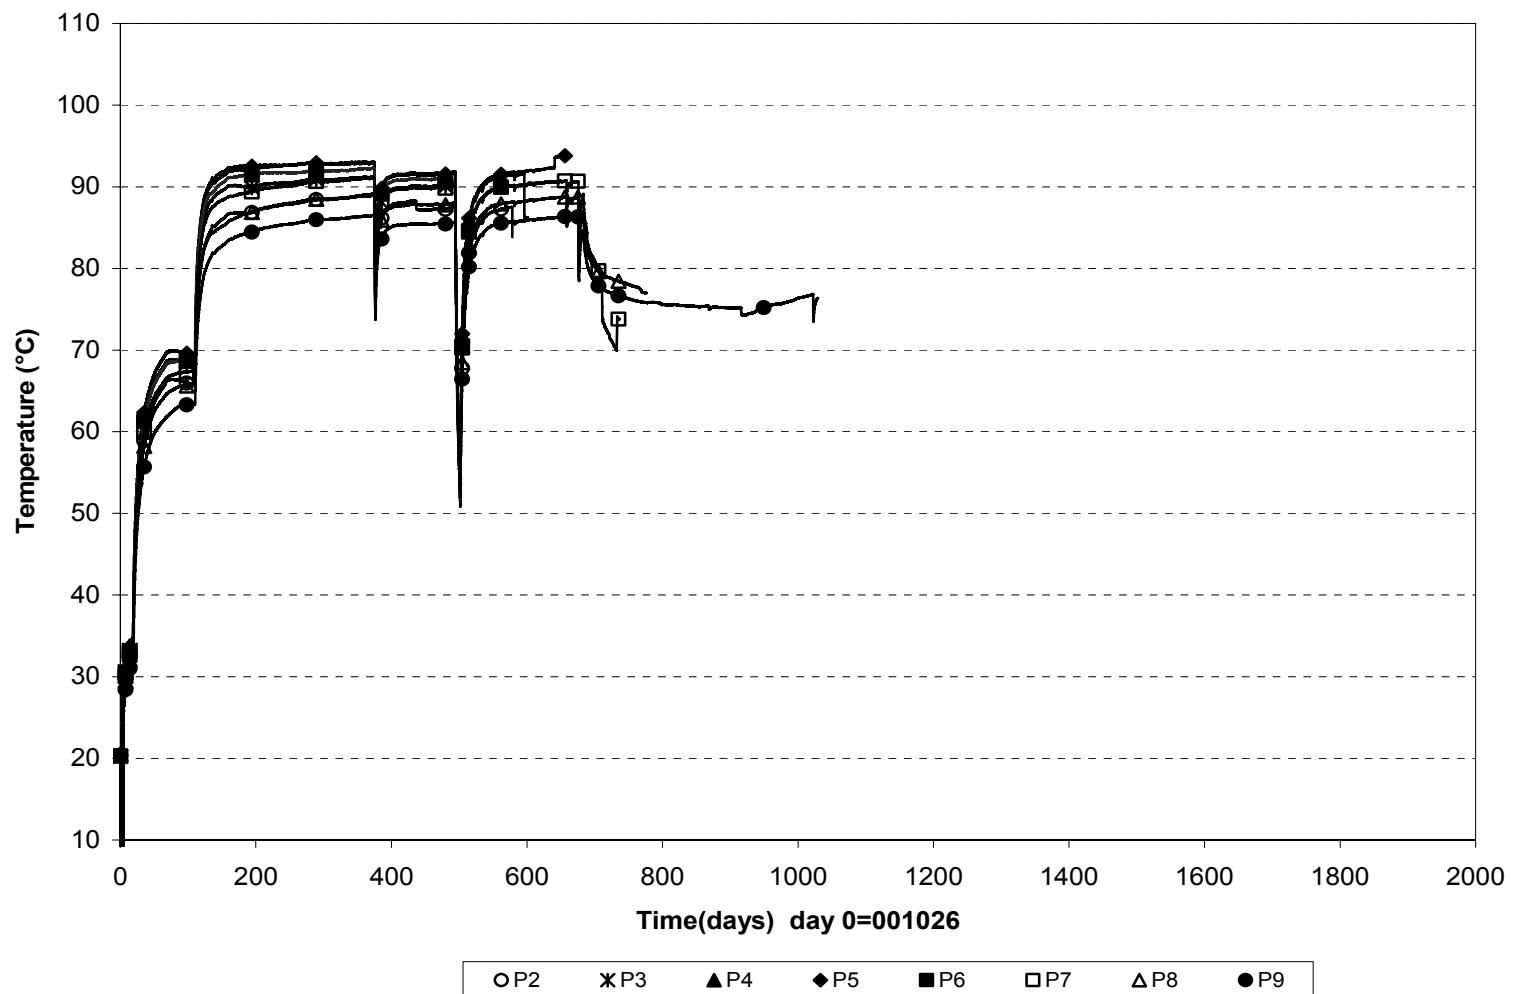

**Temperature inside the canister (001026-051101)  
PT-100**

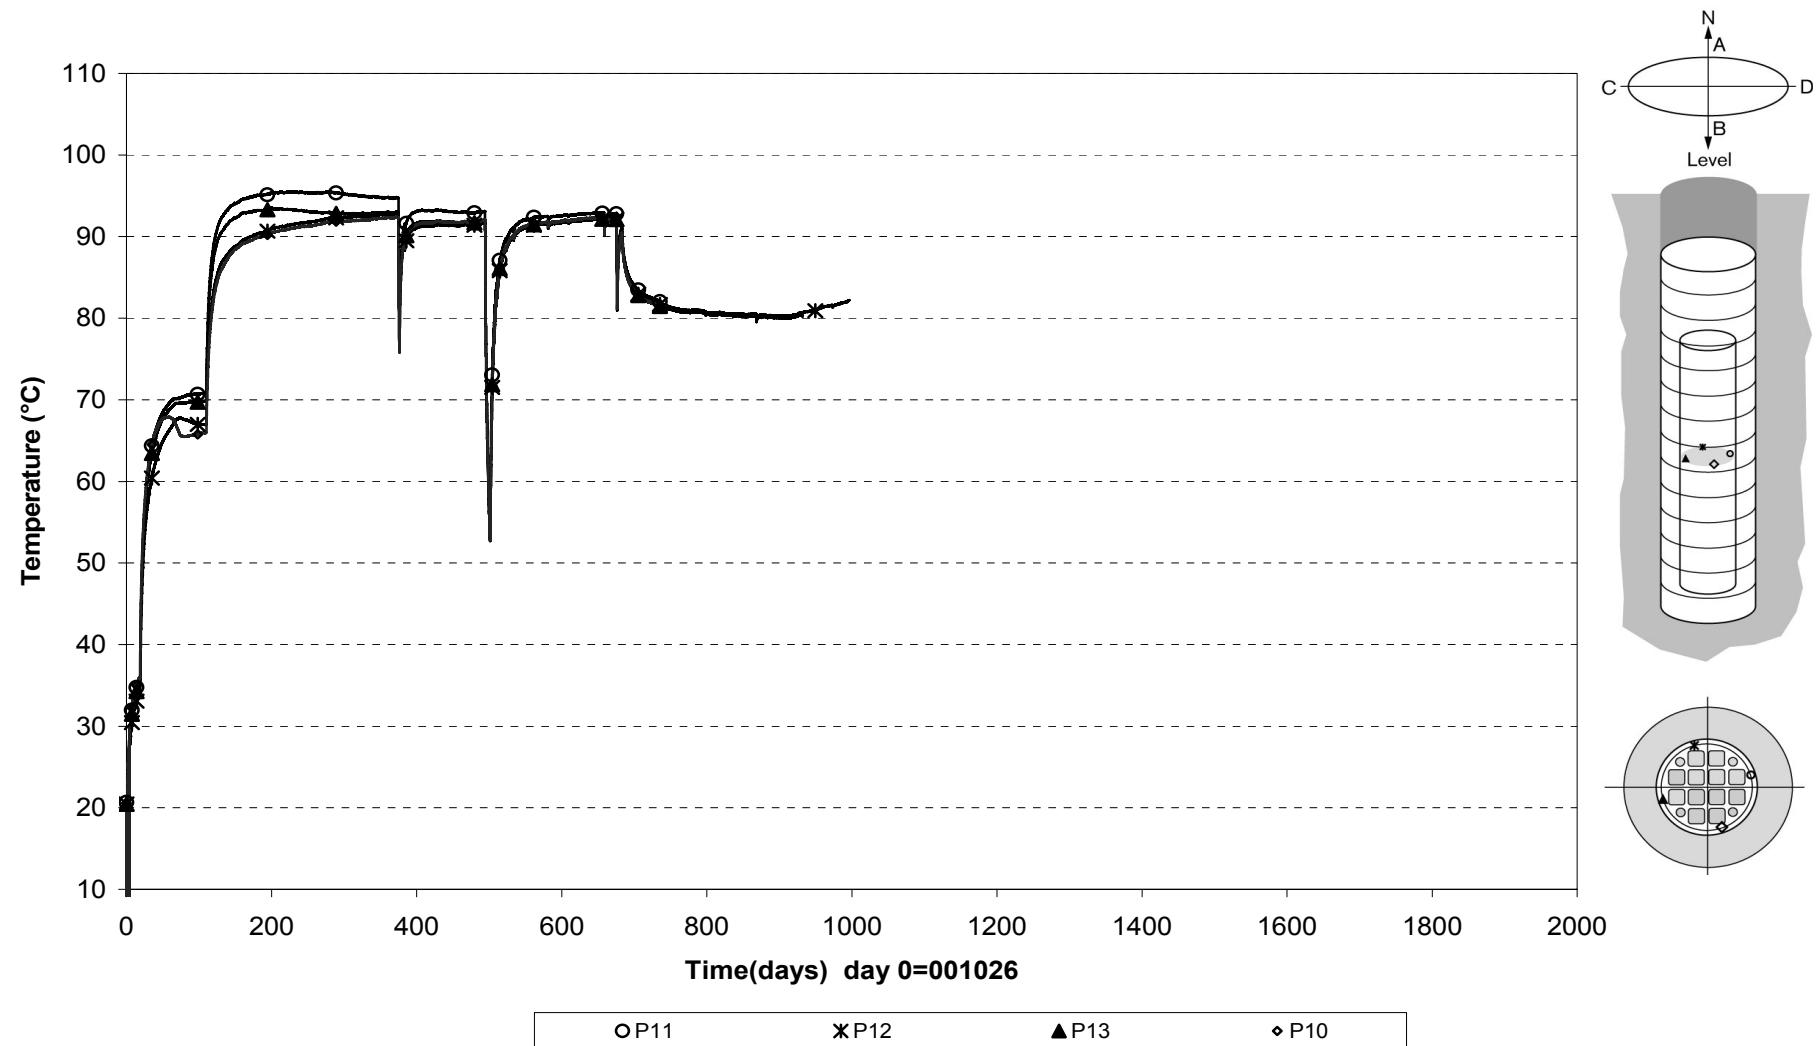

**Temperature inside the canister (001026-051101)**  
**PT-100**

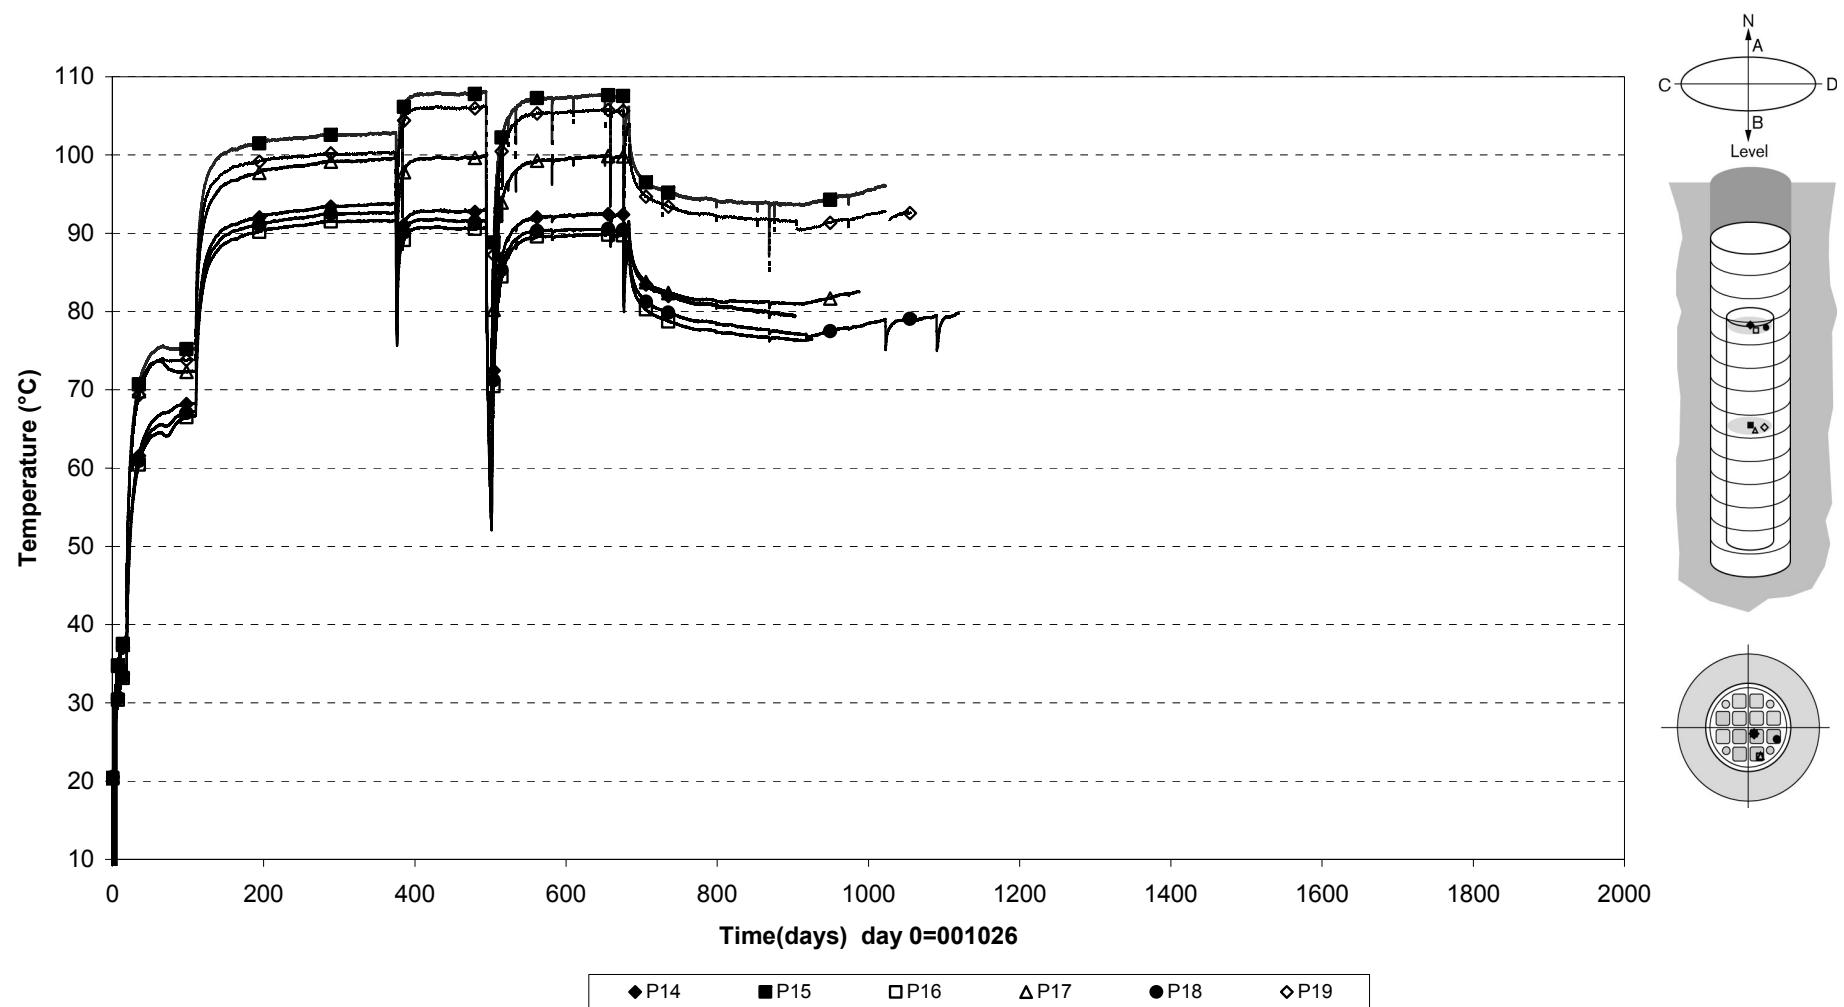



## **Appendix B**



# **BBK**

## **STRESS AND STRAIN MEASUREMENT OF THE ROCK MASS RETRIEVAL TEST AT ÄSPÖ**

Measuring period  
2005-05-01 – 2005-10-31

Martin Edelman

Kennert Röshoff

2005-12-23



# Contents

<b>1</b>	<b>Extent</b>	<b>83</b>
<b>2</b>	<b>Technical background</b>	<b>85</b>
2.1	The vibrating wire embedment biaxial stressmeter	85
2.2	Embedded strain meters	85
2.3	Cement	85
<b>3</b>	<b>Field measurement</b>	<b>87</b>
3.1	Installation work	87
3.2	Location of instruments	87
3.3	Registration	87
<b>4</b>	<b>Computer processing of field data</b>	<b>91</b>
4.1	Evaluation of stresses	91
4.1.1	Radial deformations	91
4.1.2	Calculation of deformation to stresses	91
4.2	Evaluation of strain	92
4.2.1	Calculation of strain	92
4.3	Material parameters	92
4.4	Processing	93
<b>5</b>	<b>RESULTS</b>	<b>93</b>
5.1	Results of canister hole 1	97
5.1.1	Stress change for each biaxial stressmeter	97
	Stressmeter A1	97
	Stressmeter B1	98
	Stressmeter C1	99
	Stressmeter D1	100
5.1.2	Strainmeter A1:1, B1:1, C1:1, D1:1, D1:2	101
5.1.3	Strainmeter C1:2	101
	Results of canister hole 2	102
5.1.4	Stress change for each biaxial stressmeter	102
	Stressmeter A2	102
	Stressmeter B2	103
	Stressmeter C2	104
	Stressmeter D2	105
5.1.5	Strainmeter B2:1, C2:1, C2:2	106



# **1    Extent**

BBK AB and NCC Teknik have, on commission of SKB, Äspö hard rock laboratory, performed rock mechanical measurements in the CRT (Återtaget) tunnel at Äspö. The measurement program comprises of registration of the stress and the strain response around the two canister holes during drilling and heating of the rock mass.

In the first phase, the response of the rock mass was monitored during the drilling of the two canister holes (QPTD F69-00-21). This second phase includes the response registered during a heating phase. The heating experiment started on 2000-10-27 and will continue for about five years.

The aim of the instrumentation is to monitor the stress changes due to heating of the rock mass in a canister hole. The strain meter is used to monitor the relative changes of strain of the intact rock and across fractures.

The commission extends over field measurement and evaluation.

BBK AB is responsible for measuring equipment, the mobilization, field measurement, the computer processing. BBK AB and NCC Teknik are responsible for the interpretation and report of the measurements.

This report presents the measurement results during the period of the heating phase from 2005-05-01 to 2005-10-31.



## **2 Technical background**

### **2.1 Vibrating wire embedment biaxial stressmeters**

The biaxial stressmeter, Geokon model 4350, is designed to measure compressive stress changes in rock, salt, concrete or ice. Principal stress changes are measured in the plane perpendicular to the borehole axes. The stressmeter consists of a high-strength steel cylinder that is grouted into a 60 mm borehole. Stress changes in the host material cause the cylinder to deform.

The radial deformation of the cylinder is measured by means of three pairs of vibrating wire sensors spaced at 60° intervals. Changes of stress produce corresponding changes in the resonant frequency of the sensors. These changes of frequency can be related to stress changes using factory-supplied calibrations. Longitudinal strain sensors and temperature sensors are also included in the stressmeter.

### **2.2 Embedded strain meters**

The vibrating wire strain gages are designed for direct embedment in concrete. The strainmeter is 15 cm long and commonly used for strain measurement in foundations, piles, bridges, dams, tunnel liners etc.

The strain is measured using the vibrating wire principle. A length of a steel wire is tensioned between two end blocks that are embedded directly in concrete. Deformation (i.e. strain changes) of the concrete mass will cause the two end blocks to move relative to one another, thus altering the tension in the steel wire. The tension is measured by excitation of the wire and measuring its resonant frequency of vibration using an electro magnetic coil.

### **2.3 Cement**


Special expansive grout was used to insure that the gage is in complete contact with the surrounding rock. The instruments are grouted in special cement from Denmark named Densitop T2. This cement is chosen to have as similar properties as the rock as possible. The compression strength is 150 MPa. The coefficient of expansion is approximate 8.5 microstrain/C° that is similar to hard rock as granite and as 85 % of common concrete.



# 3 Field measurement

## 3.1 Installation work

Installation of the stressmeter gage is accomplished by inserting the gage into a grout-filled borehole using a setting tool and self-aligning setting rod.

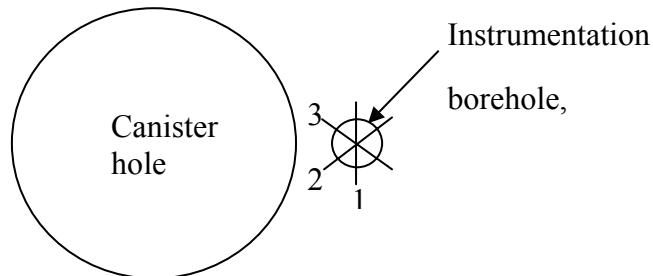

The stress cell is orientated so that the first vibrating wire is orientated tangentially to the canister hole. The second string is orientated 60° from tangential direction and the third string is orientated 120° from tangential direction.


The strainmeters were fixed to a 6 mm glasfiber rod and pushed into the grout after the stress cell was installed.

## 3.2 Location of instruments

See figure 3.1 and figure 3.2.

## 3.3 Registration

A datalogger type Campbell CR10X has captured the measurements, which have been recorded once every hour during the period 2000-10-01 to 2001-01-01, and once every six hours during the period 2001-01-03 to 2005-04-30.

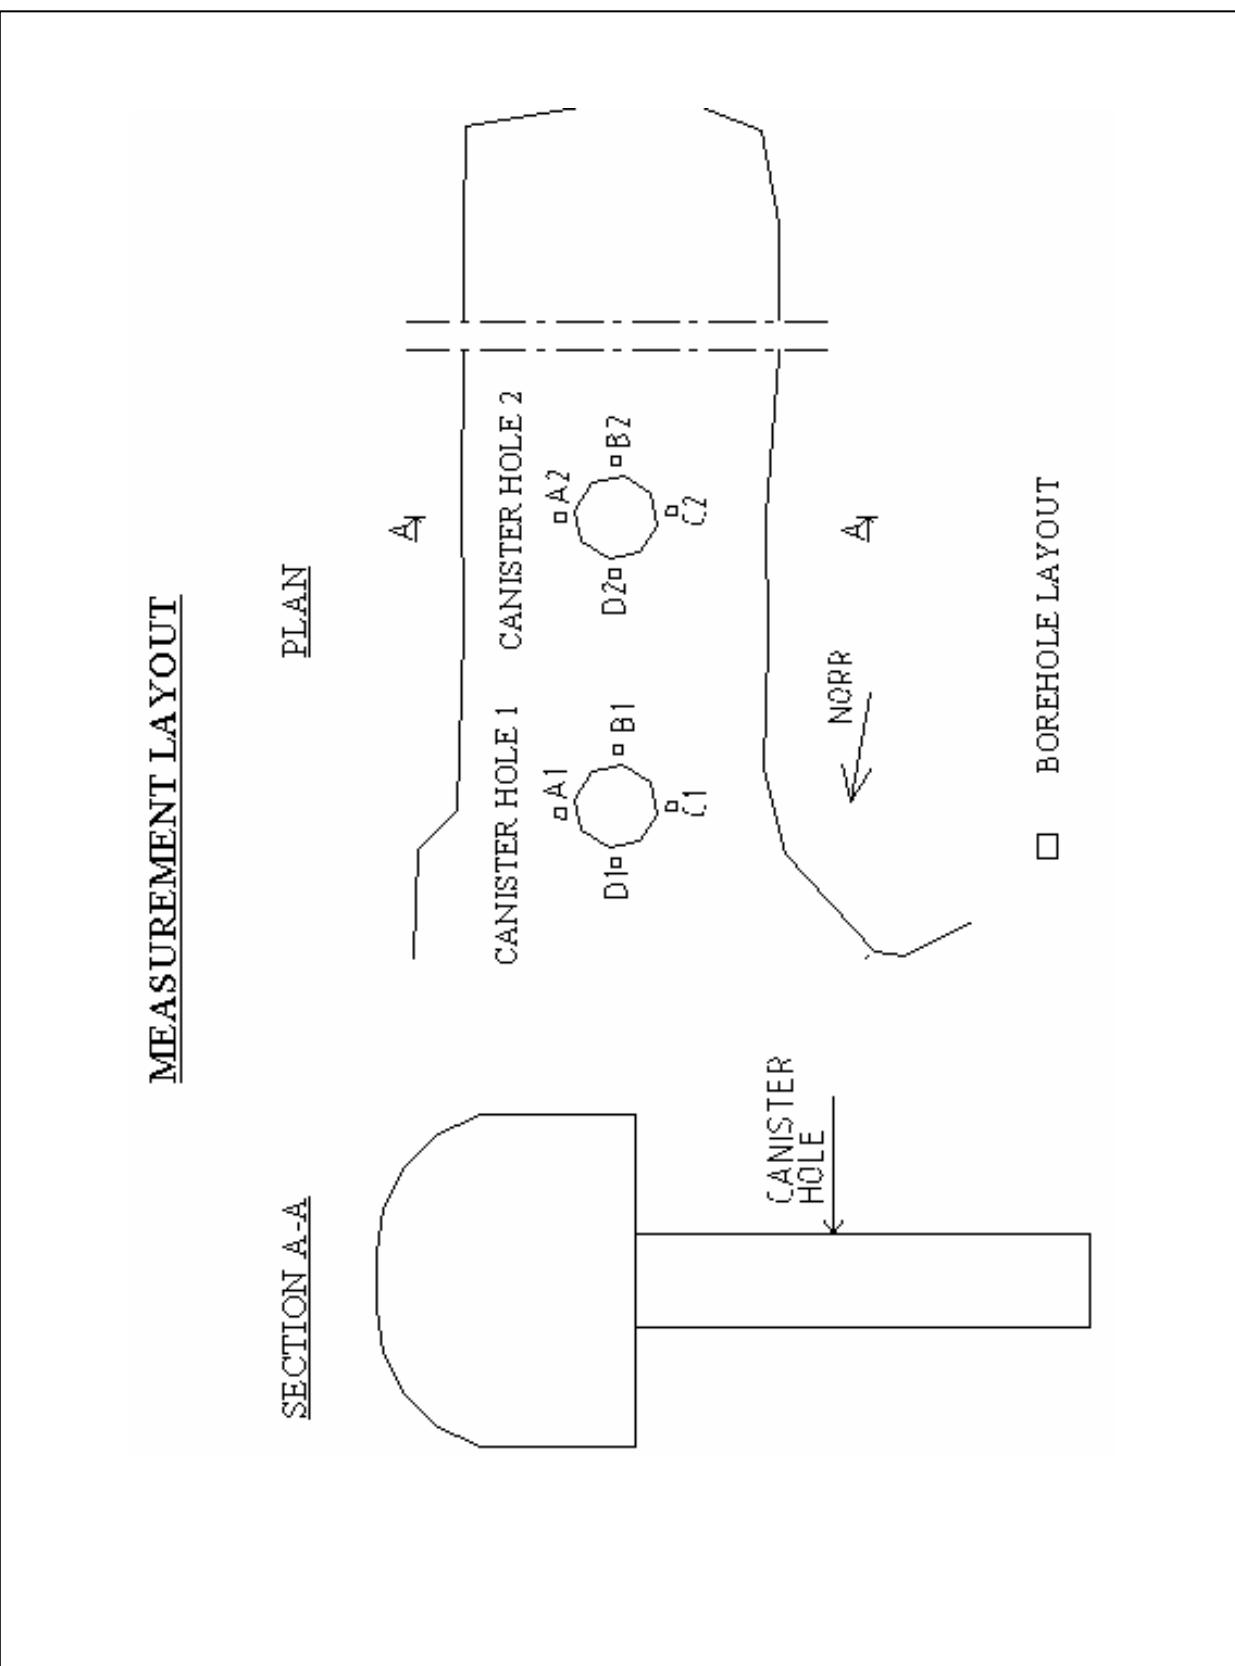

**Figure 3.1 Measurement Layout**


Canister Hole 1

Canister Hole 2

PLAN



SECTION A-A

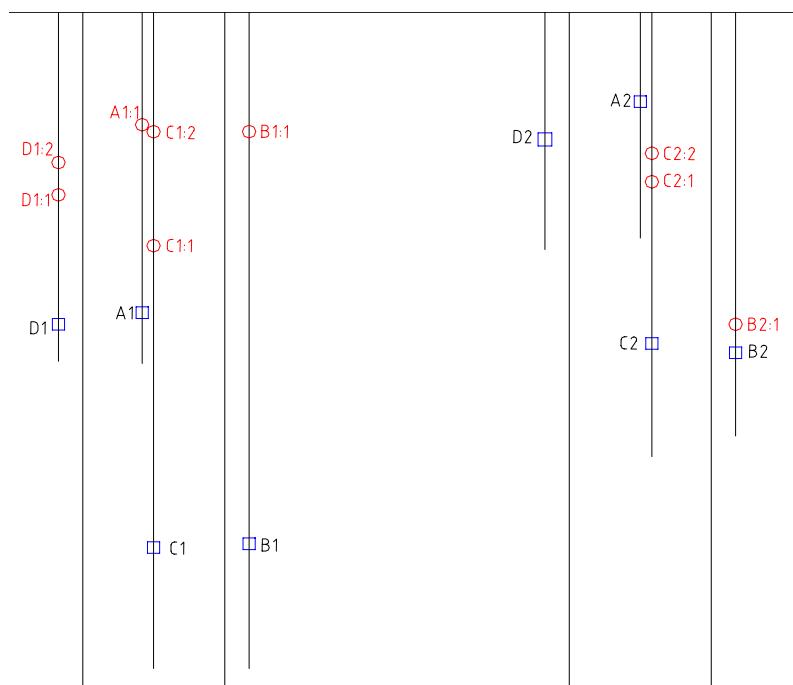

□ Biaxial stressmeter

○ Deformationmeter

**Figure 3.2 Location of instruments**



## 4 Computer processing of field data

### 4.1 Evaluation of stresses

The stress changes are evaluated from the measured deformations registered by the vibrating wires.

#### 4.1.1 Radial deformations

Radial deformation for each of the strings are calculated with the equation:

$$V_r = (R_1 - R_0) * \text{Gagefactor} \quad (\text{in. or mm})$$

$V_r$  = Radial deformation for each of the strings

$R_1$  = Deformation reading in digits (= frequency<sup>2</sup> / 1000)

$R_0$  = Deformation zero reading in digits (= frequency<sup>2</sup> / 1000)

#### 4.1.2 Calculation of deformation to stresses

The magnitude and the direction of the stress changes are determined from the measured radial deformation of the sensor in three directions.

The equations below give the magnitude and the direction of the maximum stress increase and reduction in a plane perpendicular to the borehole axes:

##### Maximal stress increase

$$p = \frac{1}{2} \left[ \frac{1}{3B} \left( (2V_{r_1} - V_{r_2} - V_{r_3})^2 + 3(V_{r_2} - V_{r_3})^2 \right)^{\frac{1}{2}} + \frac{1}{3A} (V_{r_1} + V_{r_2} + V_{r_3}) \right]$$

$V_{r_1}$  = Radial deformation for string 1

$V_{r_2}$  = Radial deformation for string 2

$V_{r_3}$  = Radial deformation for string 3

$A, B$  = Coefficients depending on the sensor geometry and the  
material properties

##### Maximal stress reduction

$$q = \left[ \frac{1}{3A} (V_{r_1} + V_{r_2} + V_{r_3}) - p \right]$$

### The angle of the maximal stress increase

The angle in the plane perpendicular to the borehole axes is measured clockwise from the tangential direction of the canister hole.

$$\theta = \frac{1}{2} \cos^{-1} \left[ \frac{V_{r_1} - A(p+q)}{B(p-q)} \right]$$

## **4.2 Evaluation of strain**

Nine strain gages were installed in the same boreholes as the biaxial stressmeters.

### **4.2.1 Calculation of strain**

Strain measurement were calculated as temperature compensated load related strain with the following equation:

$$\mu_{true} = (R_1 - R_0) * B + (T_1 - T_0)(C_1 - C_2)$$

$\mu_{true}$ = temperature compensated microstrain

$R_1$  and  $R_0$ =Digits reading

$B$  = batch calibration factor

$C_1$  and  $C_2$  are the coefficients of expansion of steel and concrete, 12.2 microstrian/ $C^\circ$  and 8.5 microstrain/ $C^\circ$ .

## **4.3 Material parameters**

Material parameters used in the calculations are as the following:

- Young's modulus of intact rock 69 Gpa
- Poisson's ratio of intact rock 0.25
- Coefficients of expansion of steel 12.2 microstrain/  $C^\circ$
- Coefficients of expansion of concrete 8.5 microstrain/ $C^\circ$

## **4.4 Processing**

The raw data registered have been processed in Microsoft Excel software. The calculation and evaluation gathered from the deformations in the plane perpendicular to the borehole axes are presented as:

Temperature

Radial deformation of the three pairs of wires in plane perpendicular to borehole axes

Maximal stress increases and stress reduction in plane perpendicular to borehole axes

Orientation of maximal stress increase in plane perpendicular to borehole axes

Strain measurement

## 5 Results

A summary of the results of the stress changes is presented in Table 1. These values represent total changes in stress magnitude and stress orientation during each reporting period during phase 2 (heating) together with maximum changes in stress magnitude and orientation recorded during phase 1 (drilling). Figure 5.1 presents graphically the maximum typical changes in stress magnitude and orientation during this reporting period from 2005-05-01 to 2005-10-31. These results are not compensated for temperature changes, nor are they compensated for longitudinal stress changes.

Although the measurements of stress meters are affected by temperature, the temperature compensated results of stress meters are not presented in this report because a further detailed study of the relationship between temperature and stress meter measurements will be required in order to quantify these effects. In addition, the longitudinal stress changes are affected by temperature changes and for this reason these longitudinal measurements are not currently used for determination of radial stresses. Results of the biaxial stress meters without temperature or longitudinal stress compensation, and the strain meters with temperature compensation from each borehole for the period 2005-05-01 to 2005-10-31 are summarized on the diagrams in section 5.1 and 5.2.

The diagrams in section 5.1 and 5.2 for each borehole display:

- Maximum stress increases and stress reductions in plane perpendicular to borehole axes.
- Orientation of maximum stress increase in plane perpendicular to borehole axes.
- Strain measurements presented in the diagrams are temperature-compensated with the unit of micro strain. Positive values represent elongation.

The data during this reporting period indicate that:

- The temperature is inhomogeneous around these two canister holes.

### Hole 1

The temperature varies with values from 67 to 69°C around canister hole 1. The temperature is stable or somewhat increasing but only by about 1°C.

There are no values from either set of vibrating wires (1-3) or (4-6) in stress meter A1, B1, C1 or D1. Sensor Vr1 in biaxial stress meter C1 was displaying disturbances towards the end of last period and stopped working in the beginning of this period. Due to this there are no values for maximum stress increase, reduction, or change in orientation of maximum stress around canister hole 1.

Measurements taken at the strain gauge locations generally display steady values in micro strain as well as in temperature, although there is a small tendency of increased temperature but only with about 1°C. The values have decreased somewhat at C1:1 and D1:1. The value at D1:2 have continued to decrease, but with a smaller gradient than for last period.

At C1:2 the values are somewhat unstable throughout the period, but with a small overall decrease of only 15 micro strain. The temperature at C1:2 increased with about 2°C.


## Hole 2

The temperature varies from 25°C to 36°C around canister hole 2. The tendency is decreasing temperature with about 1°C until 2005-10-13 when the temperature dramatically drops about 7°C for the more shallow instruments B2, C2, and B2:1. The changes can also be seen in MPa for stress meter C2. However, stress meter A2 and D2 show no signs of this significant change in temperature and stress.

The stress meters around canister hole 2 show small variations in stresses (1 to 2 MPa). At C2 the set of vibrating wires (4-6) stopped giving values at 2005-10-17, though the sensor was stable throughout the period until it stopped working.

There are small variations in the maximum stress increase and reduction around canister hole 2. The orientation ranges from -6,5 degrees to 38 degrees between the different sensors. The variation for each sensor is however very small.

The strain gage measurements show some disturbances in sensor C2:1 during June and July. But the readings are generally stable until 2005-10-13 when the temperature drops and the strain increases. The changes seem to continue into next period. Sensor C2:1 also shows some signs of disturbance towards the end of the period.

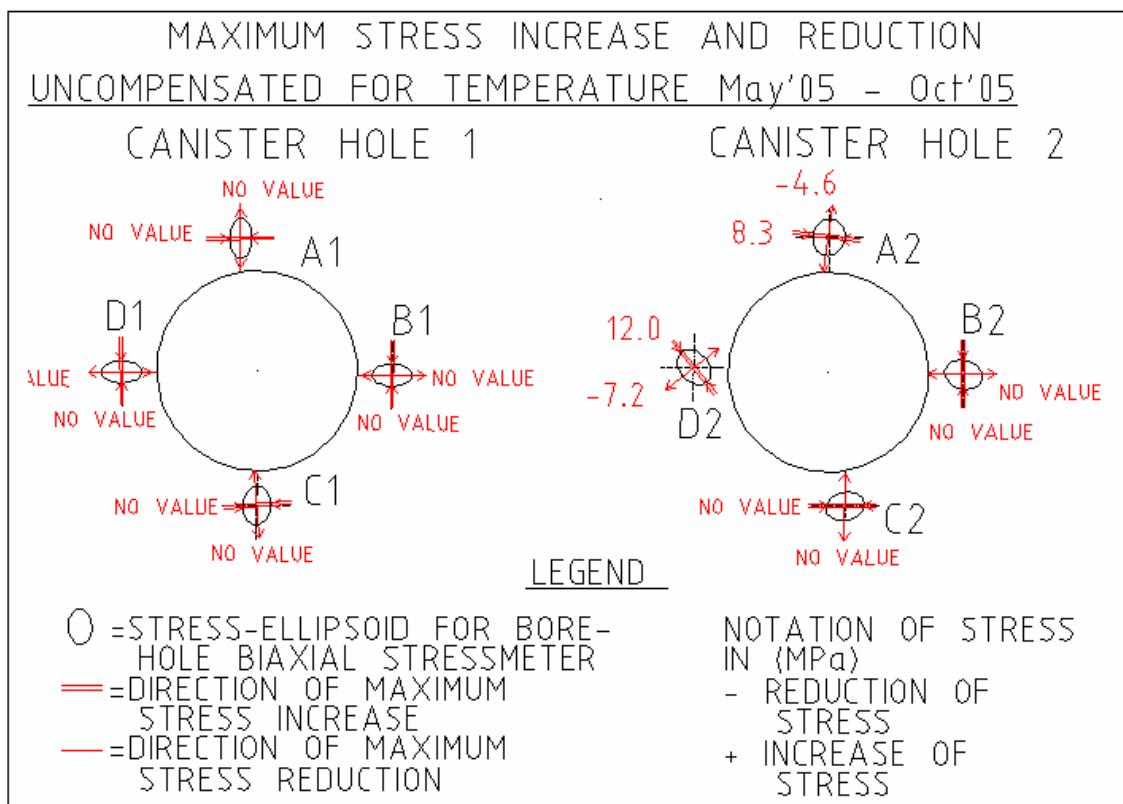

**Figure 5.1 Maximum stress changes uncompensated for temperature**

**Table 1. Summary of results for stress measurements**

Stress-meter	Measuring period								
	Phase 1: Drilling phase			Phase 2: Heating phase					
				Period: 2000-10-01 to 2001-11-30			Period: 2000-10-01 to 2001-11-30		
Typical max. stress increase (Mpa)	Typical max. stress reduction (Mpa)	Orientation of max. Stress increase (degree)	Typical max. stress increase (Mpa)	Typical max. stress reduction (Mpa)	Orientation of max. Stress increase (degree)	Typical max. stress increase (Mpa)	Typical max. stress reduction (Mpa)	Orientation of max. Stress increase (degree)	
A1	17.0	-10.0	11.5	22.7	-10.9	10.3	22.6	-10.8	10.3
B1	15.0	-11.0	17.0	21.1	-10.3	16.8	26.9	-10.5	16.8
C1	12.0	-7.4	0	21.9	-9.9	5.4	21.9	-9.8	5.4
D1	22.0	-11.0	0	25.8	-9.1	0	26.3	-9.4	0
A2	5.0	-4.0	-11.0	4.4	-3.3	-18.3	3.7	-3.3	-17.7
B2	11.0	-7.3	-7.5	31.1	-4.6	-14.1	57.9 (*)	-4.6	-21.3
C2	11.0	-7.7	29.5	29.1	-6.6	31.2	33.7 (*)	-7.6	30.2
D2	9.3	-7.2	38.5	16.5	-9.9	38.7	16.2	-9.9	38.3

Stress-meter	Measuring period			Measuring period			Measuring period		
	Phase 2: Heating phase con't (see Note 5)			Phase 2: Heating phase con't			Phase 2: Heating phase con't		
	Period: 2002-05-01 to 2002-10-31			Period: 2002-11-01 to 2003-04-30			Period: 2003-05-01 to 2003-10-31		
	Typical max. stress increase (Mpa)	Typical max. stress reduction (Mpa)	Orientation of max. Stress increase (degree)	Typical max. stress increase (Mpa)	Typical max. stress reduction (Mpa)	Orientation of max. Stress increase (degree)	Typical max. stress increase (Mpa)	Typical max. stress reduction (Mpa)	Orientation of max. Stress increase (degree)
A1	23.3	-11.0	10.4	34.7(*)	-17	5.7	38.7	-13.7	6.1
B1	21.1	-10.6	15.9	34(*)	-9.6	17.1	51 to 68	5 to 34	5 to 19
C1	22.3	-10.4	5.3	34(*)	-9.1	5.7	41.5	-5.2	5.2 to 6.6
D1	27.3	-9.7	-2.9	45(*)	-5.6	-4.3	60.3	4.8	-3.2 to -4.9
A2	4.3	-3.9	-13.9	3.5	-3.5	-9(*)	6.9	-4.3	-7.4
B2	34 to 57	4 to 21	-0.6 to -8	32 to 54	6 to 22	-1 to -10	53.2	23.2	-10.7
C2	50 to 71	5.3 to 22.7	22 to 33	48 to 70	6 to 26	19 to 33	53 to 74	8 to 31	16 to 32
D2	16.0	-10.1	38.7	15	-9	38	12.4	-8.1	38

**Notes:**

- Positive values of stress indicate compression, negative values of stress indicate extension.
- Positive values of orientation indicate anti-clockwise rotation, negative values of orientation indicate clockwise rotation.
- Typical maximum stress increases and reductions represent maximum stabilised readings during the measuring period.
- (\*) indicates that the reading had not stabilised during the measuring period.
- Orienaataion of maximum stress increase is the orientation that corresponds to the typical maximum stress increase.
- Calculation and processing methods revised during this reporting period to eliminate compensation for both temperature and longitudinal strains until further studies on these effftcs are carried out.


Stress-meter	Measuring period			Measuring period			Measuring period		
	Phase 2: Heating phase con't			Phase 2: Heating phase con't			Phase 2: Heating phase con't		
	Period: 2003-11-01 to 2004-04-30			Period: 2004-05-01 to 2004-10-31			Period: 2004-11-01 to 2005-04-30		
	Typical max. stress increase (Mpa)	Typical max. stress reduction (Mpa)	Orientation of max. Stress increase (degree)	Typical max. stress increase (Mpa)	Typical max. stress reduction (Mpa)	Orientation of max. Stress increase (degree)	Typical max. stress increase (Mpa)	Typical max. stress reduction (Mpa)	Orientation of max. Stress increase (degree)
A1	47,3	1,3	4,0 to 4,7	no value	no value	no value	no value	no value	no value
B1	no value	no value	-89,7 to 0,1	no value	no value	no value	no value	no value	no value
C1	46,0	10,0	4,3 to 9,4	48,2	3,1	3,8	46,7	3,2	3,8
D1	82,0	31,7	-9,5 to 0,6	no value	no value	no value	no value	no value	no value
A2	6,7	-4,3	-7,0	6,9	-4,8	-7,2 to -7,7	6,6	-4,5	-7,8 to -8
B2	50,8	23,0	-4,9 to -59,7	52,0	23,8	-11,2	55,9(**)	27,2(**)	-16,1(**)
C2	51,5	32,7	14,1 to 59,3	52,2	34,0	13,3	50,9	33,7	12,5
D2	12,1	-7,7	37,9	12,3	-7,8	38,1 to 38,8	10,8	-6,8	38,1 to 33,8

Stress-meter	Measuring period			Measuring period			Measuring period		
	Phase 2: Heating phase con't			Phase 2: Heating phase con't			Phase 2: Heating phase con't		
	Period: 2005-05-01 to 2005-10-31			Period: 2005-05-01 to 2005-10-31			Period: 2005-05-01 to 2005-10-31		
	Typical max. stress increase (Mpa)	Typical max. stress reduction (Mpa)	Orientation of max. Stress increase (degree)	Typical max. stress increase (Mpa)	Typical max. stress reduction (Mpa)	Orientation of max. Stress increase (degree)	Typical max. stress increase (Mpa)	Typical max. stress reduction (Mpa)	Orientation of max. Stress increase (degree)
A1	no value	no value	no value						
B1	no value	no value	no value						
C1	no value	no value	no value						
D1	no value	no value	no value						
A2	8,3	-4,6	-6,1 to -6,7						
B2	no value	no value	no value						
C2	no value	no value	no value						
D2	12,0	-7,2	38,6 to 40,0						

**Notes:**



- Positive values of stress indicate compression, negative values of stress indicate extension.
- Positive values of orientation indicate anti-clockwise rotation, negative values of orientation indicate clockwise rotation.
- Typical maximum stress increases and reductions represent maximum stabilised readings during the measuring period.  
(\*) indicates that the reading had not stabilised during the measuring period.
- Orienaataion of maximum stress increase is the orientation that corresponds to the typical maximum stress increase.
- Calculation and processing methods revised during this reporting period to eliminate compensation for both temperature and


## 5.1 Results of canister hole 1

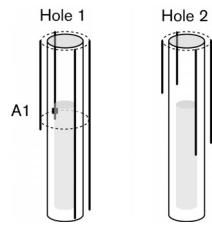

### 5.1.1 Stress change for each biaxial stressmeter


Biaxial stressmeter A1 uncompensated for temperature:

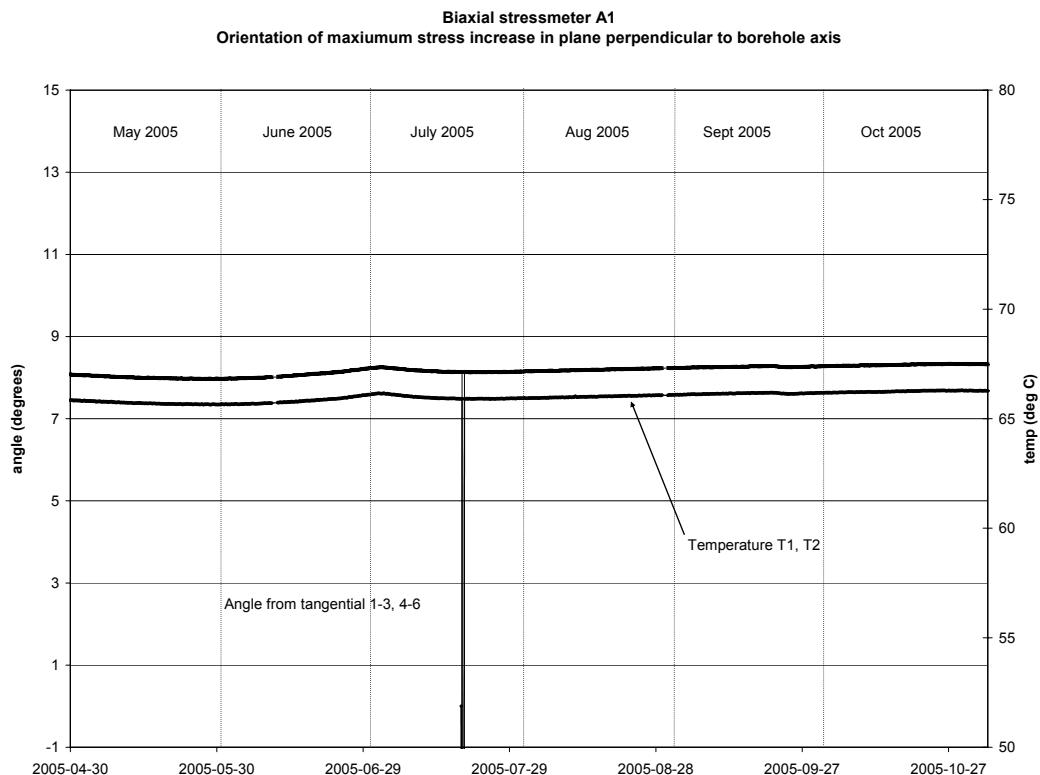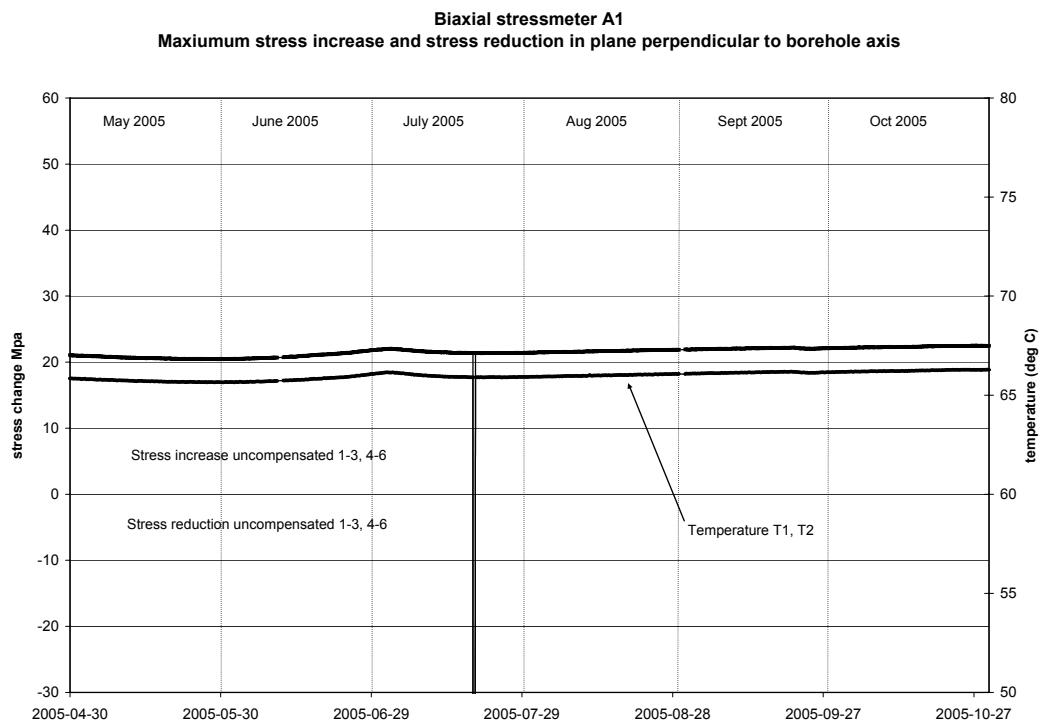

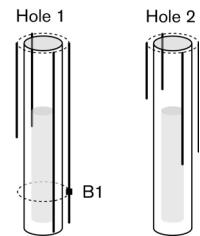



### **Biaxial stressmeter B1 uncompensated for temperature:**

**Biaxial stressmeter B1  
Maximum stress increase and stress reduction in plane perpendicular to borehole axis**

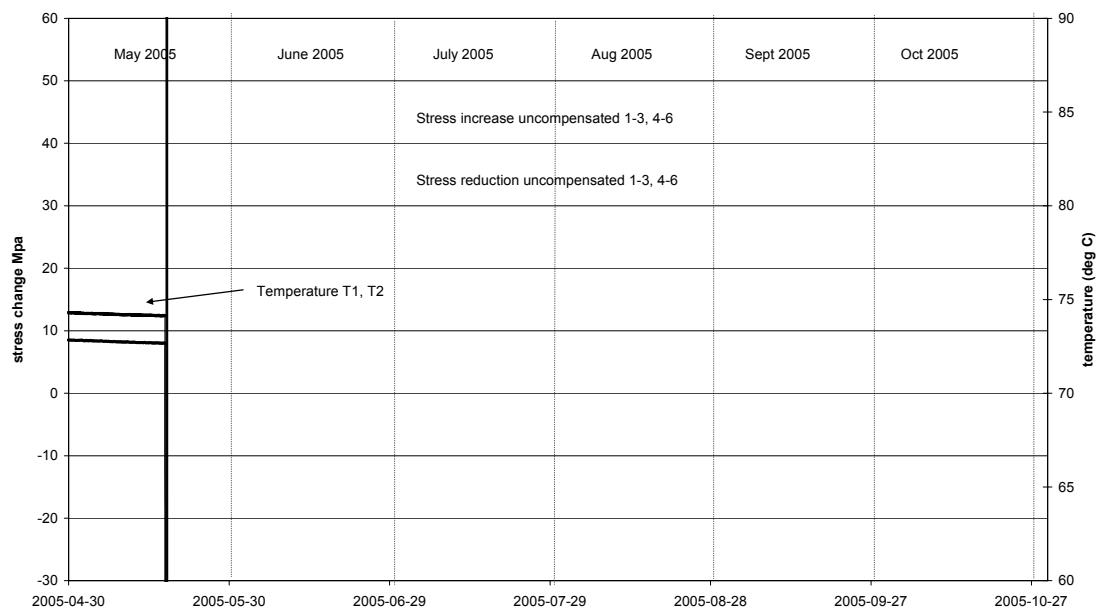


**Biaxial stressmeter B1  
Orientation of maximum stress increase in plane perpendicular to borehole axis**

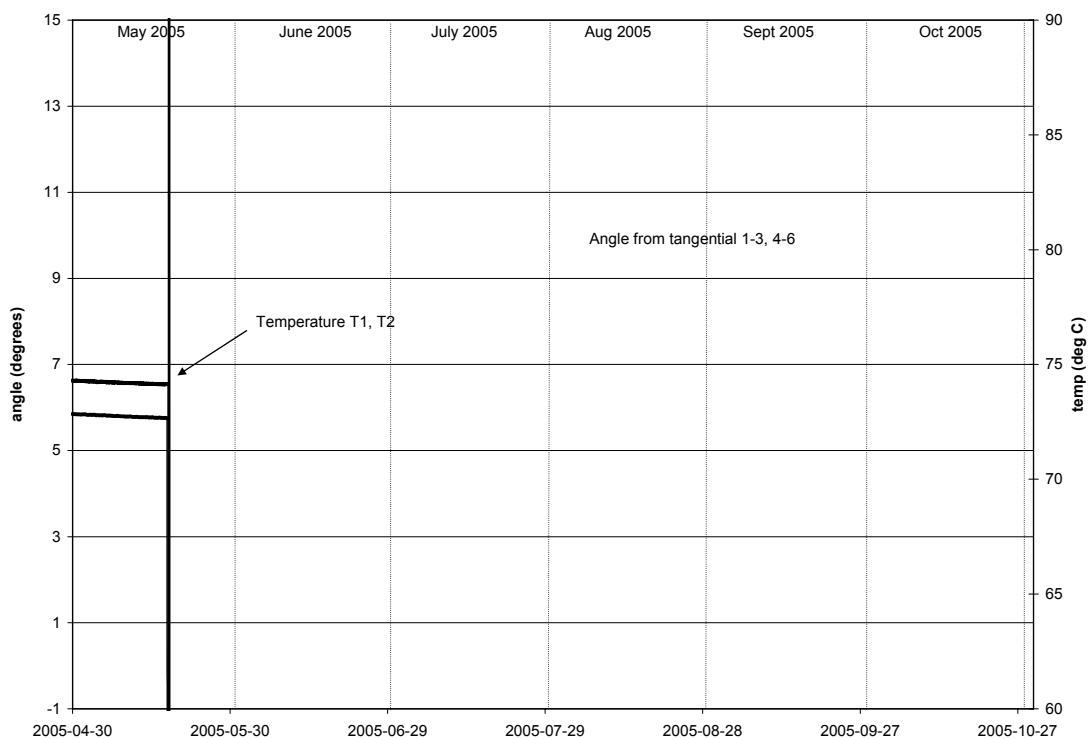


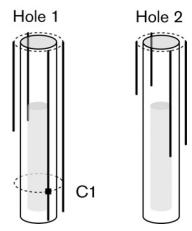


### Biaxial stressmeter C1 uncompensated for temperature:

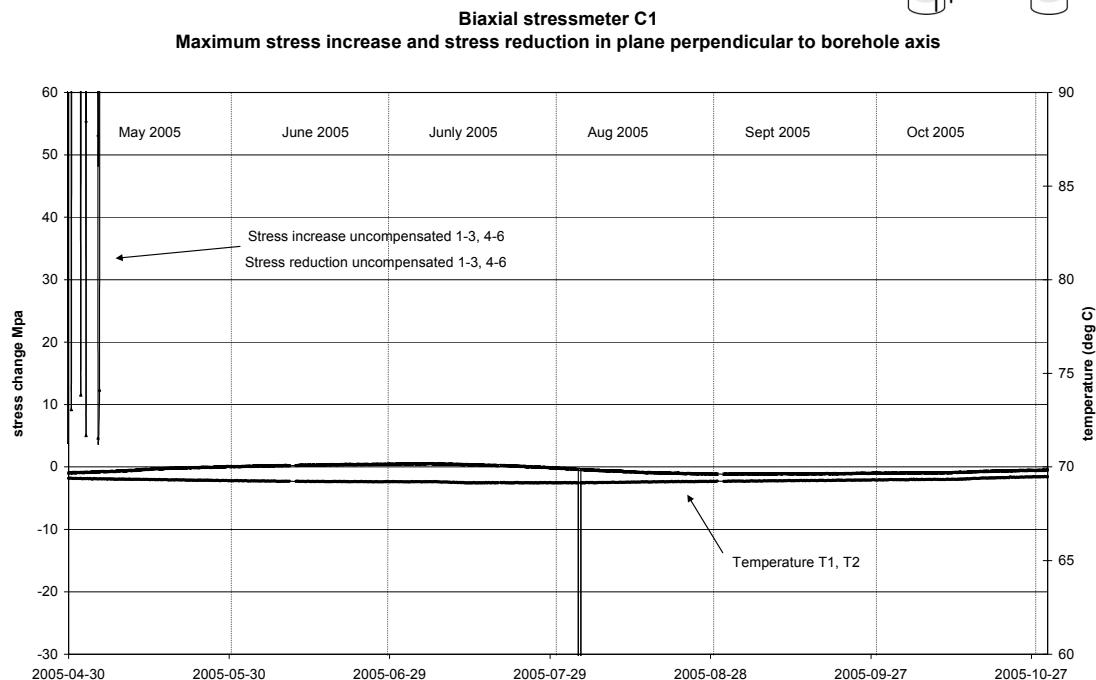


**Biaxial stressmeter C1**  
Orientation of maximum stress increase in plane perpendicular to borehole axis

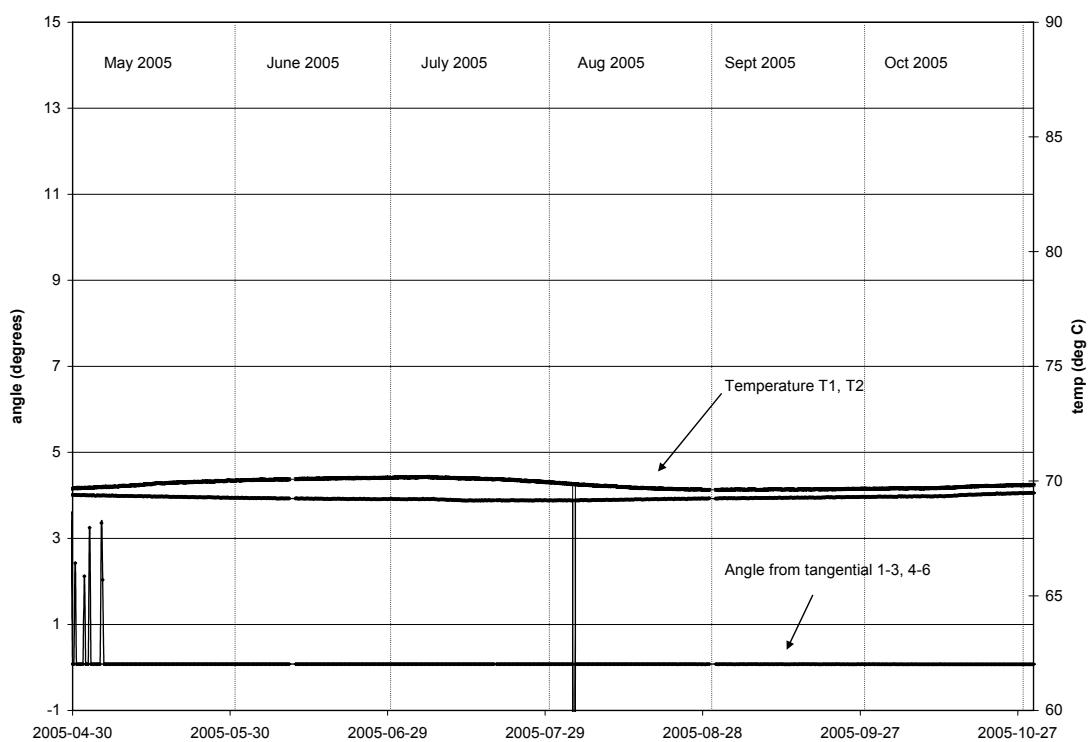


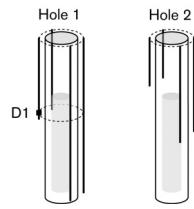


### Biaxial stressmeter D1 uncompensated for temperature:

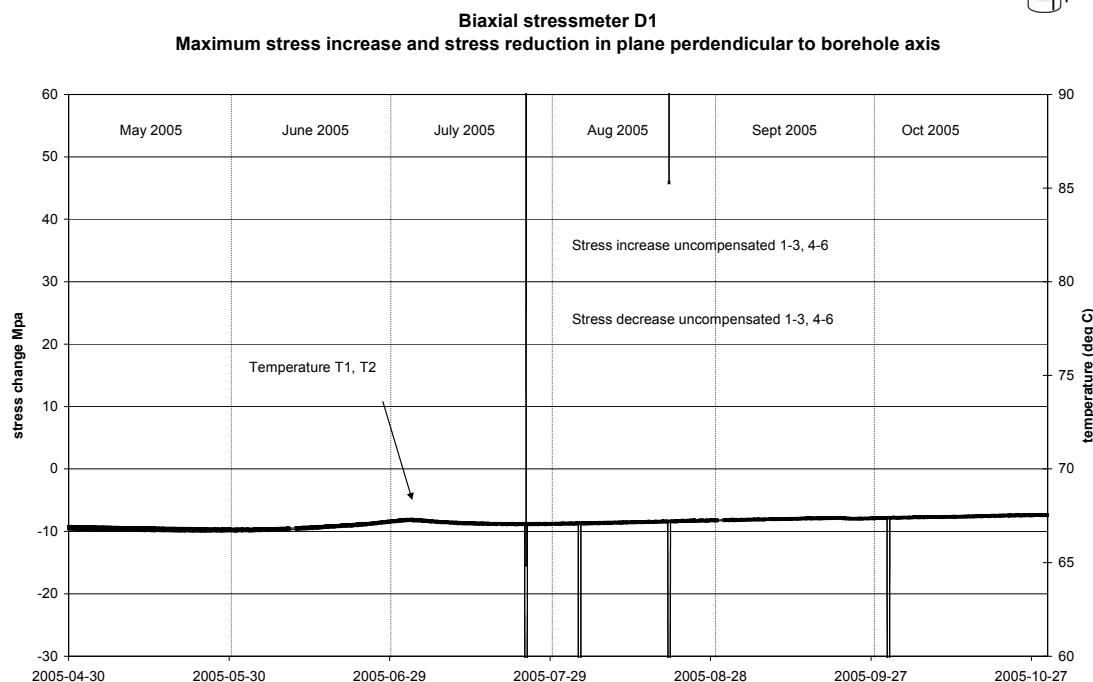


**Biaxial stressmeter D1**  
Orientation of maximum stress increase in plane perpendicular to borehole axis

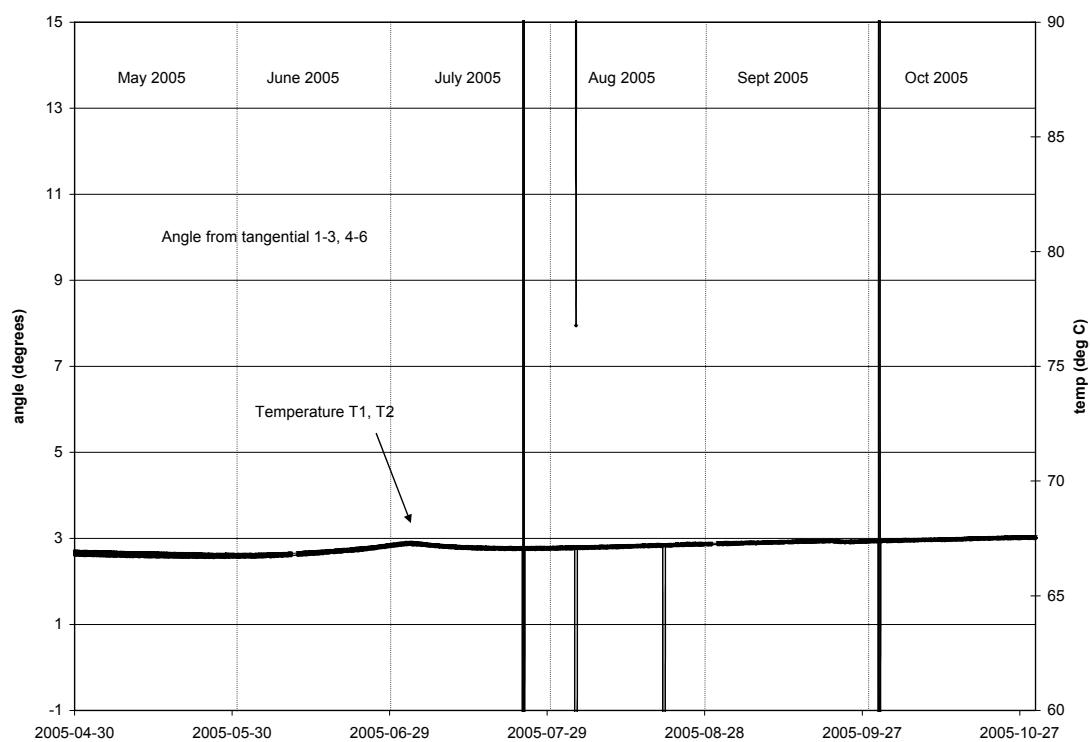

### 5.1.2 Strainmeter A1:1, B1:1, C1:1, D1:1, D1:2 (temperature compensated)

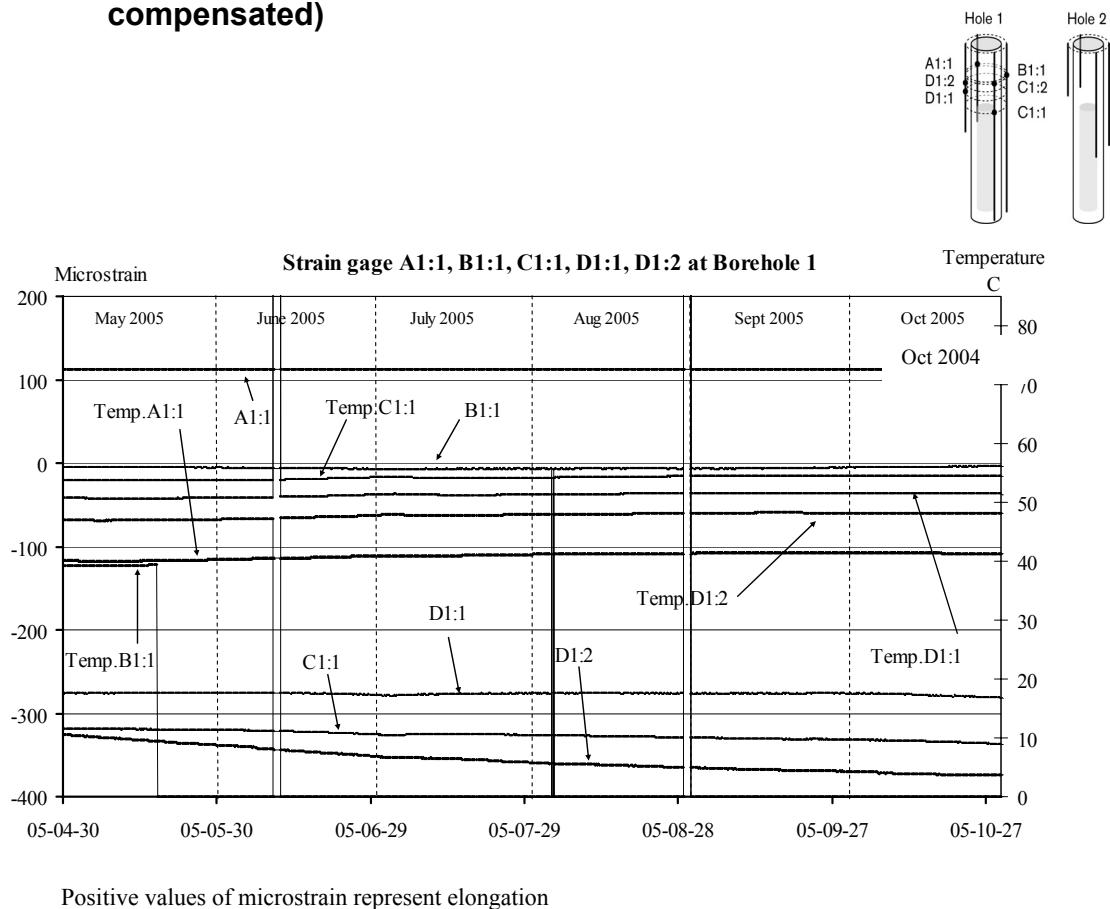


### 5.1.3 Strainmeter C1:2 (temperature compensated)

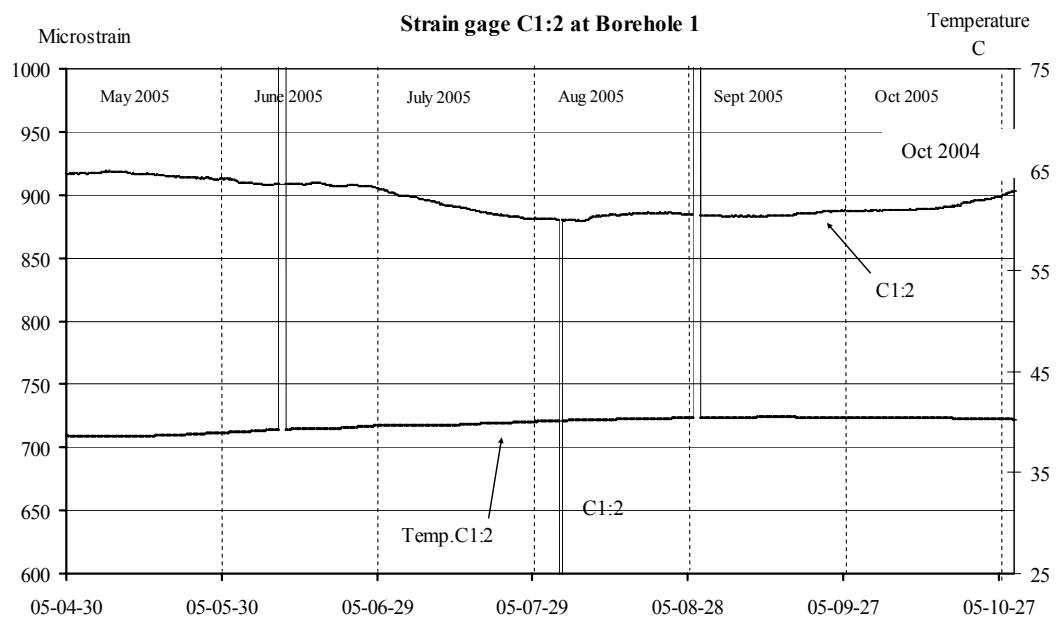



Positive values of microstrain represent elongation


## Results of canister hole 2

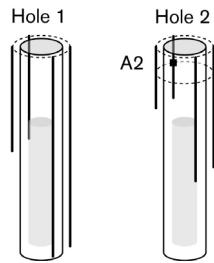


### 5.1.4 Stress change for each biaxial stressmeter

#### Biaxial stressmeter A2 uncompensated for temperature:

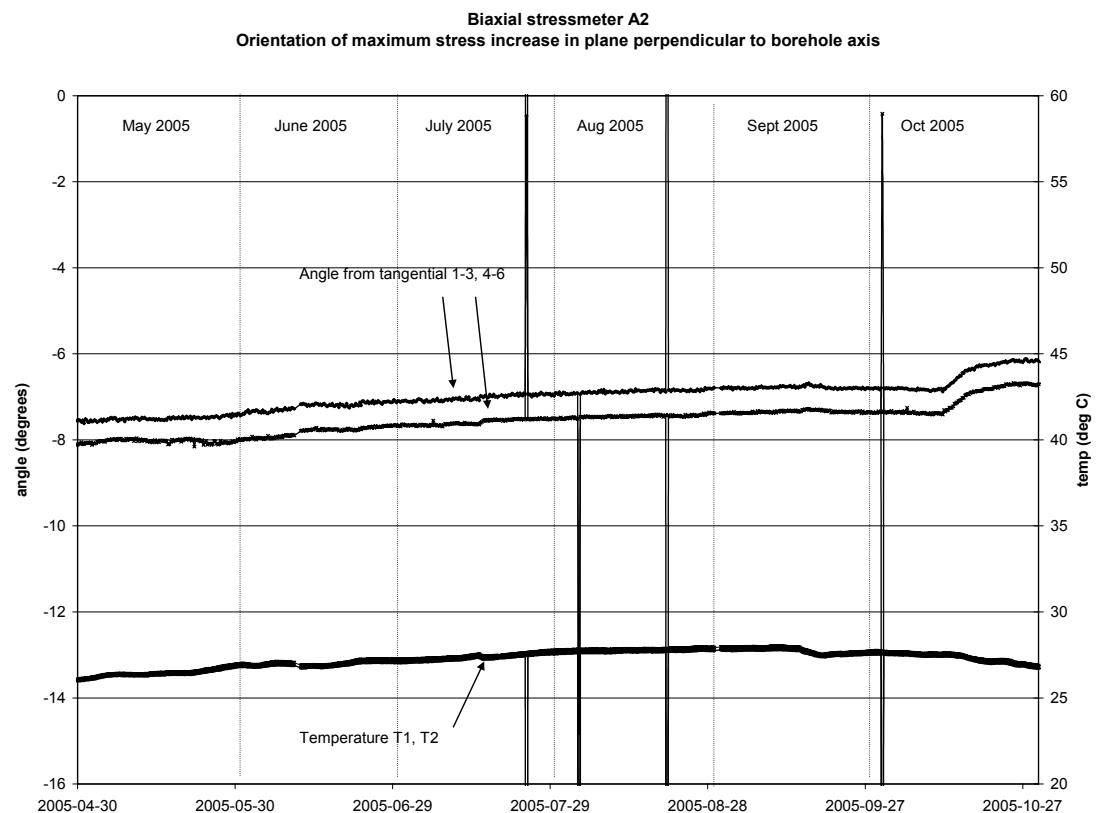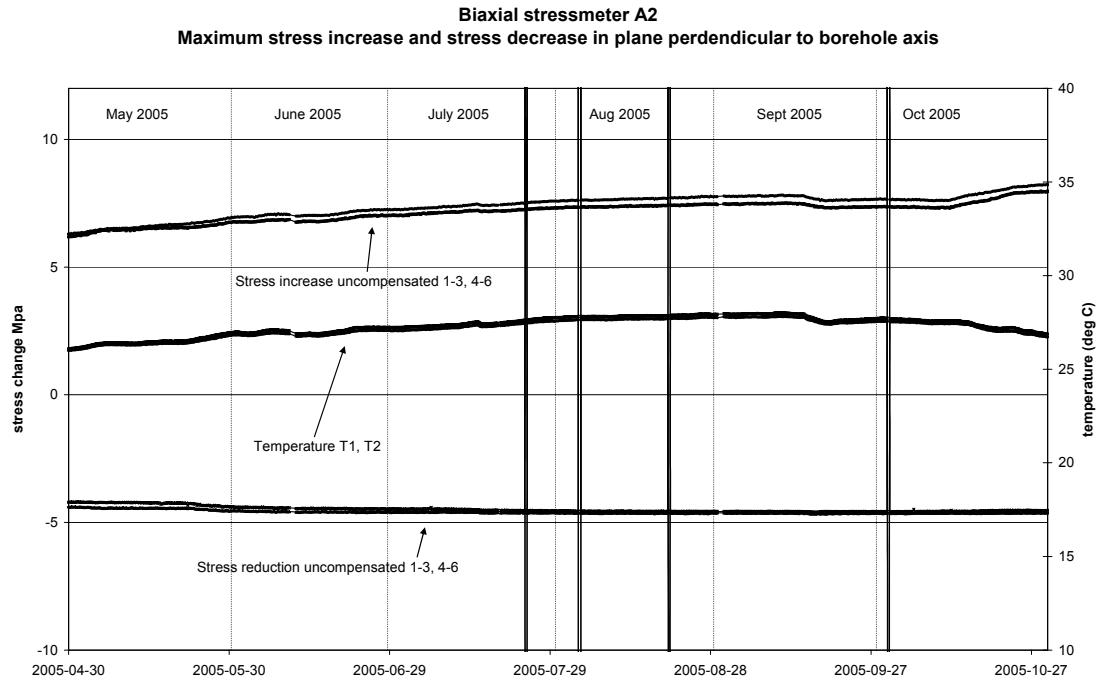


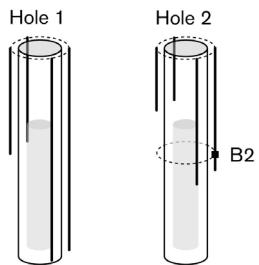


### Biaxial stressmeter B2 uncompensated for temperature:

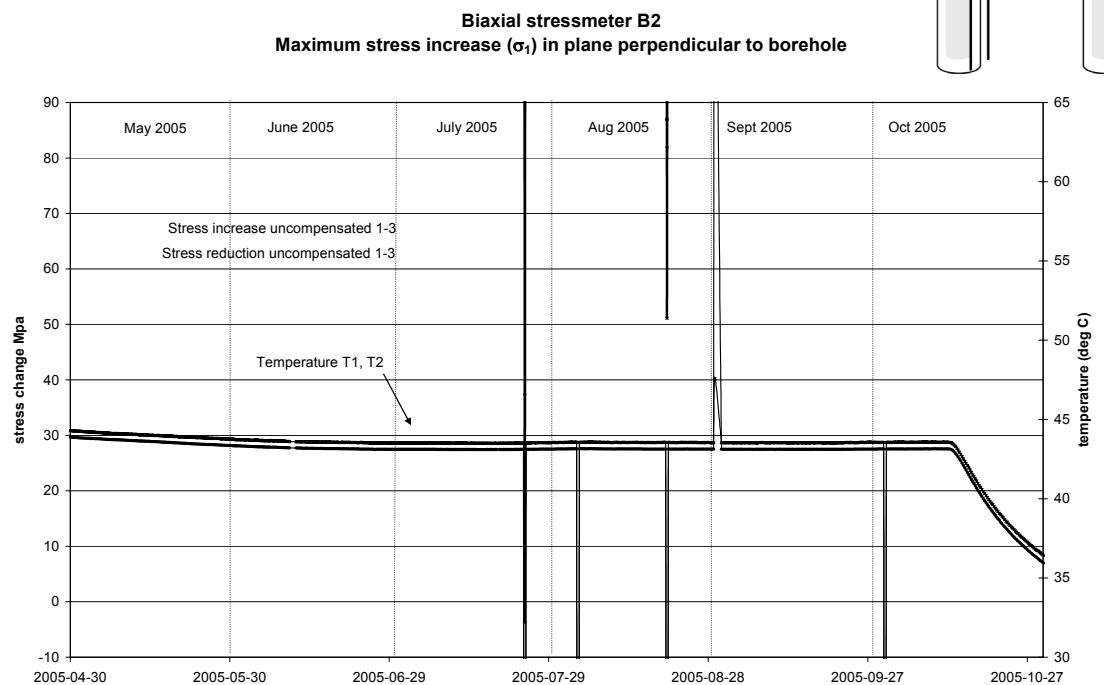


**Biaxial stressmeter B2**  
Orientation of maximum stress increase ( $\sigma_1$ ) in plane perpendicular to borehole

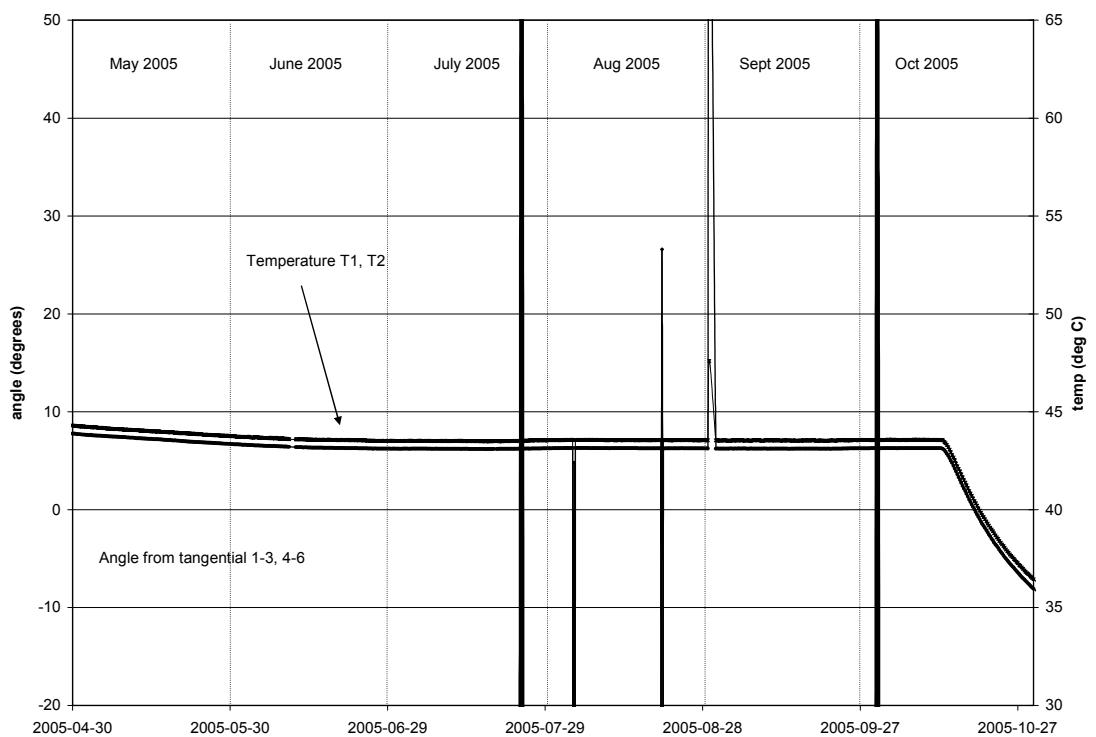


### Biaxial stressmeter C2 uncompensated for temperature:

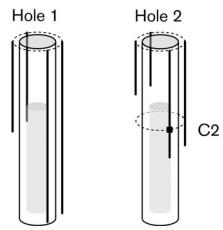


**Biaxial stressmeter C2**  
Maximum stress increase and stress reduction in plane perpendicular to borehole axis

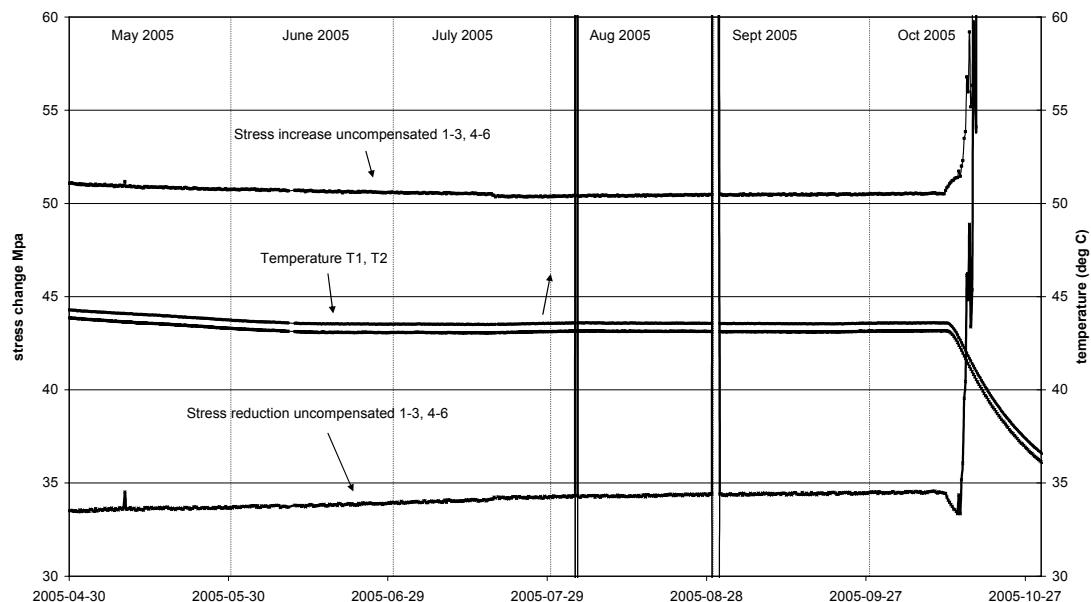


**Biaxial stressmeter C2**  
Orientation of maximum stress increase in plane perpendicular to borehole axis

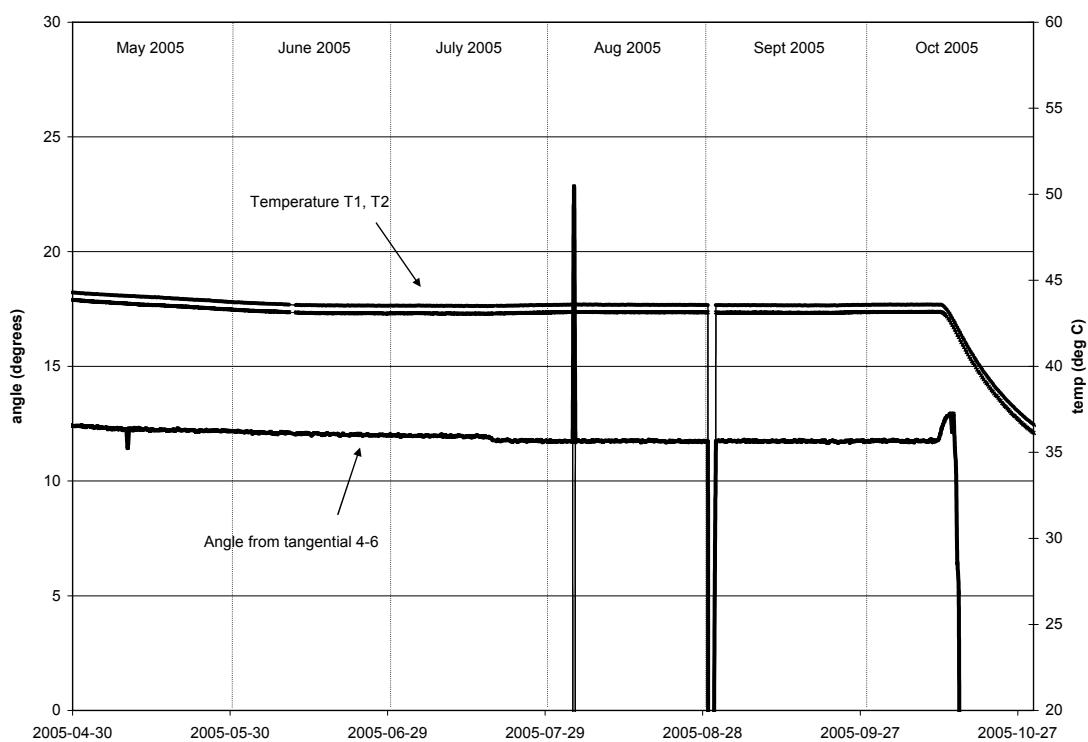

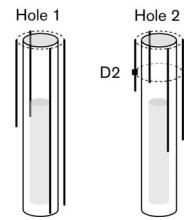


### Biaxial stressmeter D2 uncompensated for temperature:



**Biaxial stressmeter D2**  
Maximum stress increase and stress reduction in plane perpendicular to borehole axis

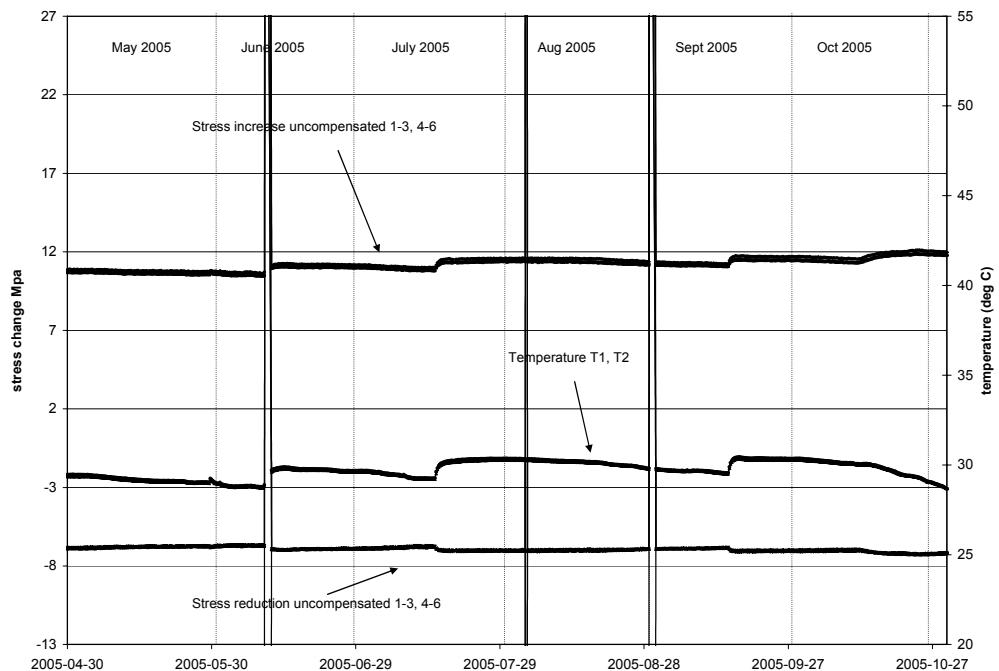

**Biaxial stressmeter D2**  
Orientation of maximum stress increase in plane perpendicular to borehole axis

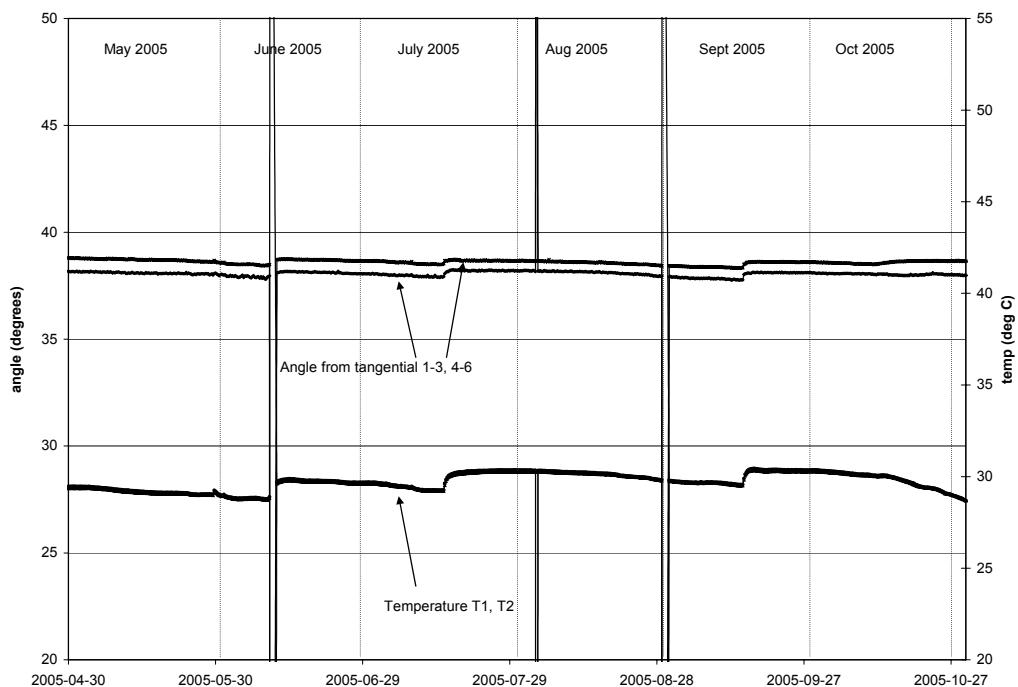

### 5.1.5 Strainmeter B2:1, C2:1, C2:2 (temperature compensated)

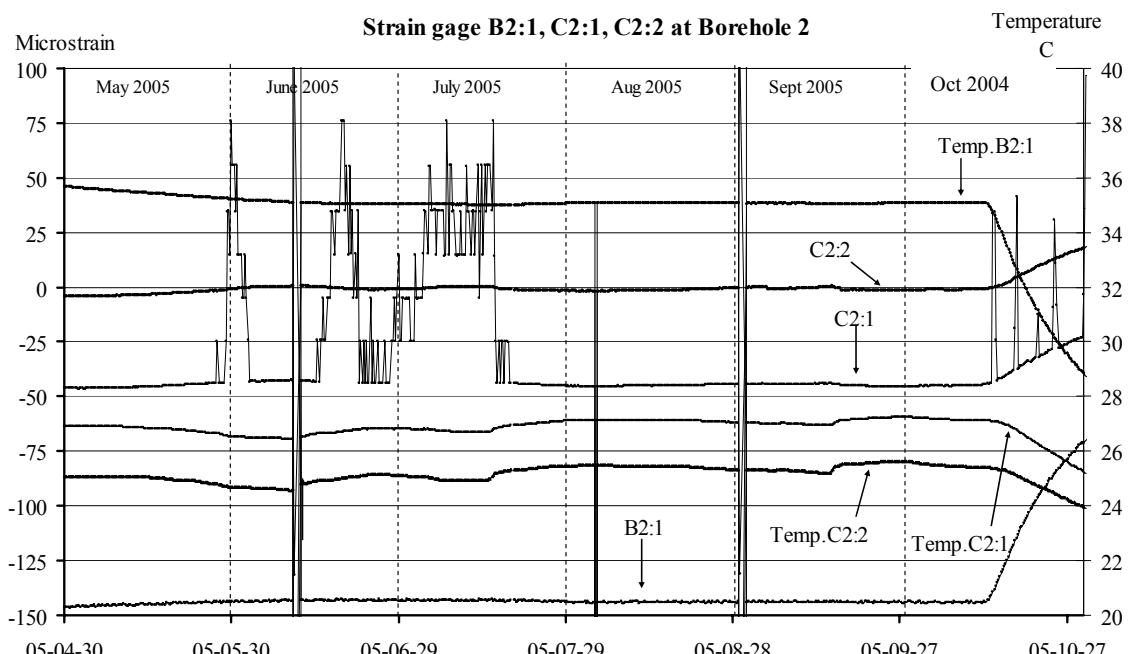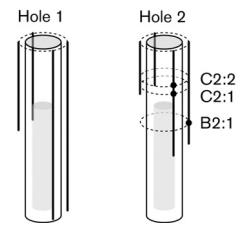

Positive values of microstrain represent elongation